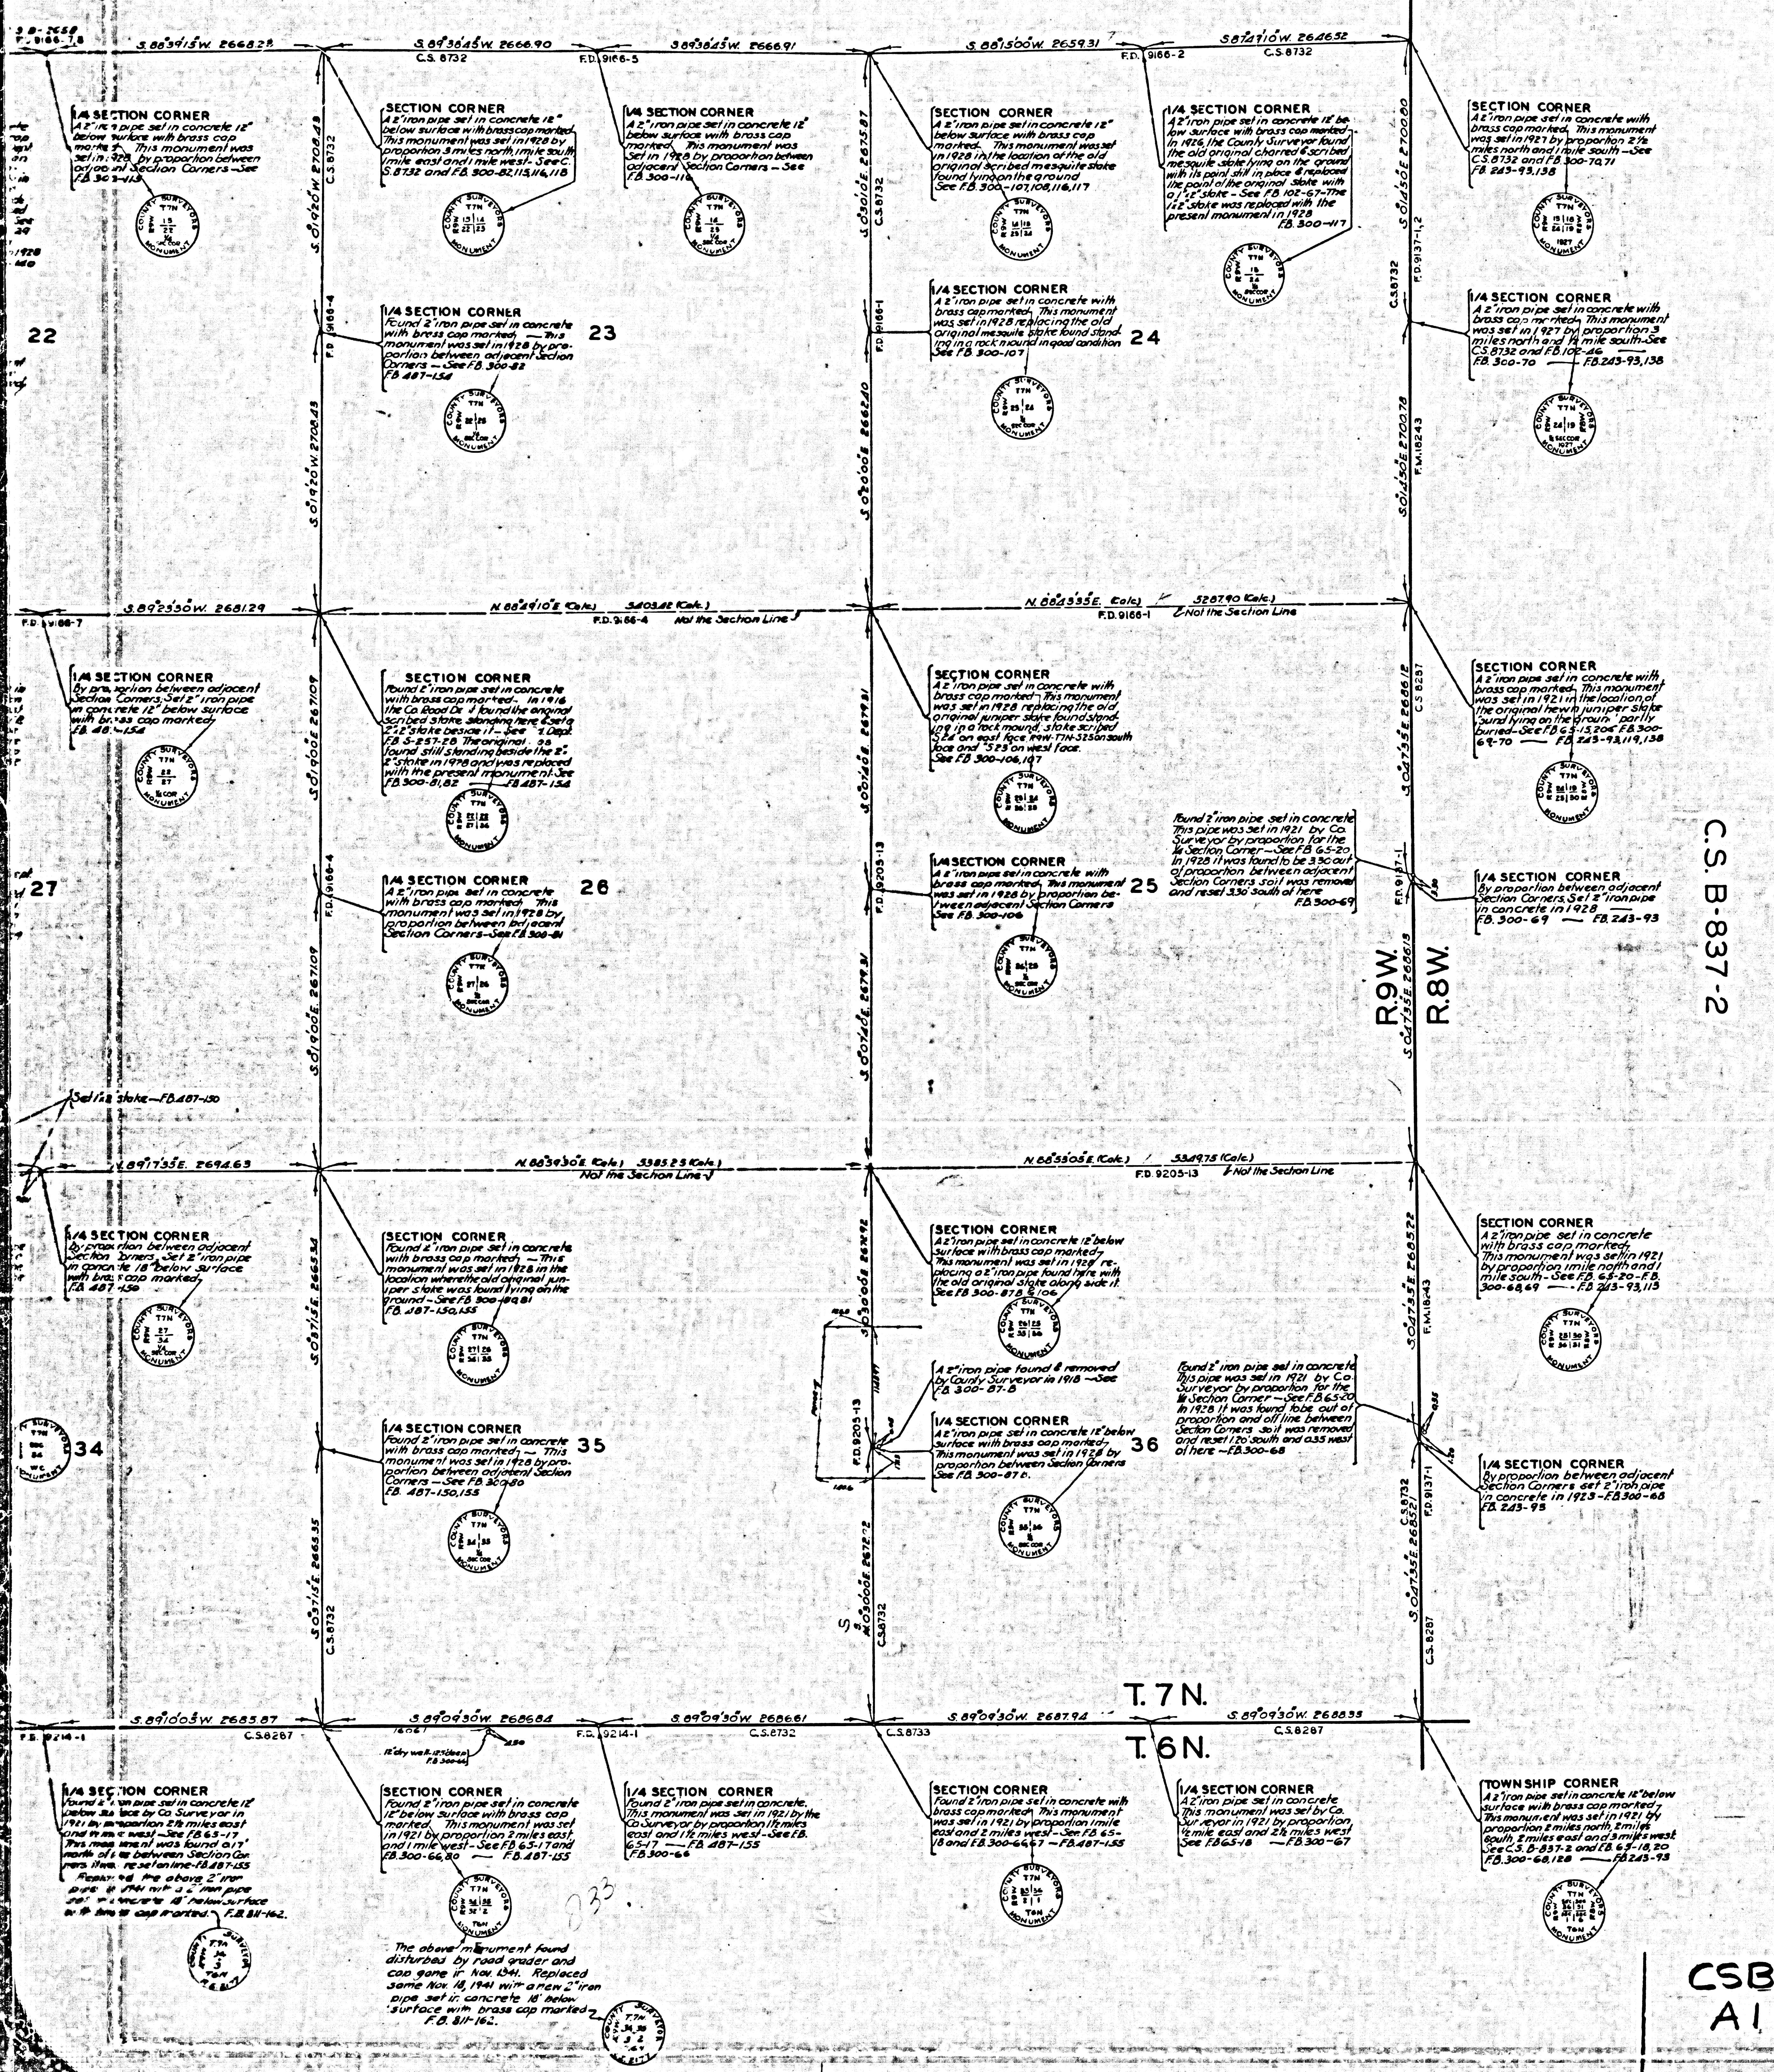
S.88°39'15"W. 2668.29
S.89°38'45"W. 2666.90
C.S. 8732
F.D. 9166-5
S.89°38'45"W. 2666.91
S.88°15'00"W. 2659.31
F.D. 9166-2
S.87°47'10"W. 2646.52
C.S.8732
S.01°19'20"W. 2708.43
F.D. 9166-4
S.03°01'0"E. 2675.87
F.D. 9166-1
S.02°00'00"E. 2662.40
S.01°45'50"E. 2700.80
F.D.9137-1,2
S.01°45'50"E. 2700.78
F.M.18243
22
23
24
S.89°23'30"W. 2681.29
F.D. 9166-7
N.88°49'10"E. (Calc.)
5403.42 (Calc.)
F.D. 9166-4
Not the Section Line
N.88°43'35"E. (Calc.)
5287.90 (Calc.)
F.D. 9166-1
Not the Section Line
S.01°19'00"E. 2671.09
S.00°07'40"E. 2679.91
F.D. 9205-13
S.04°47'35"E. 2686.12
C S 8287
S.04°47'35"E. 2686.13
F.D. 9137-1
27
26
25
R.9W.
R.8W.
C.S. B-837-2
N.89°17'35"E. 2694.63
N.88°39'30"E. (Calc.)
5385.23 (Calc.)
Not the Section Line
N.88°53'05"E. (Calc.)
5349.75 (Calc.)
F.D. 9205-13
Not the Section Line
S.03°7'15"E. 2665.34
S.03°7'15"E. 2665.35
C.S.8732
S.03°00'00"E. 2672.92
F.D. 9205-13
S.03°00'00"E. 2672.22
C.S.8732
S.04°47'35"E. 2685.22
F.M.18243
S.04°47'35"E. 2685.21
C.S.8732
F.D. 9137-1
C.S. 8287
34
35
36
S.89°10'03"W. 2685.87
F.B. 9214-1
C.S.8287
S.89°09'30"W. 2686.84
1606.7
12" dry well-12.5' deep F.B 300-66
F.D. 9214-1
S.89°09'30"W. 2686.61
C.S.8732
C.S.8733
S.89°09'30"W. 2687.94
S.89°09'30"W. 2688.33
C.S.8287
T. 7 N.
T. 6 N.
COUNTY SURVEYORS MONUMENT
T7N
R9W

1/4 SECTION CORNER
A 2" iron pipe set in concrete 12" below surface with brass cap marked. This monument was set in 1928 by proportion between adjacent Section Corners — See F.B. 300-115

SECTION CORNER
A 2" iron pipe set in concrete 12" below surface with brass cap marked. This monument was set in 1928 by proportion 3 miles north, 1 mile south, 1 mile east and 1 mile west - See C.S. 8732 and F.B. 300-82, 115, 116, 118

1/4 SECTION CORNER
A 2" iron pipe set in concrete 12" below surface with brass cap marked. This monument was Set in 1928 by proportion between adjacent Section Corners — See F.B. 300-116

SECTION CORNER
A 2" iron pipe set in concrete 12" below surface with brass cap marked. This monument was set in 1928 in the location of the old original scribed mesquite stake found lying on the ground See F.B. 300-107, 108, 116, 117

1/4 SECTION CORNER
A 2" iron pipe set in concrete 12" below surface with brass cap marked. In 1926, the County Surveyor found the old original charred & scribed mesquite stake lying on the ground with its point still in place & replaced the point of the original stake with a 1"x2" stake - See F.B. 102-67 - The 1x2" stake was replaced with the present monument in 1928
F.B. 300-117

SECTION CORNER
A 2" iron pipe set in concrete with brass cap marked. This monument was set in 1927 by proportion 2½ miles north and 1 mile south — See C.S. 8732 and F.B. 300-70, 71
F.B. 243-93, 138

1/4 SECTION CORNER
Found 2" iron pipe set in concrete with brass cap marked — This monument was set in 1928 by proportion between adjacent Section Corners — See F.B. 300-82
F.B. 487-154

1/4 SECTION CORNER
A 2" iron pipe set in concrete with brass cap marked. This monument was set in 1928 replacing the old original mesquite stake found standing in a rock mound in good condition See F.B. 300-107

1/4 SECTION CORNER
A 2" iron pipe set in concrete with brass cap marked. This monument was set in 1927 by proportion 3 miles north and ½ mile south - See C.S. 8732 and F.B. 102-46
F.B. 300-70 — F.B. 243-93, 138

1/4 SECTION CORNER
By proportion between adjacent Section Corners; Set 2" iron pipe in concrete 12" below surface with brass cap marked.
F.B. 487-154

SECTION CORNER
Found 2" iron pipe set in concrete with brass cap marked. In 1916 the Co. Road Dept. found the original scribed stake standing here & set a 2"x2" stake beside it - See Rd. Dept. F.B. S-257-28 The original was found still standing beside the 2"x2" stake in 1928 and was replaced with the present monument. See F.B. 300-81, 82 — F.B. 487-154

SECTION CORNER
A 2" iron pipe set in concrete with brass cap marked. This monument was set in 1928 replacing the old original juniper stake found standing in a rock mound; stake scribed "S24" on east face, "R9W-T7N-S25" on south face and "S23" on west face.
See F.B. 300-106, 107

SECTION CORNER
A 2" iron pipe set in concrete with brass cap marked. This monument was set in 1921 in the location of the original hewn juniper stake found lying on the ground partly buried - See F.B. 65-15, 20 & F.B. 300-69-70 — F.B. 243-93, 119, 138

1/4 SECTION CORNER
A 2" iron pipe set in concrete with brass cap marked. This monument was set in 1928 by proportion between adjacent Section Corners — See F.B. 300-81

1/4 SECTION CORNER
A 2" iron pipe set in concrete with brass cap marked. This monument was set in 1928 by proportion between adjacent Section Corners See F.B. 300-106

Found 2" iron pipe set in concrete This pipe was set in 1921 by Co. Surveyor by proportion for the ¼ Section Corner — See F.B. 65-20 In 1928 it was found to be 3.30' out of proportion between adjacent Section Corners so it was removed and reset 3.30' south of here
F.B. 300-69

1/4 SECTION CORNER
By proportion between adjacent Section Corners. Set 2" iron pipe in concrete in 1928 —
F.B. 300-69 — F.B. 243-93

Set 1x2 stake — F.B. 487-150

1/4 SECTION CORNER
By proportion between adjacent Section Corners, Set 2" iron pipe in concrete 18" below surface with brass cap marked.
F.B. 487-150

SECTION CORNER
Found 2" iron pipe set in concrete with brass cap marked — This monument was set in 1928 in the location where the old original juniper stake was found lying on the ground - See F.B. 300-80, 81
F.B. 487-150, 155

SECTION CORNER
A 2" iron pipe set in concrete 12" below surface with brass cap marked. This monument was set in 1928 replacing a 2" iron pipe found here with the old original stake along side it. See F.B. 300-87B & 106

SECTION CORNER
A 2" iron pipe set in concrete with brass cap marked. This monument was set in 1921 by proportion 1 mile north and 1 mile south - See F.B. 65-20 - F.B. 300-68, 69 — F.B. 243-93, 113

1/4 SECTION CORNER
Found 2" iron pipe set in concrete with brass cap marked — This monument was set in 1928 by proportion between adjacent Section Corners — See F.B. 300-80
F.B. 487-150, 155

A 2" iron pipe found & removed by County Surveyor in 1918 — See F.B. 300-87-B

1/4 SECTION CORNER
A 2" iron pipe set in concrete 12" below surface with brass cap marked. This monument was set in 1928 by proportion between Section Corners See F.B. 300-87 B.

Found 2" iron pipe set in concrete This pipe was set in 1921 by Co. Surveyor by proportion for the ¼ Section Corner — See F.B. 65-20 In 1928 It was found to be out of proportion and off line between Section Corners so it was removed and reset 1.20' south and 0.35 west of here — F.B. 300-68

1/4 SECTION CORNER
By proportion between adjacent Section Corners set 2" iron pipe in concrete in 1923 - F.B. 300-68
F.B. 243-93

1/4 SECTION CORNER
Found 2" iron pipe set in concrete 12" below surface by Co. Surveyor in 1921 by proportion 2½ miles east and ½ mile west — See F.B. 65-17 This monument was found 0.17' north of line between Section Corners it was reset on line - F.B. 487-155
Replaced the above 2" iron pipe in 1941 with a 2" iron pipe set in concrete 18" below surface with brass cap marked. F.B. 811-162.

SECTION CORNER
Found 2" iron pipe set in concrete 12" below surface with brass cap marked. This monument was set in 1921 by proportion 2 miles east, and 1 mile west - See F.B. 65-17 and F.B. 300-66, 80 — F.B. 487-155

The above monument found disturbed by road grader and cap gone in Nov. 1941. Replaced same Nov. 18, 1941 with a new 2" iron pipe set in concrete 18" below surface with brass cap marked. F.B. 811-162.

833

1/4 SECTION CORNER
Found 2" iron pipe set in concrete. This monument was set in 1921 by the Co. Surveyor by proportion 1½ miles east and 1½ miles west - See F.B. 65-17 — F.B. 487-155
F.B. 300-66

SECTION CORNER
Found 2" iron pipe set in concrete with brass cap marked. This monument was set in 1921 by proportion 1 mile east and 2 miles west - See F.B. 65-18 and F.B. 300-66, 67 — F.B. 487-155

1/4 SECTION CORNER
A 2" iron pipe set in concrete This monument was set by Co. Surveyor in 1921 by proportion ½ mile east and 2½ miles west See F.B. 65-18 — F.B. 300-67

TOWNSHIP CORNER
A 2" iron pipe set in concrete 12" below surface with brass cap marked. This monument was set in 1921 by proportion 2 miles north, 2 miles south, 2 miles east and 3 miles west. See C.S. B-837-2 and F.B. 65-18, 20
F.B. 300-68, 128 — F.B. 243-93

N
S

MAP
SHOWING
SECTION LINES AND CORNERS
ESTABLISHED BY THE COUNTY SURVEYOR
IN THE
SOUTH ONE HALF
OF
T.7N.-R.9W.-S.B.M.

COUNTY SURVEYORS MAP Nº B-833
SCALE~1 INCH=600 FT.
OFFSETS ARE PLATTED TO EXAGGERATED SCALE

WORK ORDER Nº 999

INDEX 66-67-68-69

J.E. ROCKHOLD~COUNTY SURVEYOR
SURVEYED JUNE 1931 TO DEC 1932 EXCEPT
WHERE OTHER WISE NOTED ON MAP

BEARINGS ARE BASED ON THE BEARING OF
THE RANGE LINE BETWEEN R.8W. AND R.9W.
AS SHOWN ON C.S. B-837-2

F.B. 487-135 TO 162

FIELD WORK BY	J.D. BOYER
OFFICE WORK BY	K.R. Mc PHERSON K.V. MORIN
CHECKED BY	K.R. Mc PHERSON

CSB-833
A1 OF A2

C.S. 8732
C.S. 8732
C.S. 8733
R.10W.
R.9W.
T.7N.
T.6N.
19
20
21
22
23
30
29
28
27
26
31
32
33
34
35
ROCKY BUTTES
PIUTE BUTTE
N.89°35'25"W. 2643.56
N.89°35'25"W. 2693.39
N.89°46'30"W. 2714.27
N.89°34'45"W. 2659.26
N.89°34'45"W. 2659.25
S.88°39'15"W. 2668.22
S.88°39'15"W. 2668.23
S.89°38'45"W. 266?.90
N.89°54'00"E. 2626.70
N.89°54'00"E. 2651.23
S.89°30'10"E. 2685.55
S.89°30'10"E. 2685.51
S.89°42'15"E. 2678.42
S.89°42'15"E. 2678.43
S.89°25'30"W. 2681.28
S.89°25'30"W. 2681.29
S.89°34'55"E. 2666.63
S.89°34'55"E. 2648.09
S.89°55'20"E. 2664.19
S.89°16'20"E. 2672.59
N.89°45'25"W. 2670.24
N.89°45'25"W. 2670.23
N.89°17'35"E. 2694.62
N.89°17'35"E. 2694.63
N.89°43'25"W. 2663.57
N.89°43'25"W. 2671.59
N.89°43'25"W. 2671.59
N.89°53'20"W. 2686.25
N.89°53'20"W. 2686.25
S.89°10'05"W. 2685.86
S.89°10'05"W. 2685.87
S.89°09'30"W. 26?6.?
N.01°12'5"W. 2673.72
N.01°12'5"W. 2673.87
N.01°12'5"W. 2673.95
N.01°12'5"W. 2673.94
N.01°12'5"W. 2674.01
N.01°12'5"W. 2672.88
S.00°25'W. 2530.68
S.02°6'45"W. 2665.50
S.02°6'45"W. 2665.99
S.03°50'0"E. 2682.63
S.03°50'0"E. 2683.14
S.02°39'0"E. 2682.90
S.02°39'0"E. 2683.91
S.1°02'45"W. 2678.60
S.1°02'45"W. 2676.60
S.01°24'0"E. 2676.19
S.01°25'5"E. 2677.45
S.02°8'15"E. 2676.82
S.02°8'15"E. 2676.81
S.03°7'15"W. 2673.11
S.03°7'15"W. 2673.10
S.00°2'15"E. 2674.84
S.00°2'15"E. 2674.78
N.02°4'15"W. 2670.54
N.02°4'15"W. 2670.68
S.01°9'20"W. 2708.43
S.01°9'20"W. 2708.43
S.01°9'00"E. 2671.09
S.01°9'00"E. 2671.09
S.03°7'15"E. 2665.34
S.03°7'15"E. 2665.35
F.M.18243
F.M.18118-2
F.D.9166-14
F.D.9112-4
F.D.9214-2
F.D.9112-4
F.D.9166-10
F.D.9166-10,11
F.D.9166-7,8
C.S.B-2658
F.D.9166-4
F.D.9166-13
F.D.9112-3,4
F.D.9112-3
F.D.9112-2
F.D.9112-1
F.D.9112-1,2
F.D.9214-1
F.M.18118-2
C.S.8287
C.S.8732
C.S.8733
5356.85
5355.64
5349.12
5340.47
R.S. 1947
Power Lines
Fence
Traveled Road
Well and Derrick
Top easterly spur Piute Butte
Wash per Rd Dept F.B. F.R. 290-26
12" dry well. 125 deep F.B. 300-66
COUNTY SURVEYORS MONUMENT

SECTION CORNER
Found spike & tin set over a 2" iron pipe 12" below surface—This pipe set by Road Dept in 1928 by proportion 3 miles north & 3 miles south—See Road Dept F.B. F.R. 137-191,223 & F.R. 290-16 F.B. 487-156

Replaced same with a County Surveyor's Monument in 1943, F.B. 410-173.

Found 6"x6" concrete monument Set by Co. Rd. Dept—F.B. 487-156

Found 6"x6" concrete monument Set by Co. Rd. Dept—F.B. 487-156

Set 1"x2" stake—F.B. 487-156

1/4 SECTION CORNER
A 2" iron pipe 6" below surface set in 1918 by the Co. Road Dept by proportion between adjacent Section Corners—See Road Dept. F.B. F.R. 137-193 and F.R. 290-17
Above 2" iron pipe replaced in 1943 with a 2" iron pipe set in concrete 18" below surface with brass cap marked — F.B. 410-175

SECTION CORNER
A 2" iron pipe set in concrete 12" below surface with brass cap marked — The Co. Road Dept. in 1918 found the original stake standing here and replaced it with a 2" iron pipe & wired the original stake to the pipe—See Rd. Dept. F.B. F.R. 137-195—The Rd. Dept. pipe was replaced with the present monument in 1923—See F.B. 209-60 — F.B. 300-76,84

1/4 SECTION CORNER
A 2" iron pipe set in concrete 12" below surface with brass cap marked—This monument was set in 1928 by proportion between adjacent Section Corners — See F.B. 300-112

Found 2"x4" Redwood Stake F.B. 300-112

Found 2" iron pipe—F.B. 300-112

Found 1"x2" stake with pieces of old stake lying on ground F.B. 300-114

Found 2"x2" stake—F.B. 300-112

SECTION CORNER
Found 2" iron pipe set in concrete 12" below surface with brass cap marked—The Co. Road Dept in 1918 found the old original stake standing here in good condition and replaced it with a 2" iron pipe—See Rd. Dept. F.B. F.R. 137-195 The Rd. Dept pipe was replaced with the present monument in 1928—See F.B. 300-112,114 — F.B. 487-145,146

SECTION CORNER
Found 2" iron pipe set in concrete 12" below surface with brass cap marked—The Co. Rd. Dept. in 1918 set a 2" iron pipe here by proportion 1 mile north, 1 mile south, 1 mile east & 1 mile west. See Rd. Dept. F.B. F.R. 137-195 — The Rd. Dept. pipe was replaced with the present monument in 1923 —See F.B. 209-61 & F.B. 300-76,112 F.B. 487-146,156

1/4 SECTION CORNER
A 2" iron pipe set in concrete-12" below surface with brass cap marked—This monument was set in 1928 by proportion between adjacent Section Corners —See F.B. 300-114

SECTION CORNER
Found 2" iron pipe set in concrete 12" below surface with brass cap marked— In 1916 The Co. Rd. Dept. found the original stake lying on the ground. Their surveyor considered that it was approximately in its original position. He reset the original and set a 2"x2" stake beside it. In 1927 the Co. Rd. Dept. replaced the original with a 2" iron pipe—See Rd. Dept. F.B. S-257-28 & F.R. 290-29 The Rd. Dept. pipe was replaced with the present monument in 1928 See F.B. 300-114 — F.B. 487-140

1/4 SECTION CORNER
A 2" iron pipe set in concrete 12" below surface with brass cap marked— This monument was set in 1928 by proportion between adjacent Section Corners—See F.B. 300-115

SECTION CORNER
A 2" iron pipe set in concrete 12" below surface with brass cap marked— This monument was set in 1928 by proportion 3 miles north, 1 mile south, 1 mile east and 1 mile west. See C.S. 8732 and F.B. 300-82,115,116,118

1/4 SECTION CORNER
Found 2" iron pipe set in concrete with brass cap marked— In 1918 the Co. Road Dept set a 2" iron pipe here by proportion 3½ miles north and 2½ miles south—See Rd. Dept. F.B. F.R. 137-223—The Rd. Dept pipe was replaced with the present monument in 1923—See F.B. 74-152— F.B. 487-156

This Range Line was established by the County Road Department in 1918 and their work was accepted by the County Surveyor. They made this line a straight line between Township Corners and set the intermediate Corners by single proportion—See Rd. Dept. F.B. F.R. 137-219,221, C.S. 8243 & C.S. 8732

Found 6"x6" concrete monument Set by Co. Rd. Dept—F.B. 487-146

Found 6"x6" concrete monument Set by Co. Rd. Dept—F.B. 487-146

1/4 SECTION CORNER
Set spike, washer & tin on line and between the found Rd. Dept. monuments A 2" iron pipe, plug & tack set by the Co. Rd. Dept in 1918, by proportion between adjacent Section Corners is set 6" below this point—See Rd. Dept. F.B. F.R. 137-197 and F.R. 290-19 F.B. 487-146

Set 1"x2" stake—F.B. 487-144

1/4 SECTION CORNER
By proportion between adjacent Section Corners. Set 2" iron pipe in concrete 12" below surface with brass cap marked F.B. 487-144

Set 1"x2" stake—F.B. 487-140

1/4 SECTION CORNER
By proportion between adjacent Section Corners Set 2" iron pipe in concrete with brass cap marked F.B. 487-140

1/4 SECTION CORNER
Found 2" iron pipe set in concrete with brass cap marked— This monument was set in 1928 by proportion between adjacent Section Corners — See F.B. 300-82 F.B. 487-154

1/4 SECTION CORNER
By proportion between adjacent Section Corners—Set 2" iron pipe in concrete 18" below surface with brass cap marked — F.B. 487-157

Set spike and tin—F.B. 487-146

1/4 SECTION CORNER
Set spike washer & tin in pavement midway between the Rd. Dept monuments This corner was first established in 1918 by Co. Rd. Dept by proportion between adjacent Section Corner & the 6"x6" monuments found were later set as witnesses to it. See Rd. Dept. F.B. F.R. 137-203. — F.B. 487-151

Set 1"x2" stake — F.B. 487-139

Found 6"x6" concrete monument Set by Co. Rd. Dept—F.B. 487-144

Found 2" iron pipe, plug & tack Set by the Co. Road Dept in 1927, not set for the ¼ Corner See Rd. Dept. F.B. F.R. 290-29 —This pipe removed by the Co. Surveyor. F.B. 487-152

SECTION CORNER
Found 2" iron pipe set in concrete with brass cap marked— Lowered this monument to 18" below surface —The Co. Rd. Dept. in 1918 set a 2" iron pipe here by proportion 4 miles north & 2 miles south—See Rd. Dept. F.B. F.R. 137-221,223—The Rd. Dept pipe was replaced with the present monument in 1923—See F.B. 74-152 F.B. 487-156,157,158

Found 2" iron pipe — This pipe was set by the Co. Road Dept. in 1918— They also found the original stake lying on the ground 30.0 west and 3.5 north of this point—See Rd. Dept. F.B. F.R. 137-199 — F.B. 487-157

Set 1"x2" stake—F.B. 487-157

SECTION CORNER
Found 2" iron pipe set in concrete with brass cap marked— The Co. Rd. Dept. in 1918 found the old original stake in good condition buried in sand here and replaced it with a 2" iron pipe—See Rd. Dept. F.B. F.R. 137-199—The Rd. Dept. pipe was replaced with the present monument in 1927 See F.B. 102-74 —F.B. 487-146,151,157,161

Found 6"x6" concrete monument Set by Co. Rd. Dept—F.B. 487-151

SECTION CORNER
Found 2" iron pipe, plug & tack set by Co. Rd. Dept. in 1918 by proportion 1 mile north, 2 miles south, 2 miles east & 1 mile west—See Rd. Dept. F.B. F.R. 137-203—Replaced the Rd. Dept. pipe with 2" iron pipe set in concrete 12" below surface with brass cap marked — F.B. 487-144,151,152

Set 1"x2" stake—F.B. 487-152

1/4 SECTION CORNER
By proportion between adjacent Section Corners. Set 2" iron pipe in concrete 18" below surface with brass cap marked—F.B. 487-152

SECTION CORNER
Found 2" iron pipe, plug & tack set in 1927 by Co. Rd. Dept. by proportion 1 mile north, 1 mile south, 1 mile east and 1 mile west See Rd. Dept. F.B. F.R. 290-29 — Replaced Rd. Dept. pipe with a 2" iron pipe set in concrete 18" below surface with brass cap marked — F.B. 487-139,152

1/4 SECTION CORNER
By proportion between adjacent Section Corners, Set 2" iron pipe in concrete 12" below surface with brass cap marked F.B. 487-154

SECTION CORNER
Found 2" iron pipe set in concrete with brass cap marked— In 1916 the Co. Road Dept. found the original scribed stake standing here & set a 2"x2" stake beside it—See Rd. Dept. F.B. S-257-28. The original was found still standing beside the 2"x2" stake in 1928 and was replaced with the present monument. See F.B. 300-81,82 — F.B. 487-154

Found spikes & pieces of old juniper stake wired to lath—The Road Dept in 1918 found a piece of original lying on ground here and probably set the lath—See Rd. Dept. F.B. F.R. 137-221 —F.B. 487-158

Set 1"x2" stake—F.B. 487-158

1/4 SECTION CORNER
By proportion between adjacent Section Corners Set 2" iron pipe in concrete with brass cap marked— F.B. 487-158

1/4 SECTION CORNER
Found 2" iron pipe set in concrete 12" below surface with brass cap marked— ; Set in 1927 by proportion between adjacent Section Corners See F.B. 102-74 —F.B. 487-161

1/4 SECTION CORNER
Found 2" iron pipe, plug & tack, set by Co. Road Dept. in 1918 by proportion between adjacent Section Corners. See Rd. Dept. F.B. F.R. 137-203—Replaced Rd. Dept. pipe with 2" iron pipe set in concrete 12" below surface with brass cap marked— F.B. 487-143

1/4 SECTION CORNER
Found 2" iron pipe set by Co. Rd. Dept. in 1927 by proportion between adjacent Section Corners—See Rd. Dept. F.B. F.R. 290-25—Replaced Rd. Dept. pipe with 2" iron pipe set in concrete 12" below surface with brass cap marked— F.B. 487-138,139

1/4 SECTION CORNER
A 2" iron pipe set in concrete with brass cap marked— This monument was set in 1928 by proportion between adjacent Section Corners—See F.B. 300-81

1/4 SECTION CORNER
By proportion between adjacent Section Corners—Set 2" iron pipe in concrete with brass cap marked— F.B. 487-160

Set 1"x2" stake—F.B. 487-160

1/4 SECTION CORNER
Found 2" iron pipe set in concrete with brass cap marked ; in large rock mound on west slope of Piute Butte. This monument was set in 1927 replacing original juniper stake scribed "¼ S" found standing here in mound of Rock —See F.B. 102-73 F.B. 487-160,160A

1/4 SECTION CORNER
By proportion between adjacent Section Corners Set 2" iron pipe in concrete 12" below surface with brass cap marked — F.B. 487-147

Found 6"x6" concrete monument centered with cut spike set by Co. Road Dept. — F.B. 487-138

Found 6"x6" concrete monument centered with cut spike set by Co. Road Dept. F.B. 487-138.

Set 1"x2" stake—F.B. 487-150

SECTION CORNER
Found 2" iron pipe set in concrete with brass cap marked— The Co. Road Dept in 1918 set a 2" iron pipe here by proportion 5 miles north & 1 mile south—See Rd. Dept. F.B. F.R. 137-221—The Rd. Dept. pipe was replaced with the present monument in 1927 See F.B. 102-72—F.B. 487-158,159,160

Found 2" iron pipe set in concrete with brass cap marked— Set by proportion for the ¼ Section Corner in 1927—See F.B. 102-72—This monument was found to be 16.05 out of proportion. It was removed and reset 16.05 east. F.B. 487-160

SECTION CORNER
Found 2" iron pipe set in concrete 12" below surface with brass cap marked ; set in 1927 by proportion 1 mile north, 1 mile south, ½ mile east, and 1 mile west See F.B. 102-73 F.B. 487-160,161,162

SECTION CORNER
Found 2" iron pipe, plug & tack with remains of original mesquite stake wired to it. The pipe was set by the Co. Rd. Dept. in 1918 by proportion 2 miles north, 1 mile south, 1 mile east and ½ mile west. See Rd. Dept. F.B. F.R. 137-205—Replaced Rd. Dept. pipe with 2" iron pipe set in concrete with brass cap marked F.B. 487-142,148

SECTION CORNER
Found nail & tin set over 2" iron pipe set by Co. Rd. Dept. in 1916 to replace a 2"x4" "O.W.O.R.P." stake found with the original scribed stake lying on the ground near-by—See Rd. Dept. F.B. S-257-26 —F.B. 487-138,147,150

1/4 SECTION CORNER
By proportion between adjacent Section Corners, Set 2" iron pipe in concrete 18" below surface with brass cap marked F.B. 487-150

SECTION CORNER
Found 2" iron pipe set in concrete with brass cap marked— This monument was set in 1928 at the location where the old original juniper stake was found lying on the ground—See F.B. 300-80,81 F.B. 487-150,155

Set 1"x2" stake—F.B. 487-159

12'x16' 1 story frame house—Not shown in notes of Road Dept Survey of 1918 per Rd. Dept. F.B. F.R. 137-221 Evidently built after Township Line was established in 1918

1/4 SECTION CORNER
Found 3"x3" redwood stake apparently the 4"x4" stake set in 1918 by the Co. Road Dept. by proportion 5½ miles north and ½ mile south See Rd. Dept. F.B. F.R. 137-221—Replaced the 3"x3" stake with a 2" iron pipe set in concrete with brass cap marked— F.B. 487-159

1/4 SECTION CORNER
Found 2" iron pipe set in concrete 12" below surface with brass cap marked ; set in 1927 by proportion between adjacent Section Corners—See F.B. 102-73—F.B. 487-162

1/4 SECTION CORNER
By proportion between adjacent Section Corners. Set 2" iron pipe in concrete with brass cap marked at foot of Piute Butte—F.B. 487-141

Set cut spike—F.B. 487-138

Set nail and tin—F.B. 487-137

Found 6"x6" concrete monument centered with cut spike—Set by Road Dept — F.B. 487-137

Found 6"x6" concrete monument centered with cut spike—Set by Road Dept. — F.B. 487-137

Set 2" iron pipe in concrete with brass cap marked— F.B. 487-137

Set 2" iron pipe in concrete with brass cap marked— F.B. 487-137

S.89°10'45"W. 30.00

N.89°10'45"E. 30.00

1/4 SECTION CORNER
Found 40d nail at surface & 2" iron pipe, plug & tack 1.5" below surface. The pipe was set by Co. Rd. Dept. in 1916 by proportion between adjacent Section Corners—See Rd. Dept. F.B. S-257-26 F.B. 487-137

Set cut spike—F.B. 487-137

1/4 SECTION CORNER
Found 2" iron pipe set in concrete with brass cap marked— This monument was set in 1928 by proportion between adjacent Section Corners — See F.B. 300-80 F.B. 487-150,155

Set 1"x2" stake — F.B. 487-159

1/4 SECTION CORNER
A 2" iron pipe set in concrete by the County Surveyor in 1923 by proportion 1½ miles east & ½ mile west — See F.B. 74-23

Found 1"x2" stake with original stake attached to it. The original was found lying on the ground here in 1918 by the Co. Road Dept. —See Rd. Dept. F.B. F.R. 137-215 —F.B. 74-32

TOWNSHIP CORNER
Found 2" iron pipe set in concrete with brass cap marked— The Co. Road Dept. in 1918, found the original scribed & charred stake standing in place here and replaced it with a 2" iron pipe and built mound of earth & rock around pipe—See Rd. Dept. F.B. F.R. 137-219—The Rd. Dept pipe was replaced in 1923 with the present monument—See F.B. 74-24 —This corner falls on the north-east corner of Rocky Butte —F.B. 487-159

SECTION CORNER
Found 2" iron pipe set in concrete with brass cap marked— set in 1923 by proportion 1 mile east & 1 mile west—See F.B. 74-23 F.B. 487-159,162

Found 2"x4" stake scribed "S32" F.B. 74-23

1/4 SECTION CORNER
Found 2" iron pipe set in concrete by County Surveyor in 1923 by proportion ½ mile east and 1½ miles west — See F.B. 74-22 F.B. 487-162

County Surveyor's Monument See F.B. 2237-184

SECTION CORNER
Found 2" iron pipe set in concrete with brass cap marked— set in 1923 replacing a 2" iron pipe found with the original stake beside it—See F.B. 74-22. The Rd. Dept. in 1918 found a mound of earth and rock here with the original stake lying near by and accepted the mound for the corner. They probably set the 2" iron pipe although it is not shown in their field notes—See Rd. Dept. F.B. F.R. 137-215 This monument lowered to 18" below the surface— F.B. 487-141

1/4 SECTION CORNER
Found 2" iron pipe set in concrete This pipe was set by County Surveyor in 1923 by proportion between adjacent Section Corners —See F.B. 74-22 — Replaced the 2" iron pipe with 2" iron pipe set in concrete 18" below surface with brass cap marked — F.B. 487-137

SECTION CORNER
Found 2" iron pipe set in concrete 12" below surface with brass cap marked. In 1916 the Co. Rd. Dept. found and accepted a 2"x4" "O.W.O.R.P." stake here and replaced it with a 2" iron pipe. See Rd. Dept. F.B. S-257-27—The Rd. Dept pipe was replaced with the present monument in 1921—See F.B. 65-17 —F.B. 487-137,135
For new Ties (Nov. 1941) See F.B. 811-163

1/4 SECTION CORNER
Found 2" iron pipe set in concrete 12" below surface by Co. Surveyor in 1921 by proportion 2½ miles east and ½ mile west—See F.B. 65-17 This monument was found 0.17' north of line between Section Corners. It was reset on line—F.B. 487-155
Replaced the above 2" iron pipe in 1941 with a 2" iron pipe set in concrete 18" below surface with brass cap marked. F.B. 811-162.

SECTION CORNER
Found 2" iron pipe set in concrete 12" below surface with brass cap marked. This monument was set in 1921 by proportion 2 miles east and 1 mile west—See F.B. 65-17 and F.B. 300-66,80 — F.B. 487-155

The above monument found disturbed by road grader and cap gone in Nov. 1941. Replaced same Nov. 18, 1941 with a new 2" iron pipe set in concrete 18" below surface with brass cap marked. F.B. 811-162

CSB-833
A2OFA2