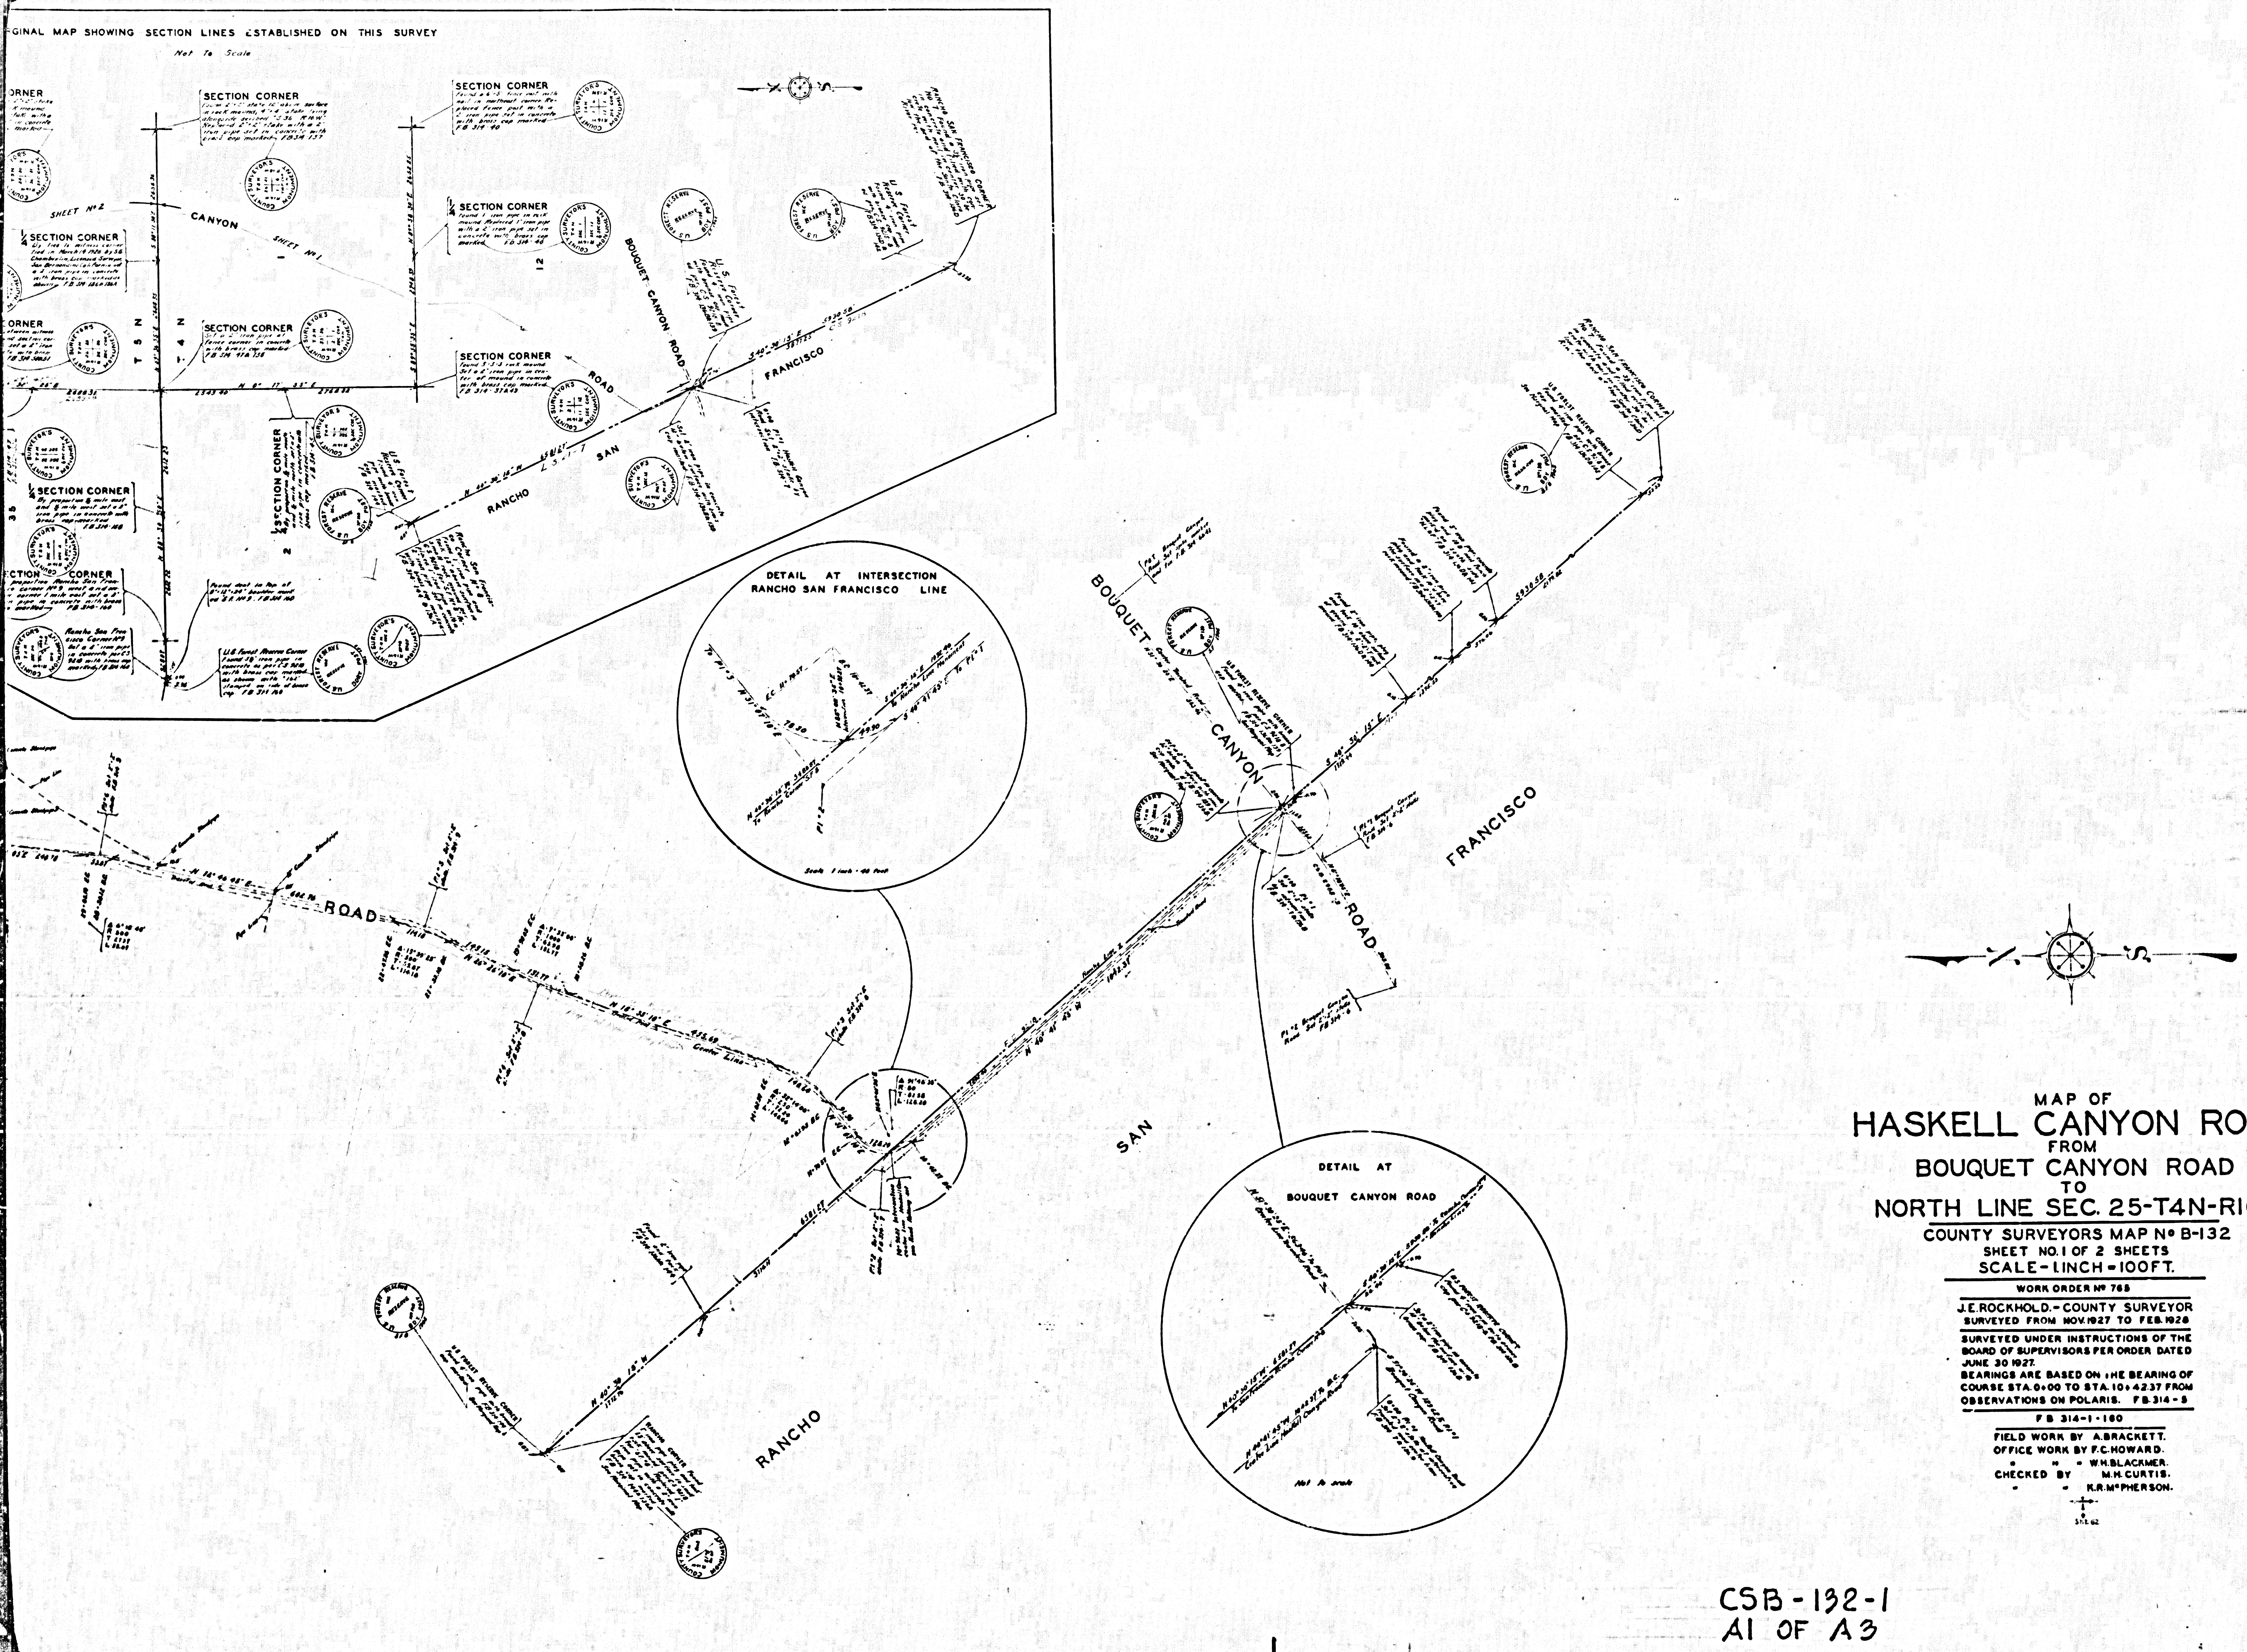
GINAL MAP SHOWING SECTION LINES ESTABLISHED ON THIS SURVEY
Not To Scale
SECTION CORNER
SECTION CORNER
SECTION CORNER
SECTION CORNER
SECTION CORNER
SECTION CORNER
SECTION CORNER
SHEET No 2
SHEET No 1
CANYON
T 5 N
T 4 N
12
BOUQUET CANYON ROAD
ROAD
RANCHO
SAN
FRANCISCO
U.S. Forest Reserve Corner
DETAIL AT INTERSECTION
RANCHO SAN FRANCISCO LINE
Scale 1 inch = 40 feet
ROAD
BOUQUET
CANYON
ROAD
FRANCISCO
SAN
RANCHO
DETAIL AT
BOUQUET CANYON ROAD
Not to scale
N
S

MAP OF
# HASKELL CANYON ROAD
FROM
BOUQUET CANYON ROAD
TO
NORTH LINE SEC. 25-T4N-R16W

COUNTY SURVEYORS MAP Nº B-132
SHEET NO. 1 OF 2 SHEETS
SCALE - 1 INCH = 100 FT.

WORK ORDER Nº 765

J.E. ROCKHOLD. - COUNTY SURVEYOR
SURVEYED FROM NOV. 1927 TO FEB. 1928

SURVEYED UNDER INSTRUCTIONS OF THE BOARD OF SUPERVISORS PER ORDER DATED JUNE 30 1927.
BEARINGS ARE BASED ON THE BEARING OF COURSE STA. 0+00 TO STA. 10+42.37 FROM OBSERVATIONS ON POLARIS. F.B. 314 - 5

F.B. 314-1-160

FIELD WORK BY A. BRACKETT.
OFFICE WORK BY F.C. HOWARD.
" " " W.H. BLACKMER.
CHECKED BY M.H. CURTIS.
" " K.R. McPHERSON.

CSB - 132 - 1
A1 OF A3

MARGINAL MAP SHOWING SECTION LINES ESTABLISHED ON THIS SUR
Not To Scale
R 15 W
R 16 W
SPUR ROAD
HASKELL
CANYON
SHEET No 2
SHEET No 1
25
36
35
2
T 5 N
T 4 N
N 0° 05' 55" E 2676.74
N 0° 12' 15" W 2675.68
N 0° 17' 55" E
2543.46
2768.32
2688.50
2688.31
2612.23
SECTION CORNER From Topography per C.S. 9362 set a 2" iron pipe in concrete with brass cap marked as shown FB 314-152
1/4 SECTION CORNER Found 2"x2" stake in a 2'x2'x1.5' rock mound. Replaced 2"x2" stake with a 2" iron pipe set in concrete with brass cap marked FB 314-150
SECTION CORNER Found old white 2"x2" stake in 2'x2'x0.7' rock mound. Replaced 2"x2" stake with a 2" iron pipe set in concrete with brass cap marked FB 314-36
SECTION CORNER Found 2"x2" stake 12" above surface in rock mound, 4"x4" stake lying alongside scribed "S 36 R16W". Replaced 2"x2" stake with a 2" iron pipe set in concrete with brass cap marked FB 314-137
1/4 SECTION CORNER By proportion 1/2 mile east and 1/2 mile west set a 2" iron pipe in concrete with brass cap marked FB 314-166
1/4 SECTION CORNER Found 3"x4"x4.0' stake 12" above surface in 2.5'x2.5' rock mound. Replaced 3"x4"x4.0' stake with a 2" iron pipe set in concrete with brass cap marked as shown FB 314-58
1/4 SECTION CORNER By tie to witness corner tied in March 14 1926 by S.G. Chamberlin, Licensed Surveyor, San Bernardino California, set a 2" iron pipe in concrete with brass cap marked as shown FB 314-156 & 183
SECTION CORNER Found charred 3"x4" post in 3'x3'x1.5' rock mound per C.S. 9103. Replaced charred 3"x4" post with a 2" iron pipe set in concrete with brass cap marked FB 314-156
Witness Corner Found 3"x3" fence post in 2'x2'x1' rock mound scribed "S 36 R16W" on east face and "26W" on west face as per C.S. 9103. Replaced 3"x3" post with a 2" iron pipe set in concrete with brass cap marked FB 314-56-51
SECTION CORNER By proportion between witness corner to north and section corner 1 mile south set a 2" iron pipe in concrete with brass cap marked FB 314-50 & 51
SECTION CORNER Set a 2" iron pipe at fence corner in concrete with brass cap marked FB 314-47 & 156
1/4 SECTION CORNER By proportion 1/2 mile north and 1/2 mile south set a 2" iron pipe in concrete with brass cap marked FB 314-49
1/4 SECTION CORNER By proportion 1/2 mile east and 1/2 mile west set a 2" iron pipe in concrete with brass cap marked FB 314-148
1/4 SECTION CORNER By proportion 1/2 mile south and 1/2 mile north set a 2" iron pipe in concrete with brass cap marked FB 314-45
SECTION CORNER By proportion Rancho San Francisco Corner No 9 west and section corner 1 mile east set a 2" iron pipe in concrete with brass cap marked FB 314-166
Rancho San Francisco Corner No 9 Set a 2" iron pipe in concrete per C.S. 9210 with brass cap marked FB 314-160
Found dent in top of 8"x12"x24" boulder marked "S.F. No 9". FB 314-160
U.S. Forest Reserve Corner Found 3/4" iron pipe in concrete as per C.S. 9210 with brass cap marked as shown with "16" stamped on side of brass cap. FB 314-160
U.S. Forest Reserve Corner Found 4" iron pipe with brass cap marked FB 314-144
COUNTY SURVEYOR'S MONUMENT
U.S. FOREST RESERVE BDY. POST
T4N-R16W
6
7
1
12
2652.25
1319.53
SECTION CORNER Found 6"x8" fence post with nail in northeast corner. Replaced fence post with a 2" iron pipe set in concrete with brass cap marked FB 314-40 See Marginal Map
Found 2"x2" stake in small rock mound FB 314-40
1332.72
1117.06
1/4 SECTION CORNER Found 1" iron pipe in rock mound. Replaced 1" iron pipe with a 2" iron pipe set in concrete with brass cap marked as shown F.B. 314-39 See Marginal Map
HASKELL
CANYON
ROAD
Center Line
N 5° 42' 46" E
2746.33
Section Line
S 89° 53' 35" E
DETAIL
INTERSECTION SECTION LINE
Scale 1 inch = 20 Feet
Section Line
N 0° 17' 55" E
2768.32
T4N-R16W
1
12
2
11
SECTION CORNER Found 3'x3'x3' rock mound. Set 2" iron pipe in center of mound in concrete with brass cap marked F.B. 314-310 46 See Marginal Map

CSB-132-1
A2 OF A3

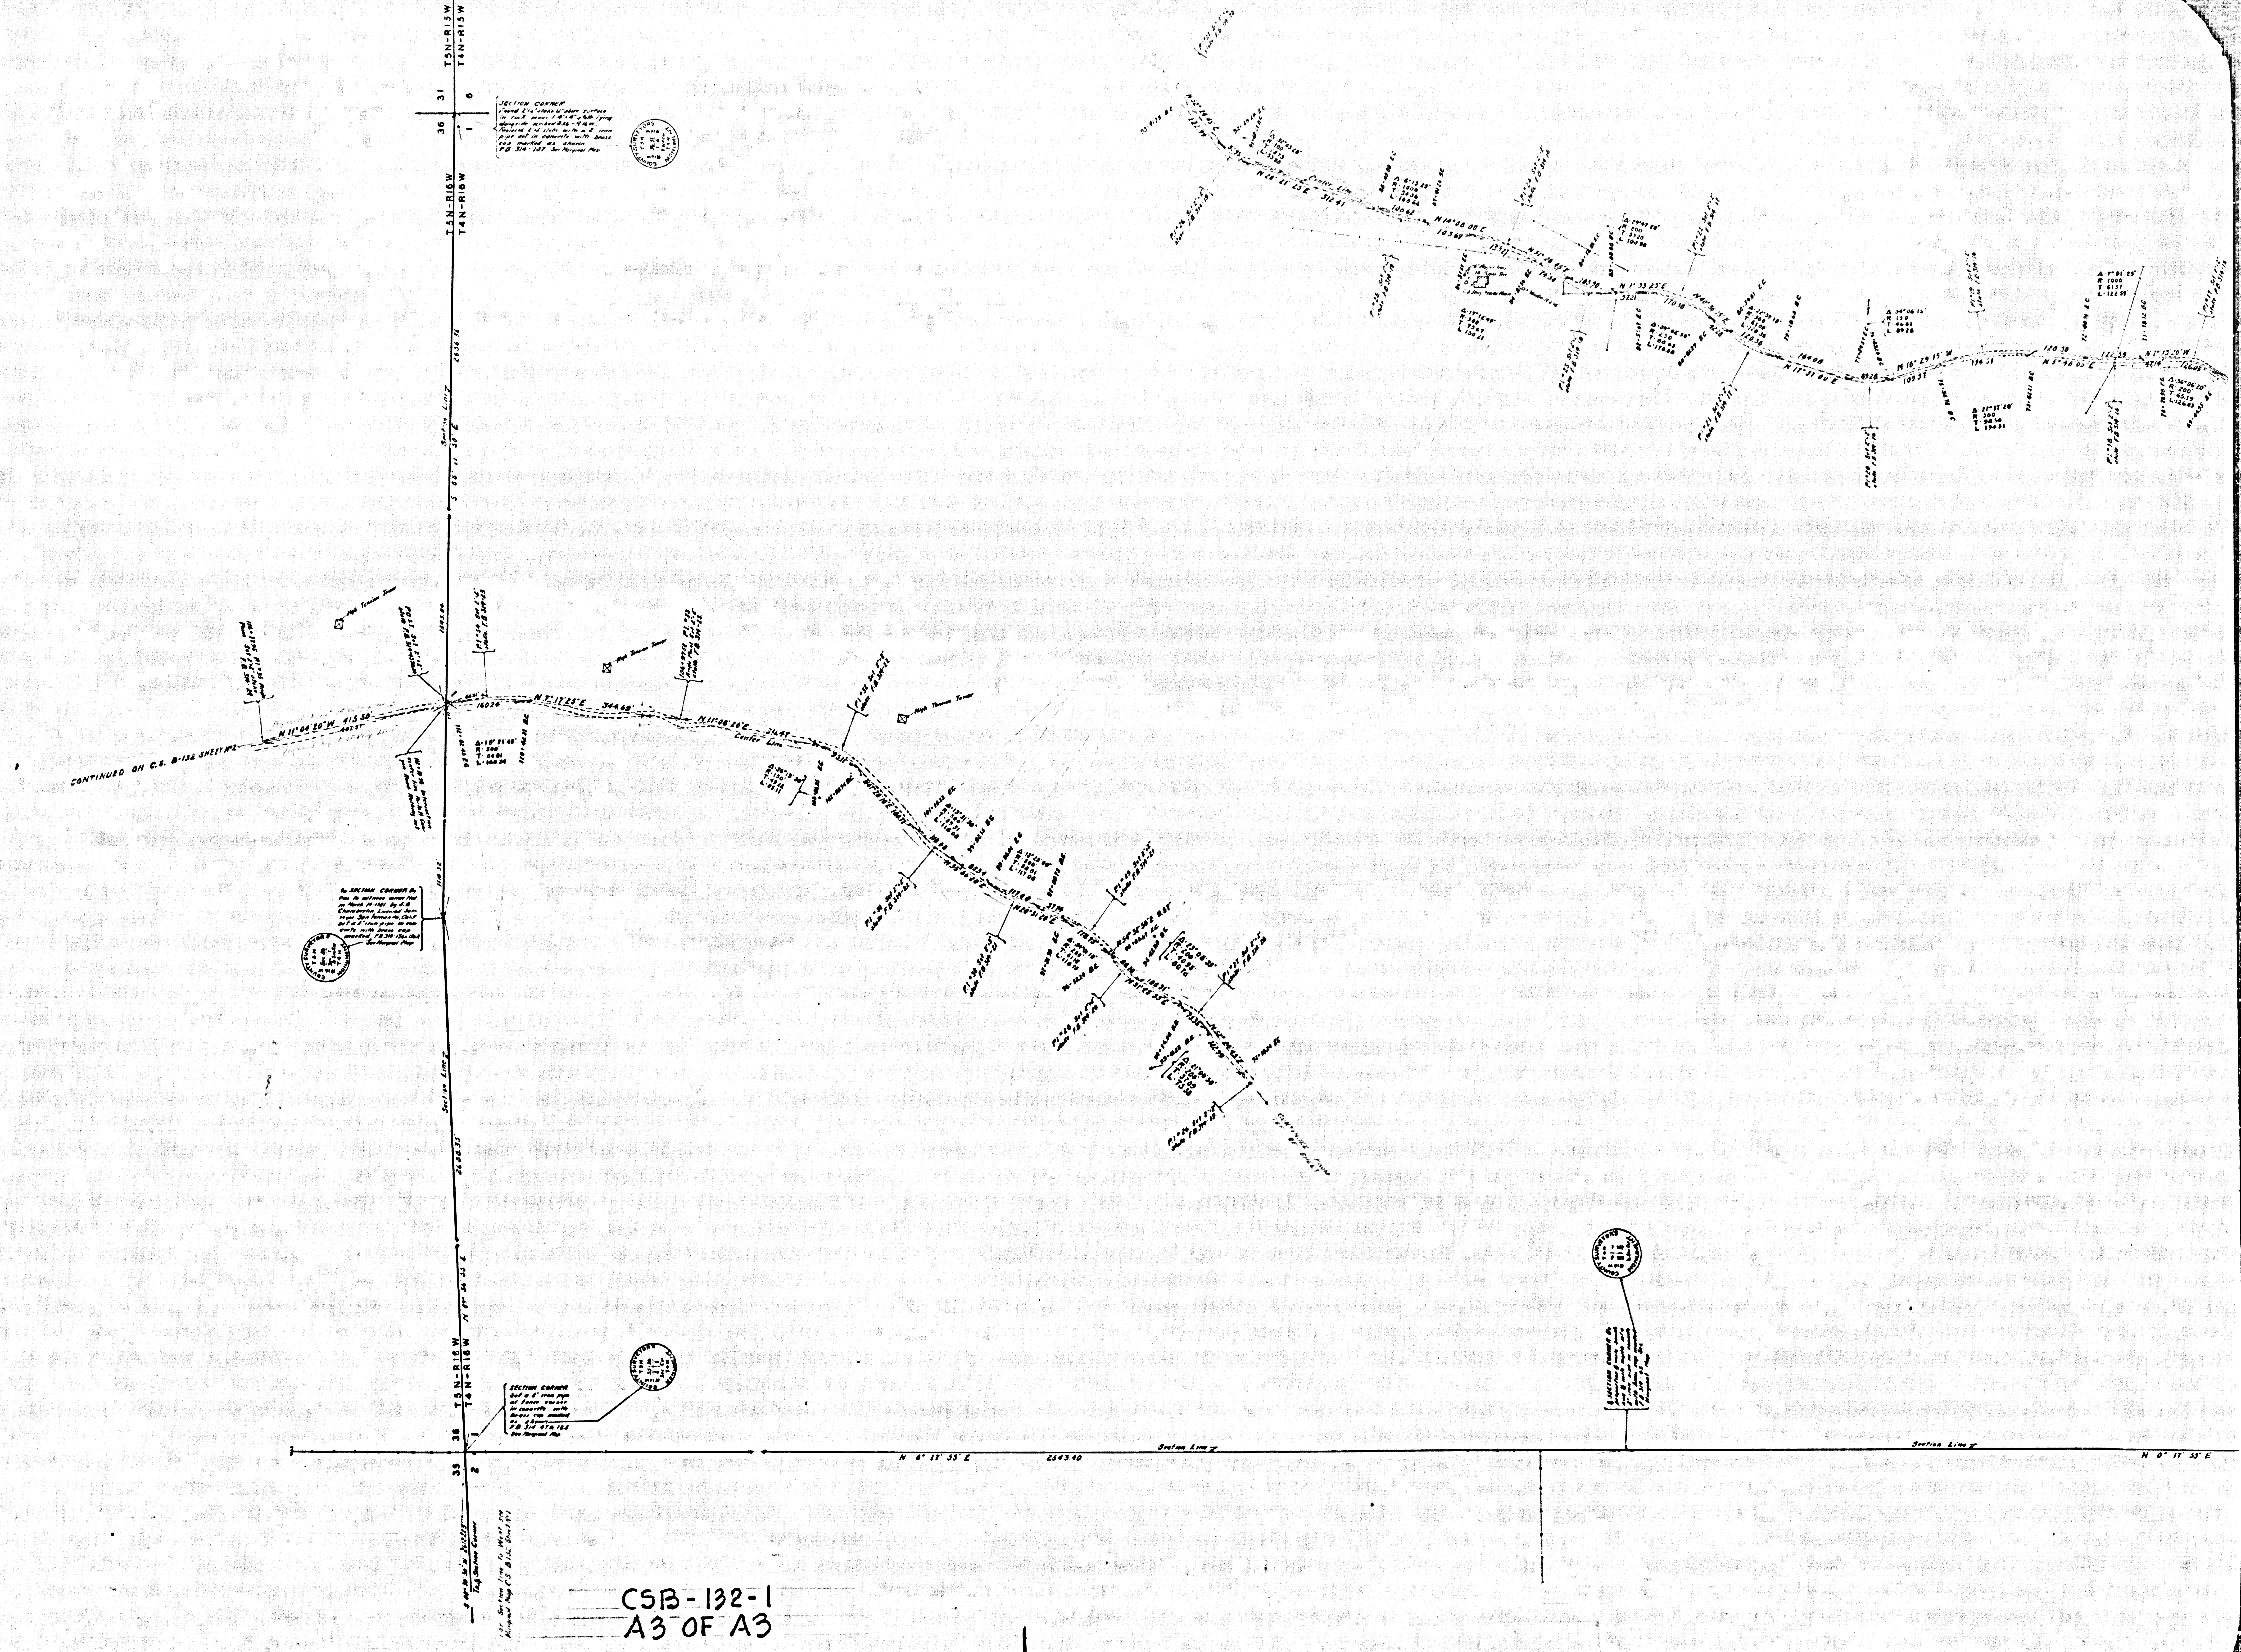
T5N-R15W
T4N-R15W
T5N-R16W
T4N-R16W
31
6
36
1
SECTION CORNER
Found 2"x4" stake 12" above surface in rock mound 4"x4" stake lying alongside scribed "S36-R16W." Replaced 2"x2" stake with a 2" iron pipe set in concrete with brass cap marked as shown
F.B. 314-137 See Marginal Map
COUNTY SURVEYORS MONUMENT
CONTINUED ON C.S. B-132 SHEET No 2
N 11° 04' 20" W 415.50
407.57
Proposed Right of Way Line
High Tension Tower
N 7° 17' 25" E 344.69
160.24
Δ 18° 21' 45"
R 500'
T 80.81
L 160.24
N 11° 08' 20" E 314.47
Center Line
Δ 36° 19' 30"
R 150
T 49.22
L 95.11
1545.84
1110.52
Section Line
SECTION CORNER
Pipe to witness corner tied on March 14-1921 by S.O. Chamberlin Licensed Surveyor, San Fernando, Calif. Set a 2" iron pipe in concrete with brass cap marked. FB 314-136 & 136A
See Marginal Map
SECTION CORNER
Set a 2" iron pipe at fence corner in concrete with brass cap marked as shown
FB 314-47 & 185
See Marginal Map
36
35
1
2
N 0° 17' 55" E
2543.40
Section Line

CSB-132-1
A3 OF A3