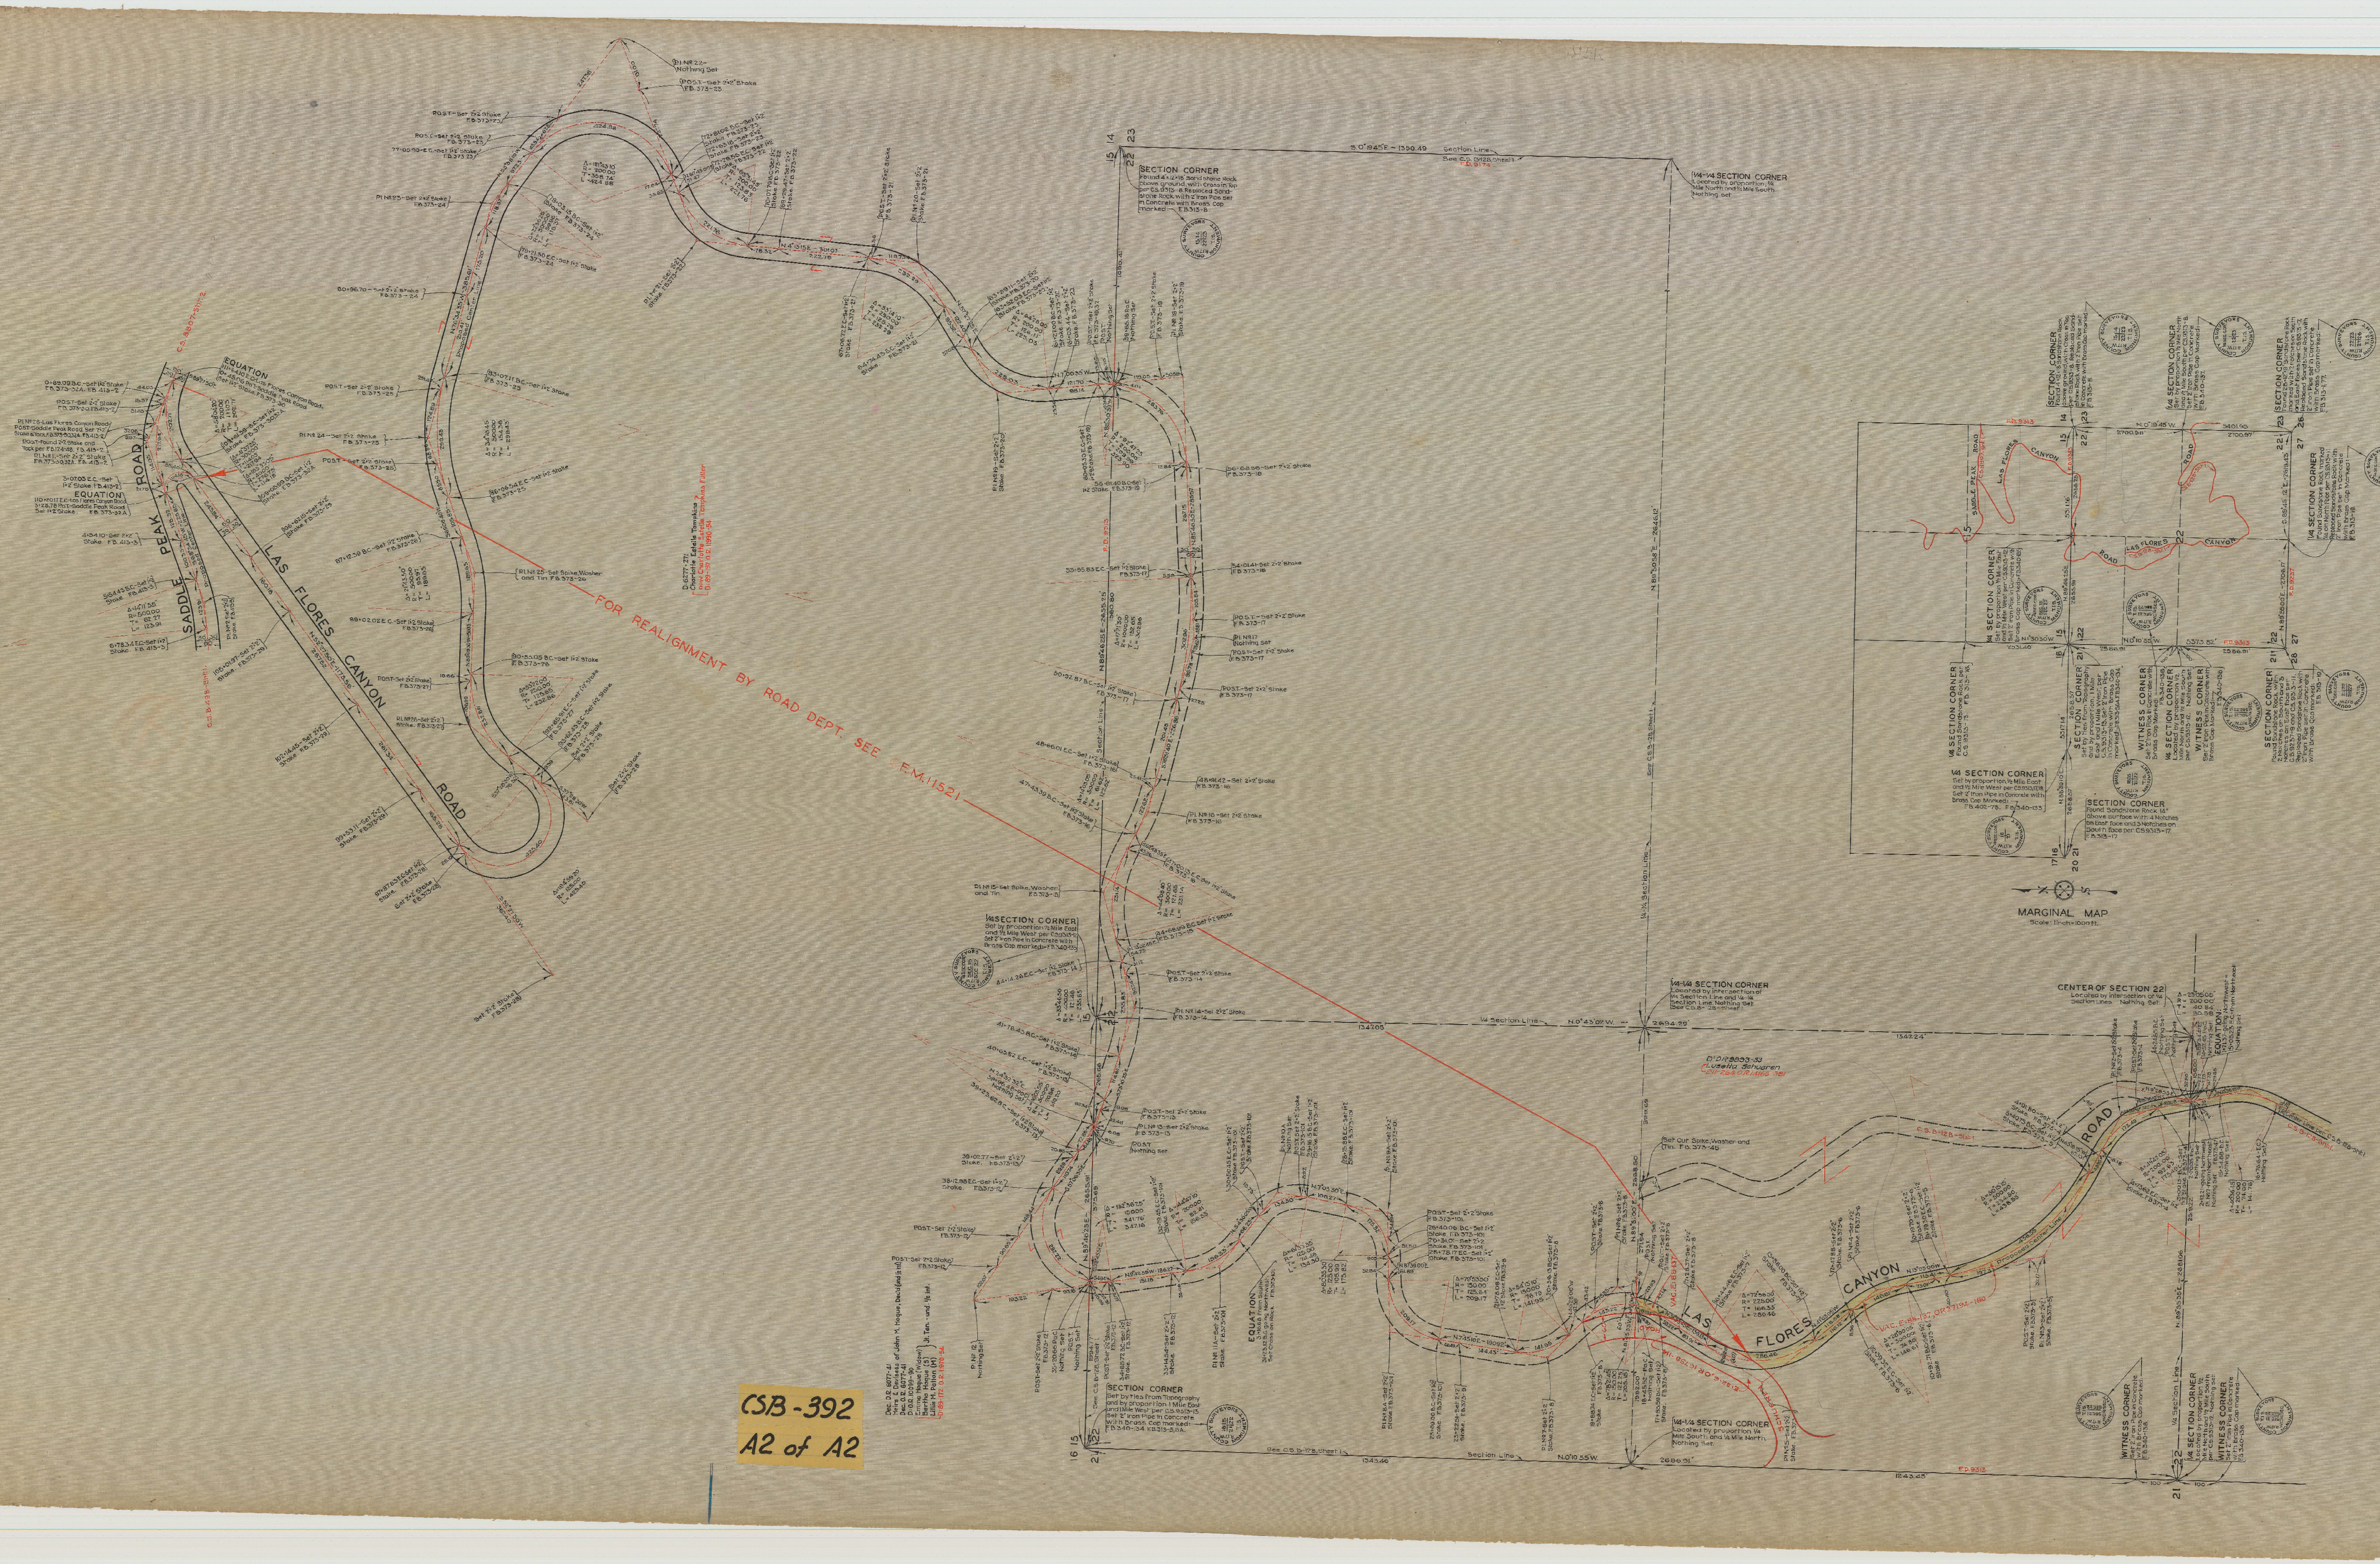
SADDLE PEAK ROAD
LAS FLORES CANYON ROAD
EQUATION
111+64.10 E.C.-Las Flores Canyon Road
0+45.06 B.C.-Saddle Peak Road
Set 1x2 Stake. F.B.373-30
EQUATION
110+20.17 E.C.-Las Flores Canyon Road
3+28.78 P.O.S.T.-Saddle Peak Road
Set 1x2 Stake. F.B.373-32A
C.S. 9807-Sht. 2
C.S.B. 498-Sht. 1
P.I. No 22-Nothing Set
P.I. No 23-Set 2x2 Stake F.B.373-24
P.I. No 24-Set 2x2 Stake F.B.373-25
P.I. No 25-Set Spike, Washer and Tin F.B.373-26
P.I. No 26-Set 2x2 Stake F.B.373-27
FOR REALIGNMENT BY ROAD DEPT. SEE F.M. 11521
D. 6277-271
Charlotte Estelle Tompkins
now Charlotte Estelle Tompkins Fuller
D. 89-187 O.R. 1990-54
SECTION CORNER
Found 4"x12"x18" Sandstone Rock above ground, with Cross in Top per C.S. 9313-8. Replaced Sandstone Rock with 2" Iron Pipe set in Concrete with Brass Cap marked- F.B.313-8
S. 0°19'45" E. - 1350.49
Section Line
See C.S. B-128, Sheet 1
F.B. 9174
1/4-1/4 SECTION CORNER
Located by proportion, 1/4 Mile North and 1/2 Mile South. Nothing Set
N. 89°50'58" E. - 2646.12
1/4-1/4 Section Line
See C.S. B-128 Sheet 1
N. 89°46'25" E. - 2655.25
F.B. 9313
1/4 SECTION CORNER
Set by proportion 1/2 Mile East and 1/2 Mile West per C.S. 9313-12. Set 2" Iron Pipe in Concrete with Brass Cap marked- F.B.340-135
P.I. No 15-Set Spike, Washer and Tin. F.B.373-5
P.I. No 16-Set 2x2 Stake F.B.373-16
P.I. No 17 Nothing Set
P.I. No 18-Set 2x2 Stake F.B.373-19
1/4 Section Line
N. 0°43'07" W.
1347.05
2694.29
1347.24
1/4-1/4 SECTION CORNER
Located by intersection of 1/4 Section Line and 1/4-1/4 Section Line. Nothing Set. See C.S. B-128-Sheet 1
D. O.R. 9893-33
Lusetta Schueren
D. 17-264 O.R. 14166-381
Set Cut Spike, Washer and Tin. F.B.373-45
C.S. B-128-Sht. 1
EQUATION
Dec. D.R. 6077-41
Heirs & Devisees of John M. Hogue, Dec'd (und ½ int.)
Dec. O.R. 6077-41
D. O.R. 10099-90
Emma Hogue (Widow)
Bertha Hogue (S)
Lillie M. Patton (M)
Jt. Ten. - und ½ int.
D. 89-172 O.R. 1970-54
P.I. No 12 Nothing Set
SECTION CORNER
Set by Ties from Topography and by proportion 1 Mile East and 1 Mile West per C.S. 9313-13. Set 2" Iron Pipe in Concrete with Brass Cap marked- F.B.340-134 F.B.313-5, 8A.
See C.S. B-128, Sheet 1
Section Line
N. 0°10'55" W.
1343.46
2686.91
1243.45
1/4-1/4 SECTION CORNER
Located by proportion 1/4 Mile South and 1/4 Mile North. Nothing Set.
VAC. E. 88-137
VAC. E. 88-137, O.R. 37194-180
Proposed Center Line
LAS FLORES CANYON ROAD
CENTER OF SECTION 22
Located by intersection of 1/4 Section Lines. Nothing Set.
EQUATION
WITNESS CORNER
Set 2" Iron Pipe in Concrete with Brass Cap marked- F.B.340-138
1/4 SECTION CORNER
Located by proportion 1/2 Mile North and 1/2 Mile South per C.S. 9313-12. Nothing Set.
WITNESS CORNER
Set 2" Iron Pipe in Concrete with Brass Cap marked- F.B.340-136
1/4 Section Line
N. 89°55'35" E. - 2681.06
COUNTY SURVEYORS MONUMENT
MARGINAL MAP
Scale: 1 inch = 1000 ft.
SECTION CORNER
Found 4"x12"x18" Sandstone Rock above ground with Cross in Top per C.S. 9313-8. Replaced Sandstone Rock with 2" Iron Pipe set in Concrete with Brass Cap marked- F.B.313-8
1/4 SECTION CORNER
Set by proportion 1/2 Mile North and 1/2 Mile South per C.S. 9313-8. Set 2" Iron Pipe in Concrete with Brass Cap marked- F.B.340-137
SECTION CORNER
Found 26"x12"x18" Sandstone Rock marked with 2 notches on South and East Faces per C.S. 9313-7. Replaced Sandstone Rock with 2" Iron Pipe set in Concrete with Brass Cap marked- F.B.313-17
N. 0°19'45" W.
5401.95
2700.98
2700.97
1/4 SECTION CORNER
Found Sandstone Rock marked ¼ on North Face per C.S. 9313-11. Replaced Sandstone Rock with 2" Iron Pipe set in Concrete with Brass Cap marked- F.B.313-18
1/4 SECTION CORNER
Found Sandstone Rock per C.S. 9313-15. F.B.313-16
1/4 SECTION CORNER
Set by proportion ½ Mile East and ½ Mile West per C.S. 9313-12, 18. Set 2" Iron Pipe in Concrete with Brass Cap Marked- F.B.402-78. F.B.340-133
SECTION CORNER
Set by Ties from Topography and by proportion 1 Mile East and 1 Mile West per C.S. 9313-13. Set 2" Iron Pipe in Concrete with Brass Cap marked- F.B.313-5, 8A. F.B.340-134.
WITNESS CORNER
Set 2" Iron Pipe in Concrete with Brass Cap Marked- F.B.340-138
1/4 SECTION CORNER
Located by proportion 1/2 Mile North and 1/2 Mile South per C.S. 9313-12. Nothing Set.
WITNESS CORNER
Set 2" Iron Pipe in Concrete with Brass Cap Marked- F.B.340-136
SECTION CORNER
Found Sandstone Rock with 2 Notches on South and 3 Notches on East Face per C.S. 9237-9 and C.S. 9313-11. Replaced Sandstone Rock with 2" Iron Pipe set in Concrete with Brass Cap marked- F.B.313-19
SECTION CORNER
Found Sandstone Rock 14" above surface with 4 Notches on East face and 3 Notches on South face per C.S. 9313-17. F.B.313-17
SADDLE PEAK ROAD
LAS FLORES CANYON ROAD
N. 89°46'25" E.
N. 0°30'30" W.
N. 0°10'55" W.
5373.82
2586.91
N. 89°55'00" E. - 2706.17
S. 89°45'12" E. - 2719.45
F.D. 9237
F.D. 9313
N
S

CSB - 392
A2 of A2

CSB - 392
A1 of A2

MAP OF
# LAS FLORES CANYON ROAD
FROM
NORTH LINE OF S½ OF SEC. 22, T.1S. R.17W. S.B.M.
TO
SADDLE PEAK ROAD

COUNTY SURVEYORS MAP No B-392
SCALE:- 1 INCH = 100 FT.

WORK ORDER No 900

J.E. ROCKHOLD - COUNTY SURVEYOR
SURVEYED DEC. 1928 - APR. 1929

SURVEYED UNDER INSTRUCTIONS OF THE
BOARD OF SUPERVISORS PER ORDER DATED
APR. 9, 1928
BEARINGS ARE BASED ON OBSERVATION OF
POLARIS PER F.B. 373-33

F.B. 373-1-32, 47, 101. F.B. 340-133, 138.

FIELD WORK BY...... C.A. BENSON
OFFICE WORK BY....... G.I. PIPPIN
M.H. CURTIS
R.W. McALLISTER
CHECKED BY.......... A.A. ROESER

Sht. 59

FOR PROFILE SEE C.S. B-496
FOR CROSS-SECTIONS SEE C.S. B-497-1-7