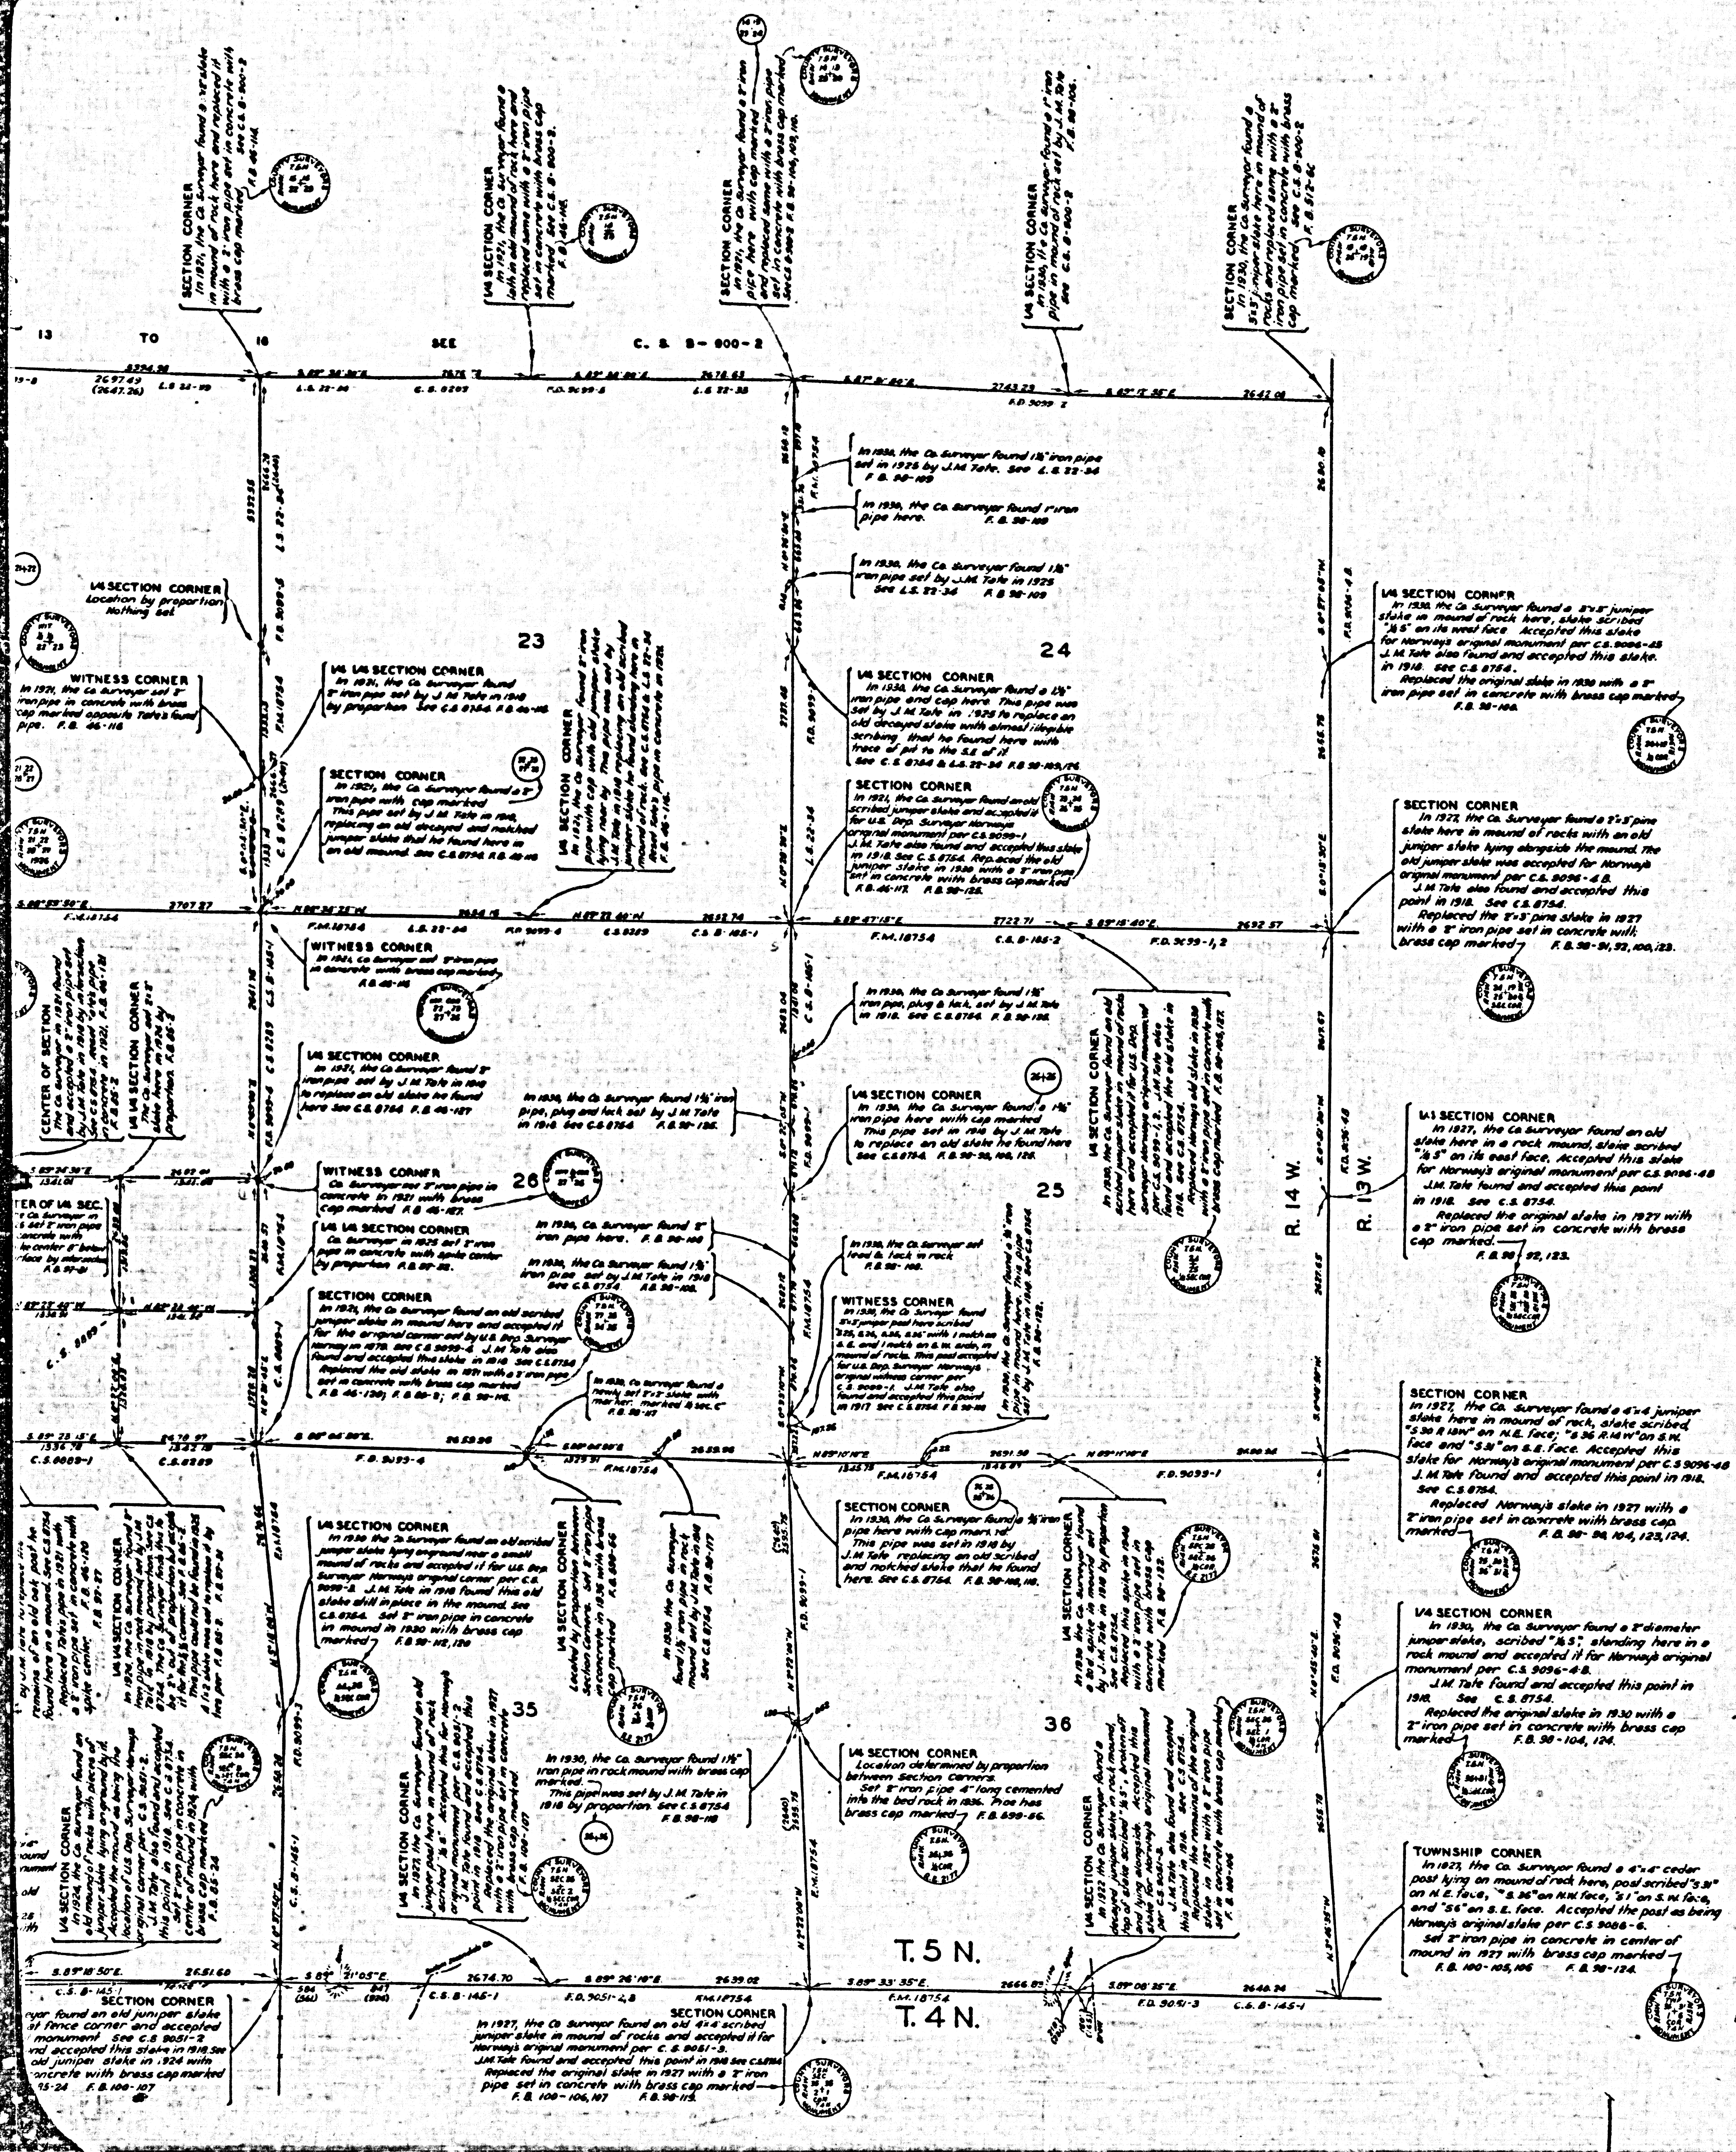
23
24
25
26
35
36
T.5 N.
T.4 N.
R. 14 W.
R. 13 W.
C.S. B-900-2
F.M. 18754
C.S. B-185-2
C.S. B-145-1
L.S. 22-34
1/4 1/4 SECTION CORNER
In 1921, the Co. Surveyor found 2" iron pipe set by J.M. Tate in 1918 by proportion. See C.S. 8754. F.B. 46-116
SECTION CORNER
In 1921, the Co. Surveyor found a 2" iron pipe with cap marked. This pipe set by J.M. Tate in 1918, replacing an old decayed and notched juniper stake that he found here in an old mound. See C.S. 8754. F.B. 46-116
WITNESS CORNER
In 1924, Co. Surveyor set 2" iron pipe in concrete with brass cap marked. F.B. 46-116
1/4 SECTION CORNER
In 1921, the Co. Surveyor found 2" iron pipe set by J.M. Tate in 1918 to replace an old stake he found here. See C.S. 8754. F.B. 46-127
In 1930, the Co. Surveyor found 1½" iron pipe, plug and tack set by J.M. Tate in 1918. See C.S. 8754. F.B. 98-126.
WITNESS CORNER
Co. Surveyor set 2" iron pipe in concrete in 1921 with brass cap marked. F.B. 46-127.
1/4 1/4 SECTION CORNER
Co. Surveyor in 1925 set 2" iron pipe in concrete with spike center by proportion. F.B. 97-32.
In 1930, Co. Surveyor found 2" iron pipe here. F.B. 98-106
In 1930, the Co. Surveyor found 1½" iron pipe set by J.M. Tate in 1918. See C.S. 8754. F.B. 98-108.
SECTION CORNER
In 1921, the Co. Surveyor found an old scribed juniper stake in mound here and accepted it for the original corner set by U.S. Dep. Surveyor Norway in 1878. See C.S. 9099-4. J.M. Tate also found and accepted this stake in 1918. See C.S. 8754. Replaced the old stake in 1921 with a 2" iron pipe set in concrete with brass cap marked. F.B. 46-130; F.B. 88-2; F.B. 98-116.
In 1930, Co. Surveyor found a newly set 2"x2" stake with marker marked "¼ sec. C." F.B. 98-117
1/4 SECTION CORNER
In 1930 the Co. Surveyor found an old scribed juniper stake lying on ground near a small mound of rocks and accepted it for U.S. Dep. Surveyor Norway's original corner per C.S. 9099-3. J.M. Tate in 1918 found this old stake still in place in the mound. See C.S. 8754. Set 2" iron pipe in concrete in mound in 1930 with brass cap marked. F.B. 98-112, 120
In 1930, the Co. Surveyor found 1½" iron pipe in rock mound with brass cap marked. This pipe was set by J.M. Tate in 1918 by proportion. See C.S. 8754. F.B. 98-118
In 1930, the Co. Surveyor found 1½" iron pipe set in 1925 by J.M. Tate. See L.S. 22-34. F.B. 98-109
In 1930, the Co. Surveyor found 1" iron pipe here. F.B. 98-109
In 1930, the Co. Surveyor found 1½" iron pipe set by J.M. Tate in 1925. See L.S. 22-34. F.B. 98-109
1/4 SECTION CORNER
In 1930, the Co. Surveyor found a 1½" iron pipe and cap here. This pipe was set by J.M. Tate in 1925 to replace an old decayed stake with almost illegible scribing that he found here with trace of pit to the S.E. of it. See C.S. 8754 & L.S. 22-34. F.B. 98-109, 126.
SECTION CORNER
In 1921, the Co. Surveyor found an old scribed juniper stake and accepted it for U.S. Dep. Surveyor Norway's original monument per C.S. 9099-1. J.M. Tate also found and accepted this stake in 1918. See C.S. 8754. Replaced the old juniper stake in 1930 with a 2" iron pipe set in concrete with brass cap marked. F.B. 46-117. F.B. 98-125.
In 1930, the Co. Surveyor found 1½" iron pipe, plug & tack, set by J.M. Tate in 1918. See C.S. 8754. F.B. 98-126.
1/4 SECTION CORNER
In 1930, the Co. Surveyor found a 1½" iron pipe here with cap marked. This pipe set in 1918 by J.M. Tate to replace an old stake he found here. See C.S. 8754. F.B. 98-98, 100, 126.
In 1930, the Co. Surveyor set lead & tack in rock. F.B. 98-100.
WITNESS CORNER
In 1930, the Co. Surveyor found 5"x5" juniper post here scribed "S 25, S 26, S 35, S 36" with 1 notch on S.E. and 1 notch on S.W. side, in mound of rocks. This post accepted for U.S. Dep. Surveyor Norway's original witness corner per C.S. 9099-1. J.M. Tate also found and accepted this point in 1917. See C.S. 8754. F.B. 98-100
SECTION CORNER
In 1930, the Co. Surveyor found a ½" iron pipe here with cap marked. This pipe was set in 1918 by J.M. Tate replacing an old scribed and notched stake that he found here. See C.S. 8754. F.B. 98-108, 118.
1/4 SECTION CORNER
Location determined by proportion between Section Corners. Set 2" iron pipe 4" long cemented into the bed rock in 1936. Pipe has brass cap marked. F.B. 699-56.
1/4 SECTION CORNER
In 1930 the Co. Surveyor found a 2"x2" juniper stake in mound of rock here, stake scribed "¼ S" on its west face. Accepted this stake for Norway's original monument per C.S. 9096-4B. J.M. Tate also found and accepted this stake in 1918. See C.S. 8754. Replaced the original stake in 1930 with a 2" iron pipe set in concrete with brass cap marked. F.B. 98-106
SECTION CORNER
In 1927, the Co. Surveyor found a 2"x3" pine stake here in mound of rocks with an old juniper stake lying alongside the mound. The old juniper stake was accepted for Norway's original monument per C.S. 9096-4B. J.M. Tate also found and accepted this point in 1918. See C.S. 8754. Replaced the 2"x3" pine stake in 1927 with a 2" iron pipe set in concrete with brass cap marked. F.B. 98-91, 92, 100, 123.
1/4 SECTION CORNER
In 1927, the Co. Surveyor found an old stake here in a rock mound, stake scribed "¼ S" on its east face. Accepted this stake for Norway's original monument per C.S. 9096-4B. J.M. Tate found and accepted this point in 1918. See C.S. 8754. Replaced the original stake in 1927 with a 2" iron pipe set in concrete with brass cap marked. F.B. 98-92, 123.
SECTION CORNER
In 1927, the Co. Surveyor found a 4"x4 juniper stake here in mound of rock, stake scribed "S 30 R 13W" on N.E. face; "S 36 R.14 W" on S.W. face and "S 31" on S.E. face. Accepted this stake for Norway's original monument per C.S. 9096-4B. J.M. Tate found and accepted this point in 1918. See C.S. 8754. Replaced Norway's stake in 1927 with a 2" iron pipe set in concrete with brass cap marked. F.B. 98-98, 104, 123, 124.
1/4 SECTION CORNER
In 1930, the Co. Surveyor found a 2" diameter juniper stake, scribed "¼ S", standing here in a rock mound and accepted it for Norway's original monument per C.S. 9096-4B. J.M. Tate found and accepted this point in 1918. See C.S. 8754. Replaced the original stake in 1930 with a 2" iron pipe set in concrete with brass cap marked. F.B. 98-104, 124.
TOWNSHIP CORNER
In 1927, the Co. Surveyor found a 4"x4" cedar post lying on mound of rock here, post scribed "S 31" on N.E. face, "S 36" on N.W. face, "S 1" on S.W. face, and "S 6" on S.E. face. Accepted the post as being Norway's original stake per C.S. 9086-6. Set 2" iron pipe in concrete in center of mound in 1927 with brass cap marked. F.B. 100-105, 106. F.B. 98-124.
SECTION CORNER
In 1927, the Co. Surveyor found an old 4"x4" scribed juniper stake in mound of rocks and accepted it for Norway's original monument per C.S. 9051-3. J.M. Tate found and accepted this point in 1918. See C.S. 8754. Replaced the original stake in 1927 with a 2" iron pipe set in concrete with brass cap marked. F.B. 100-106, 107. F.B. 98-115.

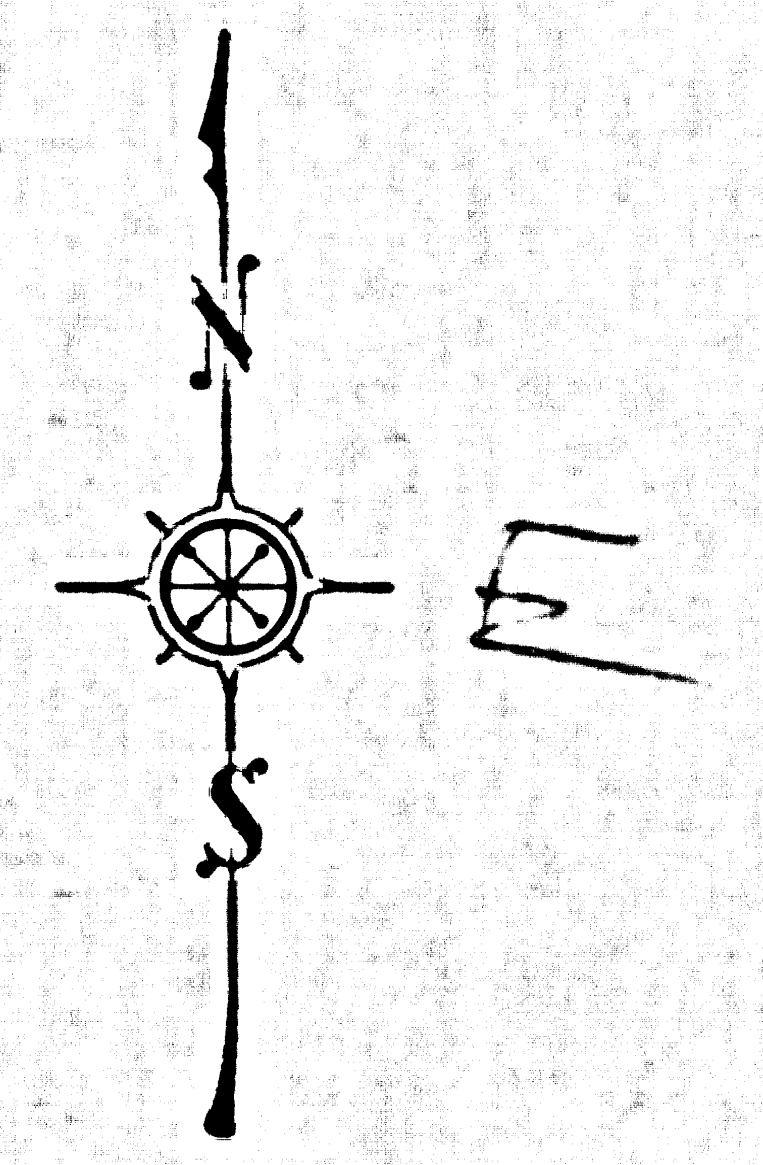

COUNTY OF LOS ANGELES
MAP OF

SECTION LINES AND CORNERS
ESTABLISHED BY THE COUNTY SURVEYOR
IN
T.5N. R.14 & 15W. S.B.M.

COUNTY SURVEYORS MAP NO. B-900
SHEET NO. 1 OF 2 SHEETS
SCALE: 1 INCH=600 FT.

JOB NUMBER 4999

C. E. ARNOLD - COUNTY SURVEYOR
THIS MAP COMPILED FROM SURVEYS MADE
BETWEEN 1921 AND 1940.

BEARINGS ARE BASED ON THE BEARING OF
THE SOUTH LINE OF SECTION 31 T.6N. R.13W.
AS SHOWN C.S. B-745-8.

FIELD BOOKS AS SHOWN IN EACH NOTE.

FIELD WORK BY H. WAITE, C.F. BRUNTY, E.T. MANKEY,
A. BRACKETT, C.A. BENSON, T.J. STEVENSON,
E.A. ROSECRANS.

OFFICE WORK BY K. R. McPHERSON
C.E. DROWN

CHECKED BY K. R. McPHERSON

THIS MAP FILED MARCH 1953
WILLIAM J. FOX - COUNTY SURVEYOR

INDEX 77 & 78 & 64

Monument shown at N. ¼ corner of section 35, T5N, R15W by SK 11/15/68

CSB- 900-1
A1 OF A3

SECTION CORNER
J.M. Tate found original monument here. No trace of the original now remains. Relocated this corner at Tate's record distances from the Section Corner 1 mile east and Witness Corners ½ mile south per C.S. 8754. Set 2" iron pipe in concrete in 1940 with brass cap marked. F.B. 512-42.

Found 2x2" stake with 1" iron pipe alongside it. Probably a Tate random triangulation point. F.B. 512-42.

Found 36" live oak tree, blazed and scribed - A Bearing tree to the Witness Corner established by U.S. Dep. Surveyor Norway in 1879. See C.S. 9099-14. Also found stump hole of other Bearing Tree. F.B. 512-44.

1/4 SECTION CORNER
Located at record distance from Witness Corner per C.S. 9099-14. Set 2" iron pipe in concrete in 1940 with brass cap marked F.B. 512-43.

WITNESS CORNER
Located at record distance and bearing from Bearing Tree per C.S. 9099-14. Set 2" iron pipe in concrete in 1933 with brass cap marked F.B. 512-44.

Found 1x2" stake in 1926 F.B. 97-82

... and accepted it for U.S. Dep. Surveyor Norway's original corner per C.S. 9051-1. J.M. Tate also found and accepted this stake in 1918. See C.S. 8754. Replaced the old stake in 1925 with a 2" iron pipe set in concrete with brass cap marked. F.B. 97-37.

WITNESS CORNER
In 1926 the Co. Surveyor found an old 1x2" stake in mound of rock and accepted it for the location of U.S. Dep. Surveyor Norway's original witness corner per C.S. 9051-1. This point is on east side of Tick Canyon at foot of hill sloping upwards to the east which checks Norway's topography calls. Replaced the old 1x2" stake in 1927 with a 2" iron pipe set in concrete with brass cap marked. F.B. 97-95.

1/4 SECTION CORNER
Located at Record distance from Witness Corner per C.S. 9051-1

CSB - 900-1
A2 OF A3



This Line Re-established by the County Surveyor in 1930 by proportion as shown on C.S. B-438-1

CLOSING TOWNSHIP CORNER
In 1929, the Co. Surveyor found a 6"x8" rock, 9" above surface marked "C.C. T5N" on south face with 6 notches on each of the east, south and west faces.
The original Closing Corner, a 4"x4" post in stone mound was set by U.S. Dep. Surveyor Norway in 1879. See C.S. 9362-4.
In 1914 Percy L. Day, a National Forest Examiner of the U.S. Forest Service, in making a Survey for Homestead Entry Survey No. 83, found Norways old post lying on stone mound and replaced it with the found stone. See C.S. 9375-1. Replaced Days stone in 1930 with a 2" iron pipe set in concrete with brass cap marked. F.B. 385-107.

SECTION CORNER
A 2" iron pipe set in concrete with brass cap marked See C.S. B-438-1

¼ SECTION CORNER
To Sec. 6 - T.5N. - R.15W. A 2" iron pipe set in concrete with brass cap marked See C.S. B-438-1

¼ SECTION CORNER
To Sec. 32 - T.6N. - R.15W. A 2" iron pipe set in concrete with brass cap marked. See C.S. B-438-1

CLOSING CORNER
A 2" iron pipe set in concrete with brass cap marked. See C.S. B-438-1

Tie Line - Not Section Line F.D. 9101 - 17, 16, 19

SECTION CORNER
A 2" iron pipe set in concrete with brass cap marked. See C.S. B-438-1

¼ SECTION CORNER
To Sec. 5 - T.5N. - R.15W. A 2" iron pipe set in concrete with brass cap marked. See C.S. B-438-1

¼ SECTION CORNER
To Sec. 33 - T.6N. - R.15W. A 2" iron pipe set in concrete with brass cap marked. See C.S. B-438-1

CLOSING CORNER
A 2" iron pipe set in concrete with brass cap marked. See C.S. B-438-1

Tie Line - Not Section Line

SECTION CORNER
A 2" iron pipe set in concrete with brass cap marked. See C.S. B-438-1

¼ SECTION CORNER
Located by proportion between Section Corners. Set 2" iron pipe in concrete in 1930 with brass cap marked F.B. 385-82.

SECTION CORNER
Located at record distance from witness corner per C.S. 9101-9. Set 2" iron pipe in concrete in 1930 with brass cap marked. Set on a shelf cut into partially decomposed granite boulder. F.B. 385-80, 248.

SECTION CORNER
Located by proportion 3 miles north and 1 mile south. Set 2" iron pipe in concrete in 1930 with brass cap marked. This point falls on S.E. slope. near top of ridge. F.B. 385-96.

¼ SECTION CORNER
Location by proportion Nothing Set

Location for Section Corner by proportion 3 miles north, 3 miles south, 2 miles east and 1 mile west. Nothing set.

¼ SECTION CORNER
Location by proportion Nothing set

SECTION CORNER
Located by proportion 3 miles north, 1½ miles South, 2 miles west and 1 mile east. Set 2" iron pipe in concrete in 1930 with brass cap marked F.B. 385-84.

Found sandstone rock point believed to be the prominent rock mentioned by Norway per C.S. 9101-9 F.B. 385-79

WITNESS CORNER
In 1929, the Co. Surveyor found a mound of rock on top of ridge here. Part of mound looked old and part more recent and pieces of old inscribed post were found in mound. Accepted as being Norways original witness corner per C.S. 9101-9. Set 2" iron pipe in concrete in center of mound in 1930 with brass cap marked F.B. 385-80

¼ SECTION CORNER
Located by proportion between Section Corners. Set 2" iron pipe in concrete in 1930 with brass cap marked. This point falls on Southwest slope about 200'± west of top of spur. F.B. 385-94.

¼ SECTION CORNER
Location by proportion Nothing Set

¼ SECTION CORNER
Location by proportion Nothing set.

Found rock mound 1.5' diameter by 8" high near toe of slope. Set 1"x2" stake in center of mound. F.B. 385-78.

¼ SECTION CORNER
Located by proportion between adjacent Section Corners. Set 2" iron pipe in concrete in 1930 with brass cap marked F.B. 385-111

¼ SECTION CORNER
Located by proportion between adjacent Section Corners. Set 2" iron pipe in concrete in rock mound in 1930 wit brass cap marked F.B. 385-78

¼ SECTION CORNER
Located at record distance from witness corner per C.S. 9101-12. Set 2" iron pipe in concrete in 1930 with brass cap marked. F.B. 385-71

¼ SECTION CORNER
In 1929, the Co. Surveyor found a 6"x10" granite rock 6" high marked "¼" on its South face with mound of rock east of corner. The tie to the Bearing Tree indicates that this rock is a replacement of Norways original post per C.S. 9101-9. Replaced the granite stone in 1920 with a 2" iron pipe set in concrete with brass cap marked F.B. 385-75. F.B. 512-7

SECTION CORNER
Located at record distance and bearing from Norway's bearing tree per C.S. 9362-2. Set 2" iron pipe in concrete in 1928 with brass cap marked. F.B. 314-152. F.B. 385-92.

Location for Section Corner by proportion 4 miles north, 2 miles south, 1½ miles east and 1 mile west. Nothing set.

In 1928, the Co. Surveyor found a 32" oak tree with old blaze on its NW face and accepted it for the bearing tree established by U.S. Dep. Surveyor Norway in 1879. See C.S. 9362-2 F.B. 314-152

Location for ¼ Section Corner By proportion between Section Corners. Nothing set.

Found small mound of rock with a 1"x1" stake 4' long lying alongside it. Set 1"x1" stake in center of mound F.B. 385-68

SECTION CORNER
Located by proportion 4 miles north, ½ mile south, 2 miles west and ½ mile east. Set 2" iron pipe in concrete in 1930 with brass cap marked, 30'± north of top of ridge. F.B. 385-68.

WITNESS CORNER
Found mound of rock 3' in diameter with old post marked W.P. lying on ground near by. This is Norway's original. Witness corner per C.S. 9101-12. Set 2" iron pipe in concrete in center of mound in 1930 with brass cap marked. This monument falls at toe of slope on west side of canyon as per Norways notes. F.B. 385-71

SECTION CORNER
In 1929 the Co. Surveyor found a 6"x14" sandstone 10" above surface in rock mound, stone marked with 3 notches on east face and 2 notches on south face. Accepted this rock for Section corner and replaced it in 1929 with a 2" iron pipe set in concrete with brass cap marked F.B. 385-73

In 1929, the Co. Surveyor found a sycamore tree 30" in diameter at base forking into 2 - 10" branches, Base blazed and marked "B.T. ¼" Norways Beaing Tree per C.S. 9101-9. F.B. 385-75

In 1928, the Co. Surveyor found 40" blazed oak and accepted it for a bearing tree established by U.S. Dep. Surveyor Norway in 1879. See C.S. 9362-2. F.B. 314-150.

¼ SECTION CORNER
In 1928, the Co. Surveyor found a 2"x2" stake in rock mound at east edge of canyon. This point checks Norways tie to bearing tree per C.S. 9362-2.
Replaced the 2"x2" stake in 1928 with a 2" iron pipe set in concrete with brass cap marked. F.B. 314-150.

Location for ¼ Section Corner By proportion between Section Corners. Nothing set.

CENTER OF SECTION
Located by calculated Intersection. Set 2" iron pipe in concrete in 1934 with brass cap marked F.B. 512-131

¼ SECTION CORNER
Located by proportion between Section Corners. Set 2" iron pipe in concrete in 1934 with brass cap marked. F.B. 512-131.

¼ SECTION CORNER
In 1929, the Co. Surveyor found a mound of rock 3' in diameter by 1' high. The distance to the edge of mesa to the south checks Norways topographic call per C.S. 9101-12.
Accepted the mound and in 1930 set a 2" iron pipe in concrete, in its center, with brass cap marked F.B. 385-67.

¼ SECTION CORNER
Located by proportion between Section Corners. Set 2" iron pipe in concrete in rock mound in 1930 with brass cap marked. F.B. 385-248.

¼ SECTION CORNER
In 1933, Co. Surveyor found an old post, scribing illegible, in rock mound and accepted it as being Norways original post per C.S. 9101-8. Replaced the old post in 1933 with a 2" iron pipe set in concrete with brass cap marked F.B. 512-10 F.B. 775-38.

¼ SECTION CORNER
Located at record distance from witness corner per C.S. 9101-5 ~~Nothing set~~ Set County Engineer monument marked: 6" above surface 9/25/68. F.B. 1872-153

WITNESS CORNER
In 1933, the Co. Surveyor found an old stake in mound and accepted it for Norways witness to the ¼ Section Corner per C.S. 9101-5 Replaced the old stake in 1933 with a 2" iron pipe set in concrete

¼ SECTION CORNER
Located by proportion between Section Corners. Set 2" iron pipe in concrete in 1924 with brass cap marked F.B. 512-125

Found hewn post in rock mound in 1933. F.B. 512-124.

In 1933, Co. Surveyor found mound of rock at corner of Mining Claim. Set 1"x2" in center of mound F.B. 512-126.

SECTION CORNER
In 1928, the Co. Surveyor found a hard stone firmly embedded in a rock mound. Stone was marked with a chisled cross. At that time a Mr. John Ferrei stated that this stone had been accepted as the corner for 20 years. Norway did not set any monument here on the original survey in 1879. He set a witness corner 2 chains north See C.S. 9101-11, 12.
This corner falls in a steep ravine as called for by Norway and it is about record distance from the beginning of descent to the north.
Replaced the found stone in 1928, with a 2" iron pipe set in concrete with brass cap marked. F.B. 343-12, 13.

South edge of Mesa

Found old 4"x4" post and nail at toe of slope, part of stake split off, top of stake painted white and scribed ¼ GFG on south face. F.B. 385-66.

Found 2"x2" stake with white top on side hill. F.B. 385-66.

North edge of Mesa.

Found mound of rock 2' in diameter 1' high Probably Norway's witness corner to the Section Corner per C.S. 9101-11. F.B. 343-13

SECTION CORNER
In 1927, the Co. Surveyor found old white 2"x2" stake in mound of rock and replaced same with a 2" iron pipe set in concrete with brass cap marked. F.B. 314-56. F.B. 512-124.

SECTION CORNER
Located by proportion 5 miles north, 1 mile south, 1 mile east and 1 mile west. Set 2" iron pipe in concrete in 1934 with brass cap marked. F.B. 512-126.

¼ SECTION CORNER
Location by proportion Nothing set

In 1933 Co. Surveyor found a partly burned 4"x4" Post marked W.P.W.N. ¼ 32 B. A mining claim corner. F.B. 512-129.

¼ SECTION CORNER
In 1928, the Co. Surveyor found 2" iron pipe, plug and tack in small rock mound. This pipe is probably a replacement of Norway's original monument per C.S. 9101-11.
Replaced the pipe in 1928 with a 2" iron pipe set in concrete with brass cap. marked. F.B. 343-14.

Found led nail in rock mound on south edge of mesa F.B. 385-13.

Found rock mound on top of ridge. F.B. 343-11

Found clump of sycamores growing from same root with evidence that Norway's Bearing Tree per C.S. 9101-1 was formerly one of the clump. F.B. 343-14.

¼ SECTION CORNER
Located by proportion between Section Corners. Set 2" iron pipe in concrete with brass cap marked. This monument first set in 1928. In 1930 it was found to have been incorrectly set in 1928 and was reset in its true position. F.B. 385-58, 349 F.B. 343-10

SECTION CORNER
In 1928 the Co. Surveyor found 1½" iron pipe in rock mound with a 3" Post, not the original monument, 1.5' north of pipe.
The tie to ridge to the south checks Norways call per C.S. 9101-8.
Accepted the pipe for the corner and replaced it in 1928 with a 2" iron pipe set in concrete with brass cap marked. F.B. 343-8 F.B. 775-38.

SECTION CORNER
In 1933, the Co. Surveyor found a portion of old scribed stake in mound of rock and in 1933 replaced it with a 2" iron pipe set in concrete with brass cap marked see C.S. B-1563-1 F.B. 512-13 F.B. 775-39 F.B. 1872-192

¼ SECTION CORNER
In 1928, the Co. Surveyor found rock mound. The tie to ridge to the north checks Norways call per C.S. 9101-8.
Set 2" iron pipe in concrete in center of rock mound in 1928 with brass cap marked. F.B. 343-7.

Found ½" iron pipe in rock mound F.B. 775-40

1/4 SECTION CORNER
Located by proportion between Section Corners. Set 2" iron pipe in concrete in 1940 with brass cap marked. See C.S. B-1563-1 F.B. 775-40.

¼ SECTION CORNER
Located between Sec... Set 2" iron p... in 1940 with bras... See C.S.

TOWNSHIP CORNER
In 1927, the Co. Surveyor found a 2"x2" stake in rock mound here 10' east of top of ridge with 4"x4" stake scribed "S.36 R.16 W." on one side lying on ground near by. This 2"x2" stake was also found by S.G. Chamberlain, a Licensed Surveyor in 1921 and was accepted as the Township Corner by him. See F.B. 314-136 C.
Replaced the 2"x2" stake in 1927 with a 2" iron pipe set in concrete with brass cap marked. F.B. 314-137

¼ SECTION CORNER
Located by proportion between Section Corners. Set 2" iron pipe in concrete in 1930 with brass cap marked F.B. 385-29.

SECTION CORNER
Located by proportion 1 mile east and 1 mile west. Set 2" iron pipe in concrete in 1930 with brass cap marked. F.B. 385-27

Found 4"x4" stake in mound of rock at toe of spur, stake marked "S¼ SW 32" on east face, "RAMCO No.7" on north face, and "Cor 1" on west face. F.B. 385-26

Found 1½" diameter post 3' high in mound of rock on top of spur. F.B. 385-26

¼ SECTION CORNER
Located by proportion between Section Corners. Set 2" iron pipe in concrete in 1930 with brass cap marked. F.B. 385-26

SECTION CORNER
In 1928, Co Surveyor found old 1"x2" stake in intersection of fence lines.
In 1918, C.E. Bailey found a 1" iron pipe here. He obtained an affidavit from W.H. Cruzon to the effect that Cruzon saw the setting of the 1" iron pipe and that it replaced Norway's original monument. See L.S. 8-28, M: 40-118 and Tract No. 3253 - M.B. 36-96.
The old 1"x2" stake is apparently a replacement of the 1" iron pipe.
Replaced it in 1928 with a 2" iron pipe set in concrete with brass cap marked F.B. 343-16. F.B. 98-146

CENTER OF SECTION
Located by Intersection Set 2" iron pipe in concrete in 1928 with brass cap marked F.B. 343-18.

Found 1½" round stake in rock mound F.B. 343-21

SECTION CORNER
Found 2" iron pipe, plug and tack in rock mound. This pipe was set by W.R. Barclay in 1926 by single proportion between S.W. Corner of Sec. 33 and the pipe at 104.74' south of S.E. Corner of Sec. 34.
The County Surveyor accepted Barclay's pipe account of being record distance from both the ¼ Corner north and the Sec. Cor. to the west and replaced it in 1928 with a 2" iron pipe set in concrete with brass cap. marked. See C.S. 8880. F.B. 343-24 F.B. 98-146.

¼ SECTION CORNER
Located by proportion between Section Corners. Set 2" iron pipe in concrete in 1940 with brass cap marked See C.S. B-1563-1 F.B. 98-147.

Found 1½" iron pipe 12" above surface. F.B. 98-148.

SECTION CORNER
Located by intersection of the west line of Sec. 2 with a straight line between the S.E. Cor. of Sec. 36 and the S.W. Corner of Sec. 33. as shown on C.S. B-1563-1. Set 2" iron pipe in concrete in 1940 with brass cap marked. F.B. 98-148 F.B. 775-42.

¼ SECTION CORNER
Located by proportion between Section Corners. Set 2" iron pipe in concrete in 1940 with brass cap marked See C.S. B-1563-1 F.B. 98-149

Located b... east and ... Set 2" iron ... 1940 with bra... See C.S. B

Found 4"x4" stake, 30" high on west slope near foot of slope, stake marked "S¼ S.32" on east face, and "RAMCO. Ex. No.7" on north face. F.B. 385-26.

Found 4"x4" stake, 22" high marked "S¼ S.E. 32" on east face, and "RAMCO Ex No 7" on north face. F.B. 385-26

¼ SECTION CORNER
Located by proportion between Section Corners. Set 2" iron pipe in concrete in 1928 with brass cap marked F.B. 343-21

Found 1½" iron pipe 10" above surface F.B. 98-148

Found 2" iron pipe, 6" above surface. This is the pipe ... Sec. 34 by Barclay who says it was set by Bailey ... See C.S. 8880. Baileys corner should have been ... of here. The Co. Surveyor uses this pipe ... Section 2 as shown on C.S. B-1563-1 ... Section Corner F.B. 98-...

CSB - 900-1
A3 OF A3

T.6N.
T.5N.
T.5N.
T.4N.
R.16W.
R.15W.
31
32
33
34
1
6
5
4
19
20
21
28
29
30
31
32
33
34
35
27
SOUTHERLY BOUNDARY ANGELES NATIONAL FOREST
SOUTHERLY BOUNDARY OF ANGELES NATIONAL FOREST
FOREST BOUNDARY
NATIONAL
ANGELES
WESTERLY BOUNDARY OF ANGELES NATIONAL FOREST
SOUTHERLY BOUNDARY
Tie Line, not Section Line
Tie Line - Not Section Line
S 89°43'15"E 2710.74 2527.76
S.89°43'35"E 2710.74 2456.61
S.89°43'50"E 2710.74 2444.75
S.89°44'10"E. 2710.74 2432.89
N.88°34'50"W. 2552.71 (2534.40)
(5174.40) 5211.78 2659.07 (2640.00)
N.89°09'35"W. 2648.44 (2629.44)
(5258.88) 5296.87 2648.43 (2629.44)
N.89°19'55"W. (2645.94) 2665.05
N 89°19'55"W (2645.94) 2665.05
N.88°16'10"W. 2569.27 (2541.00)
(5181.00) 5238.65 2669.38 (2640.00)
N88°59'15"W. (2634.06) 2663.36
S.89°59'20"W. (2640) 2669.78
N.88°20'50"W. (2640) 2634.82
N 88°25'35"W. 2682.32
N.88°54'05"W. (Not Measured)
N88°54'05"W 2653.05
N.88°22'35"W. (2534.40) 2550.48
N.88°22'35"W. (2640) 2656.74
N.89°05'15"W. (2640) 2656.76
N.89°56'15"E. 2634.72 2674.42
N 89°56'15"E (2634.72) 2674.42
N.89°42'30"W. 2696.68
N.87°07'05"E. 2687.85
S.89°49'30"E. 1020 (990) 1437.11
S.89°53'25"E. 2657.43
S.89°53'25"E. 2688.70
N.89°23'00"W. (2514.60) 2544.45
N.89°23'00"W. (2640) 2671.33
N.89°23'00"W. (2640) 2671.33 1677.40
N 89°43'50"E. (2640) 2642.00
N.89°43'50"E. (2640) 2641.99
S.88°36'10"W. (2640) 2640.79
N.89°10'00"E. (2640) 2637.09
N.0°59'10"E.
N.0°59'10"E.
S.0°16'40"W.
S.0°02'10"E.
N.0°37'55"E.
S.430.86 (Calc.)
N.1°12'35"E.
N.0°42'30"E.
N.0°27'00"E.
N.0°31'15"E. (Not Measured)
N.0°31'15"E.
N.1°32'25"E.
N.0°23'20"E.
N.0°40'45"E.
S.0°44'30"W.
S.0°26'20"W.
N.0°12'00"E.
N.0°14'00"E.
N.0°33'25"E.
N.0°33'25"E. Not Measured
N.0°14'30"E.
N.1°35'45"E.
S.0°06'00"W.
N.0°04'25"W.
N.2°00'30"E.
F.D. 9101-16-17
F.D. 9101-16
F.D. 9101-12, 13
F.D. 9101-15
F.D. 9101-12
F.D. 9101-8, 9
F.D. 9101-14, 15
F.D. 9101-11
F.D. 9101-15
F.D. 9043-11
F.D. 9043-10
C.S. B-438-1
C.S. B-1563-1
Ridge
Wash
Top Loose Ridge