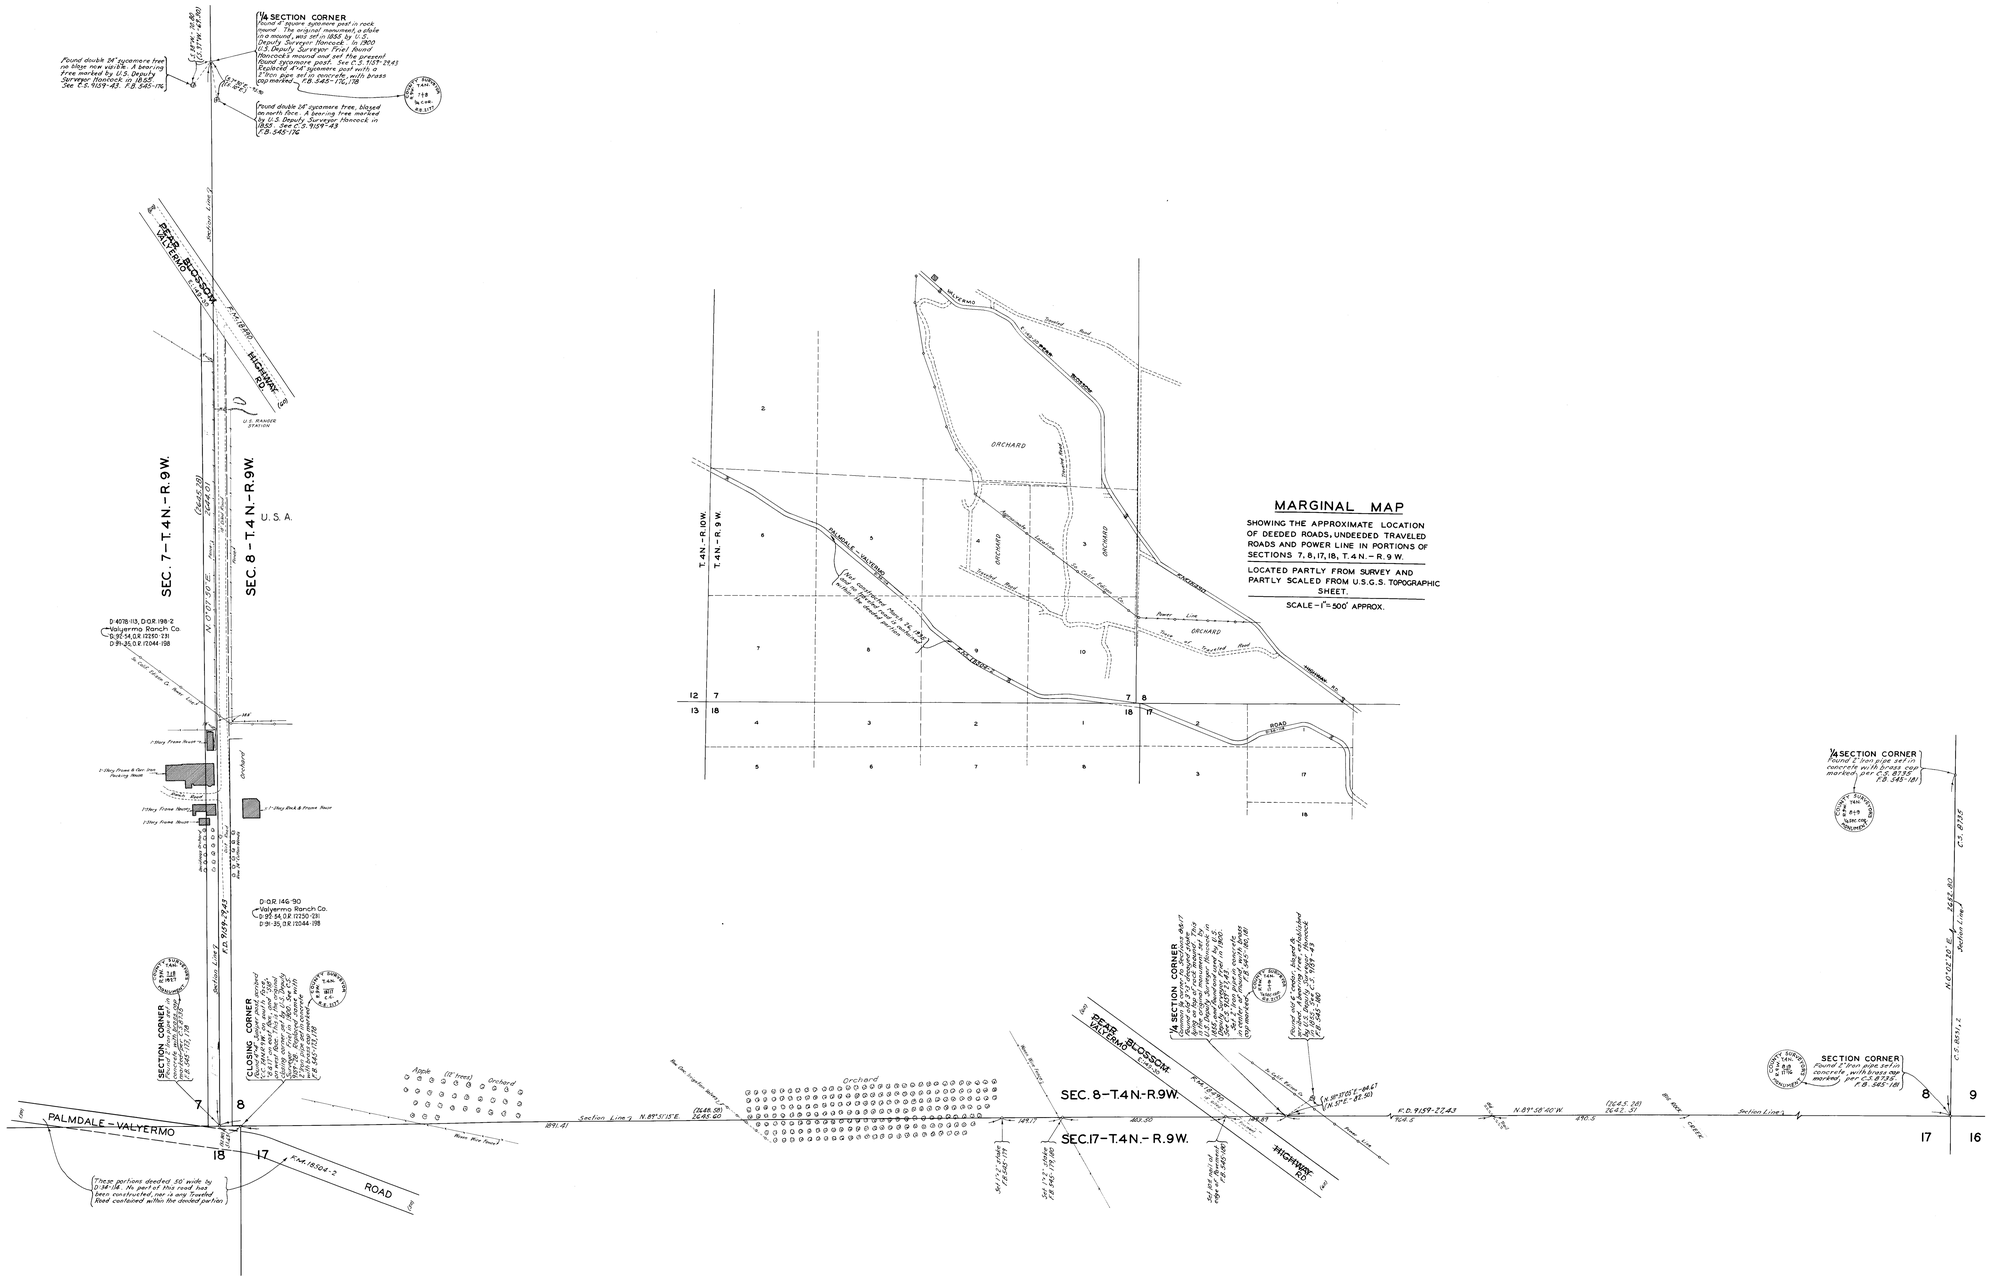
¼ SECTION CORNER
Found 2" square sandstone post in rock mound. The original monument, a stake in a mound, was set in 1855 by U.S. Deputy Surveyor Hancock. In 1900 U.S. Deputy Surveyor Friel found Hancock's mound and set the present found sycamore post. See C.S. 1159-43 and Explored 4"x4" sycamore post with a 3" iron pipe set in concrete, with brass cap marked. F.B. 545-176, 178
Found double 24" sycamore tree on which new notch. A bearing tree marked by U.S. Deputy Surveyor Hancock, in 1855. See C.S. 1159-43. F.B. 545-176
Found double 24" sycamore tree, blazed on north face. A bearing tree marked by U.S. Deputy Surveyor Hancock, in 1855. See C.S. 1159-43. F.B. 545-176
PEAR BLOSSOM HIGHWAY 138
PALMDALE - VALYERMO
SEC. 7 - T.4N.-R.9W.
SEC. 8 - T.4N.-R.9W.
U.S.A.
U.S. RANGER STATION
Section Line
(1644.01)
N. 0°01'30" E.
1644.01
D-4078-113, O.R. 198-2
Valyermo Ranch Co.
D-91-34, O.R. 12250-231
D-91-35, O.R. 13044-198
1-Story Frame Store
1-Story Frame & Gas Stns. Parking Area
1-Story Frame Store
1-Story Frame House
1-Story Brick & Frame Store
Orchard
D-O.R. 146-90
Valyermo Ranch Co.
D-91-34, O.R. 12250-231
D-91-35, O.R. 13044-198
SECTION CORNER
Found 2" iron pipe with brass cap in concrete with punch mark as set by U.S. Deputy Surveyor Hancock, in 1855. See C.S. 1159-43. F.B. 545-173, 178
CLOSING CORNER
Found 2" iron pipe with brass cap in concrete with punch mark as set by U.S. Deputy Surveyor Friel, in 1900. See C.S. 1159-43. Stamped "T.4N. R.9W. 1900 S.B.M." F.B. 545-173, 178
Maple (18 trees)
Orchard
Note: Bldg. Fence
Section Line
N. 89°31'15" E.
(2648.02)
2645.60
891.41
Orchard
Note: Bldg. Fence
PEAR BLOSSOM HIGHWAY 138
SEC. 8 - T.4N.-R.9W.
SEC. 17 - T.4N.-R.9W.
1/4 SECTION CORNER
Found 2" iron pipe with brass cap in concrete with punch mark as set by U.S. Deputy Surveyor Hancock, in 1855. See C.S. 1159-43. F.B. 545-176
Found nail & tinned, tagged R.C.E. 5351 as set by Hancock by C.S. 1159-43. F.B. 545-180
N. 89°31'15" E. 2648.02
N. 89°58'40" W.
2642.31
Section Line
C.S. 8735
N. 0°02'30" E.
Section Line
SECTION CORNER
Found 2" iron pipe for tie, concrete with brass cap marked, per C.S. 8735. F.B. 545-181
¼ SECTION CORNER
Found 2" iron pipe set in concrete with brass cap marked, per C.S. 8735. F.B. 545-181
PALMDALE - VALYERMO
ROAD
These portions deeded 50' wide by D-34-18. No part of this road has been constructed, nor is any traveled road contained within the deeded portion
R.M.M. 18104-2
ROAD
Section Line
Section Line
Section Line