LANCASTER ROAD
MAP OF
~~FAIRMONT NEENACH ROAD~~
(STATE HIGHWAY VII - L. A. - 59 A & B)
THROUGH
T. 8 N. - R. 16 W. S.B.M.

COUNTY SURVEYORS MAP Nº B-1411.
SHEET Nº 1 OF 2 SHEETS
SCALE - 1 INCH = 100 FT.

JOB NUMBER 8210.

ALFRED JONES - COUNTY SURVEYOR
SURVEYED - APRIL 1938.

SURVEYED UNDER INSTRUCTIONS OF THE BOARD OF SUPERVISORS PER ORDER DATED NOV. 23 1937.
BEARINGS ARE BASED ON THE BEARING OF SECTION LINES AS SHOWN ON C.S.B-975-18.2

F.B. 503-189-220.

FIELD WORK BY... E.A. ROSECRANS.
OFFICE WORK BY..... P.A. WOOD.
K.R.M^c PHERSON.
CHECKED BY.... K.R.M^c PHERSON.

Lancaster Road Alignment, 1958 R. L. Green J.N. 0075.07

INDEX 73

CSB-1411-1
A1 OF A4

SILVEY

MOLLIE

OF

M.R. 72-67,68

R. 16 W.

R. 15 W.

ROAD LANCASTER

Continued on C.S.B-1422-2

COLONY

224TH WEST ST.

E-7

AVE. E-15

Proposed Right of Way Line

Northerly Edge of Pavement

Northerly Edge of Roadbed

Southerly Edge of Pavement

Southerly Edge of Roadbed

Center Line of Dedicated Right of Way per Mariposa Colony - M.R. 72-68 & L.A.-59

Section Line

SECTION CORNER T8N, R16&15W
Set spike, washer & tin tag for mon. F.B. 503-132-134 & 154-142, 145 F.B. 2222-187

¼ SECTION CORNER
4" iron pipe set in concrete with brass cap punched. See C.S.B-975-2 Found 18" below surface F.B. 2222-189

Set spike, washer & tin F.B. 503-190, F.B. 154-17

Set ¾" iron pipe, flush with surface. F.B. 503-190

Found 18" mortar mound. Replaced same with ¾" iron pipe, 6" below surface. F.B. 154-144

Found 18" mortar mound under 6"x8"x18" granite stone, per L.S. F-58. Replaced same with ¾" iron pipe, 18" below surface. See Marginal Map. F.B. 154-142, 145

Found 18" mortar mound. Replaced same with ¾" iron pipe, 4" below surface. See Marginal Map. F.B. 154-141

Found 4"x6"x18" granite stone, marked "+" on south face. Points with lead plug. Set 3" in top of stone. Also set 2" iron pipe in concrete 18" below stone with brass cap inscribed. See Marginal Map. F.B. 135-137

N 63°55'55" W per C.S.B-1422-2

N 63°55'55" W 2509.56

N 89°48'26" W 2374.67

2374.76

D 15

2509.56

2374.67

2374.76

N 89°48'26" W

N 89°48'26" W

N 0°38'45" E 264.87

S 0°38'45" W 264.87

S 0°38'45" E 2640.74

2642.79

2621.31

Section Line

C.S.B-975-2

XII

24

19

25

30

4

3

2

1

R 15 W.

R 16 W.

T 8 N.

T 7 N.

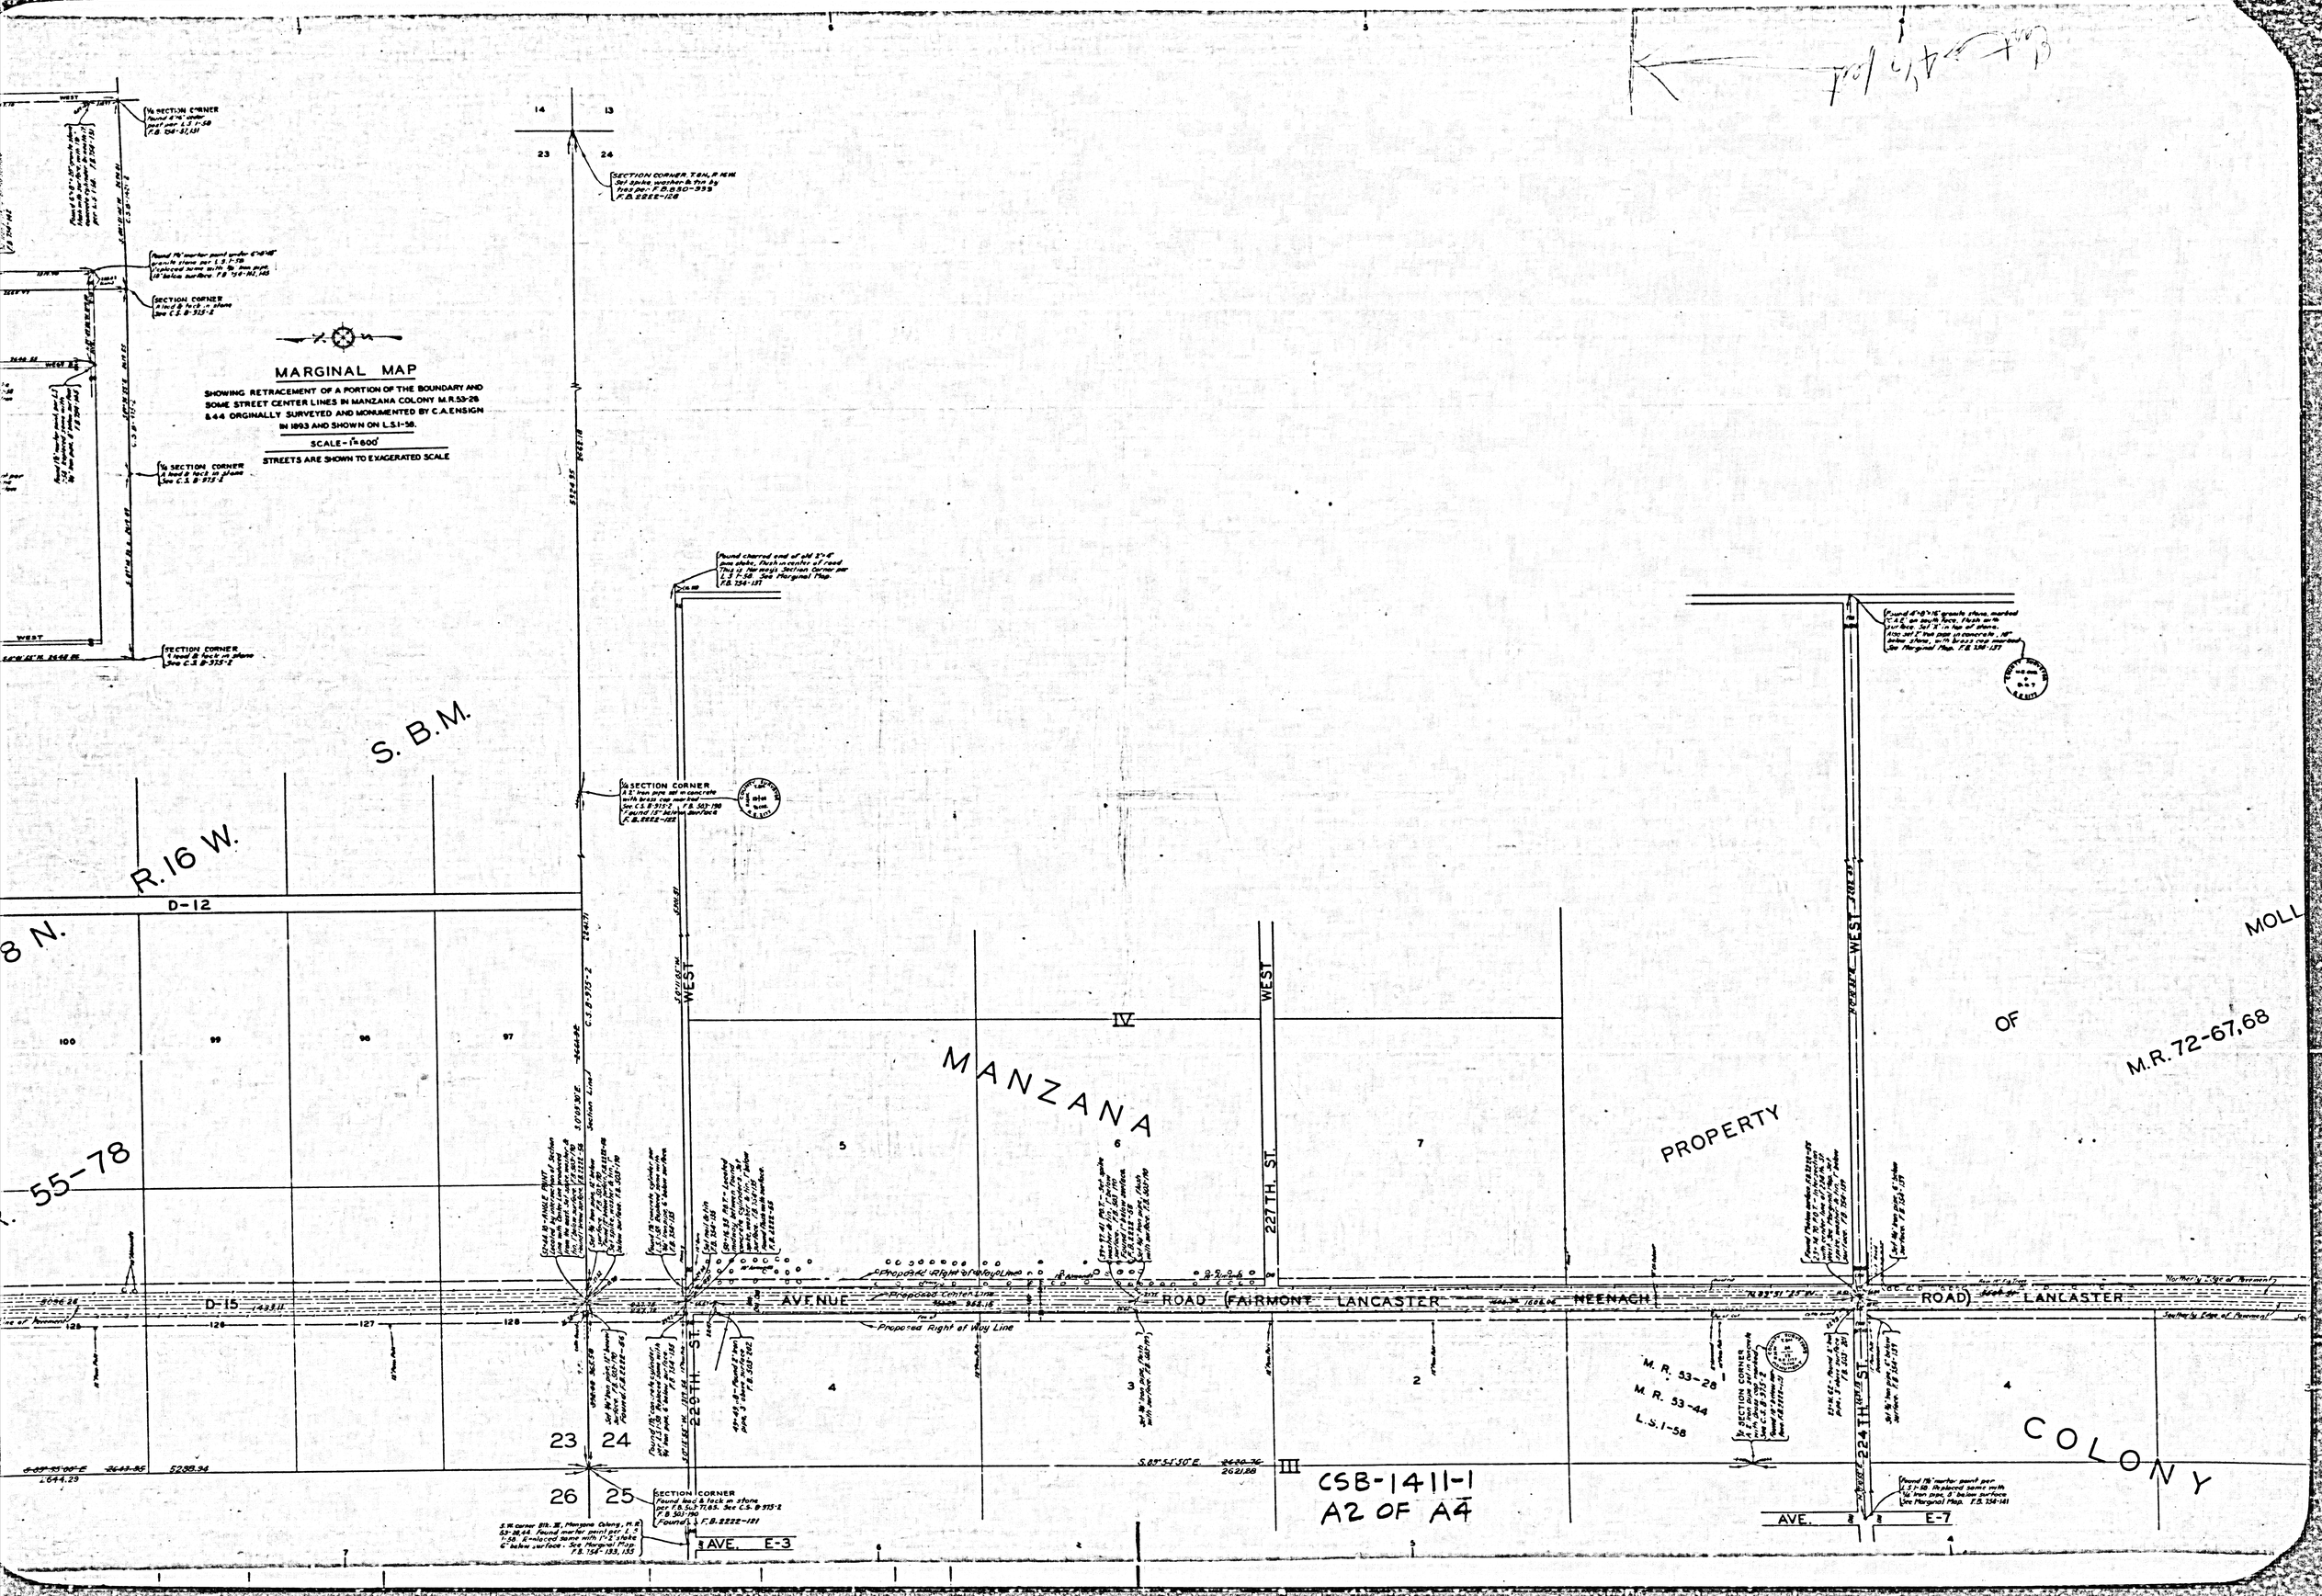
MARGINAL MAP
SHOWING RETRACEMENT OF A PORTION OF THE BOUNDARY AND SOME STREET CENTER LINES IN MANZANA COLONY M.R.53-28 & 44 ORGINALLY SURVEYED AND MONUMENTED BY C.A.ENSIGN IN 1893 AND SHOWN ON L.S.1-58.
SCALE - 1" = 600'
STREETS ARE SHOWN TO EXAGERATED SCALE
S. B.M.
R.16 W.
D-12
8 N.
55-78
D-15
MANZANA
IV
PROPERTY
OF
M.R.72-67,68
MOLL
COLONY
AVENUE
ROAD (FAIRMONT LANCASTER
NEENACH
ROAD) LANCASTER
227 TH. ST.
229 TH. ST.
224 TH. ST.
WEST
M. R. 53-28
M. R. 53-44
L.S.1-58
AVE. E-3
AVE. E-7
CSB-1411-1
A2 OF A4

15 14
22 23

SECTION CORNER
Found 2" iron pipe set in concrete by pol & brass cap marked per F.B. 507-98, Sec. C.S. P.975'-2. F.B. 468-166 60 feet south, westerly & 1'w. Tack with surface as fnd. per F.B. 8788-326 F.B. 2282-130

¼ SECTION CORNER
A 2" iron pipe set in concrete with brass cap marked Sec 17 C.S. P.973'-2 Found 18" below surface F.B. 2282-186

T 8 N. - R 15 W.

T 8 N. - R 16 W.

PROPERTY OF U.S.

MOLLIE

SILVEY

MANZANA

COLONY

TRACT

PARK

MR 53-44

MR 53-28

L.S. 1-58

12-07-58

Found 4"x4" R/S with illegible chiseled marks, set lead & tack in top, 0.4' N. & 0.4' W. of corner. Set 2' iron rod w/ plastic plug stamped "LS 3574" 0.2' below surface. F.B. 1249-187

Found 4" hardwood stake no mark, 0.4' E. set tack in top, 0.4' N. of corner. Probably lost corner of Sec. Cor. per L.S. 1-58. Mark "T.C." F.B. 1249-187

MARGINAL MAP

SHOWING RETRACEMENT OF A PORTION OF THE BO
SOME STREET CENTER LINES IN MANZANA COLON
&44 ORGINALLY SURVEYED AND MONUMENTED B
IN 1893 AND SHOWN ON L.S.1-58.

SCALE - 1"=60'

STREETS ARE SHOWN TO EXAGERATED

SOCIETY'S

S. B.

R.16 W.

D-12

T. 8 N.

MUTUAL

GROWERS

SECTION 23

OF

M. R. 55-78

FRUIT

SUBDIVISION

AVENUE

ROAD

LANCASTER

235TH. ST.

WEST

D-15

112 111 110 109 108 107 106 105 104 103 102 101 100 99 98

113 114 115 116 117 118 119 120 121 122 123 124 125 126 127

Section Line

2644.65

2644.29

5288.94

S 89°55'00" E

N 89°49'39" W

Proposed Right of Way Line

Proposed Center Line

Northerly Edge of Asphalt

Southerly Edge of Roadbed

Northerly Edge of Pavement

Southerly Edge of Pavement

Center Line Approximate Center Line of Pavement

¼ SECTION CORNER
A 2" iron pipe set in concrete with brass cap marked Sec C.S. B-975-2 Found 18" below surface F.B. 2282-183

C.S.B-975-2

SECTION CORNER
Found lead & tack in rock Per F.B. 501-98 Sec C.S. P.975'-1 F.B. 503-191 Found F.B. 2282-183

27 26

CSB-1411-1
A3 OF A4

SECTION 22

T. 8 N. R. 16 W.

FAIRMONT

LANCASTER

LANCASTER

NEENACH

ROAD

AVENUE

CSB-1411-1
A4 OF A4