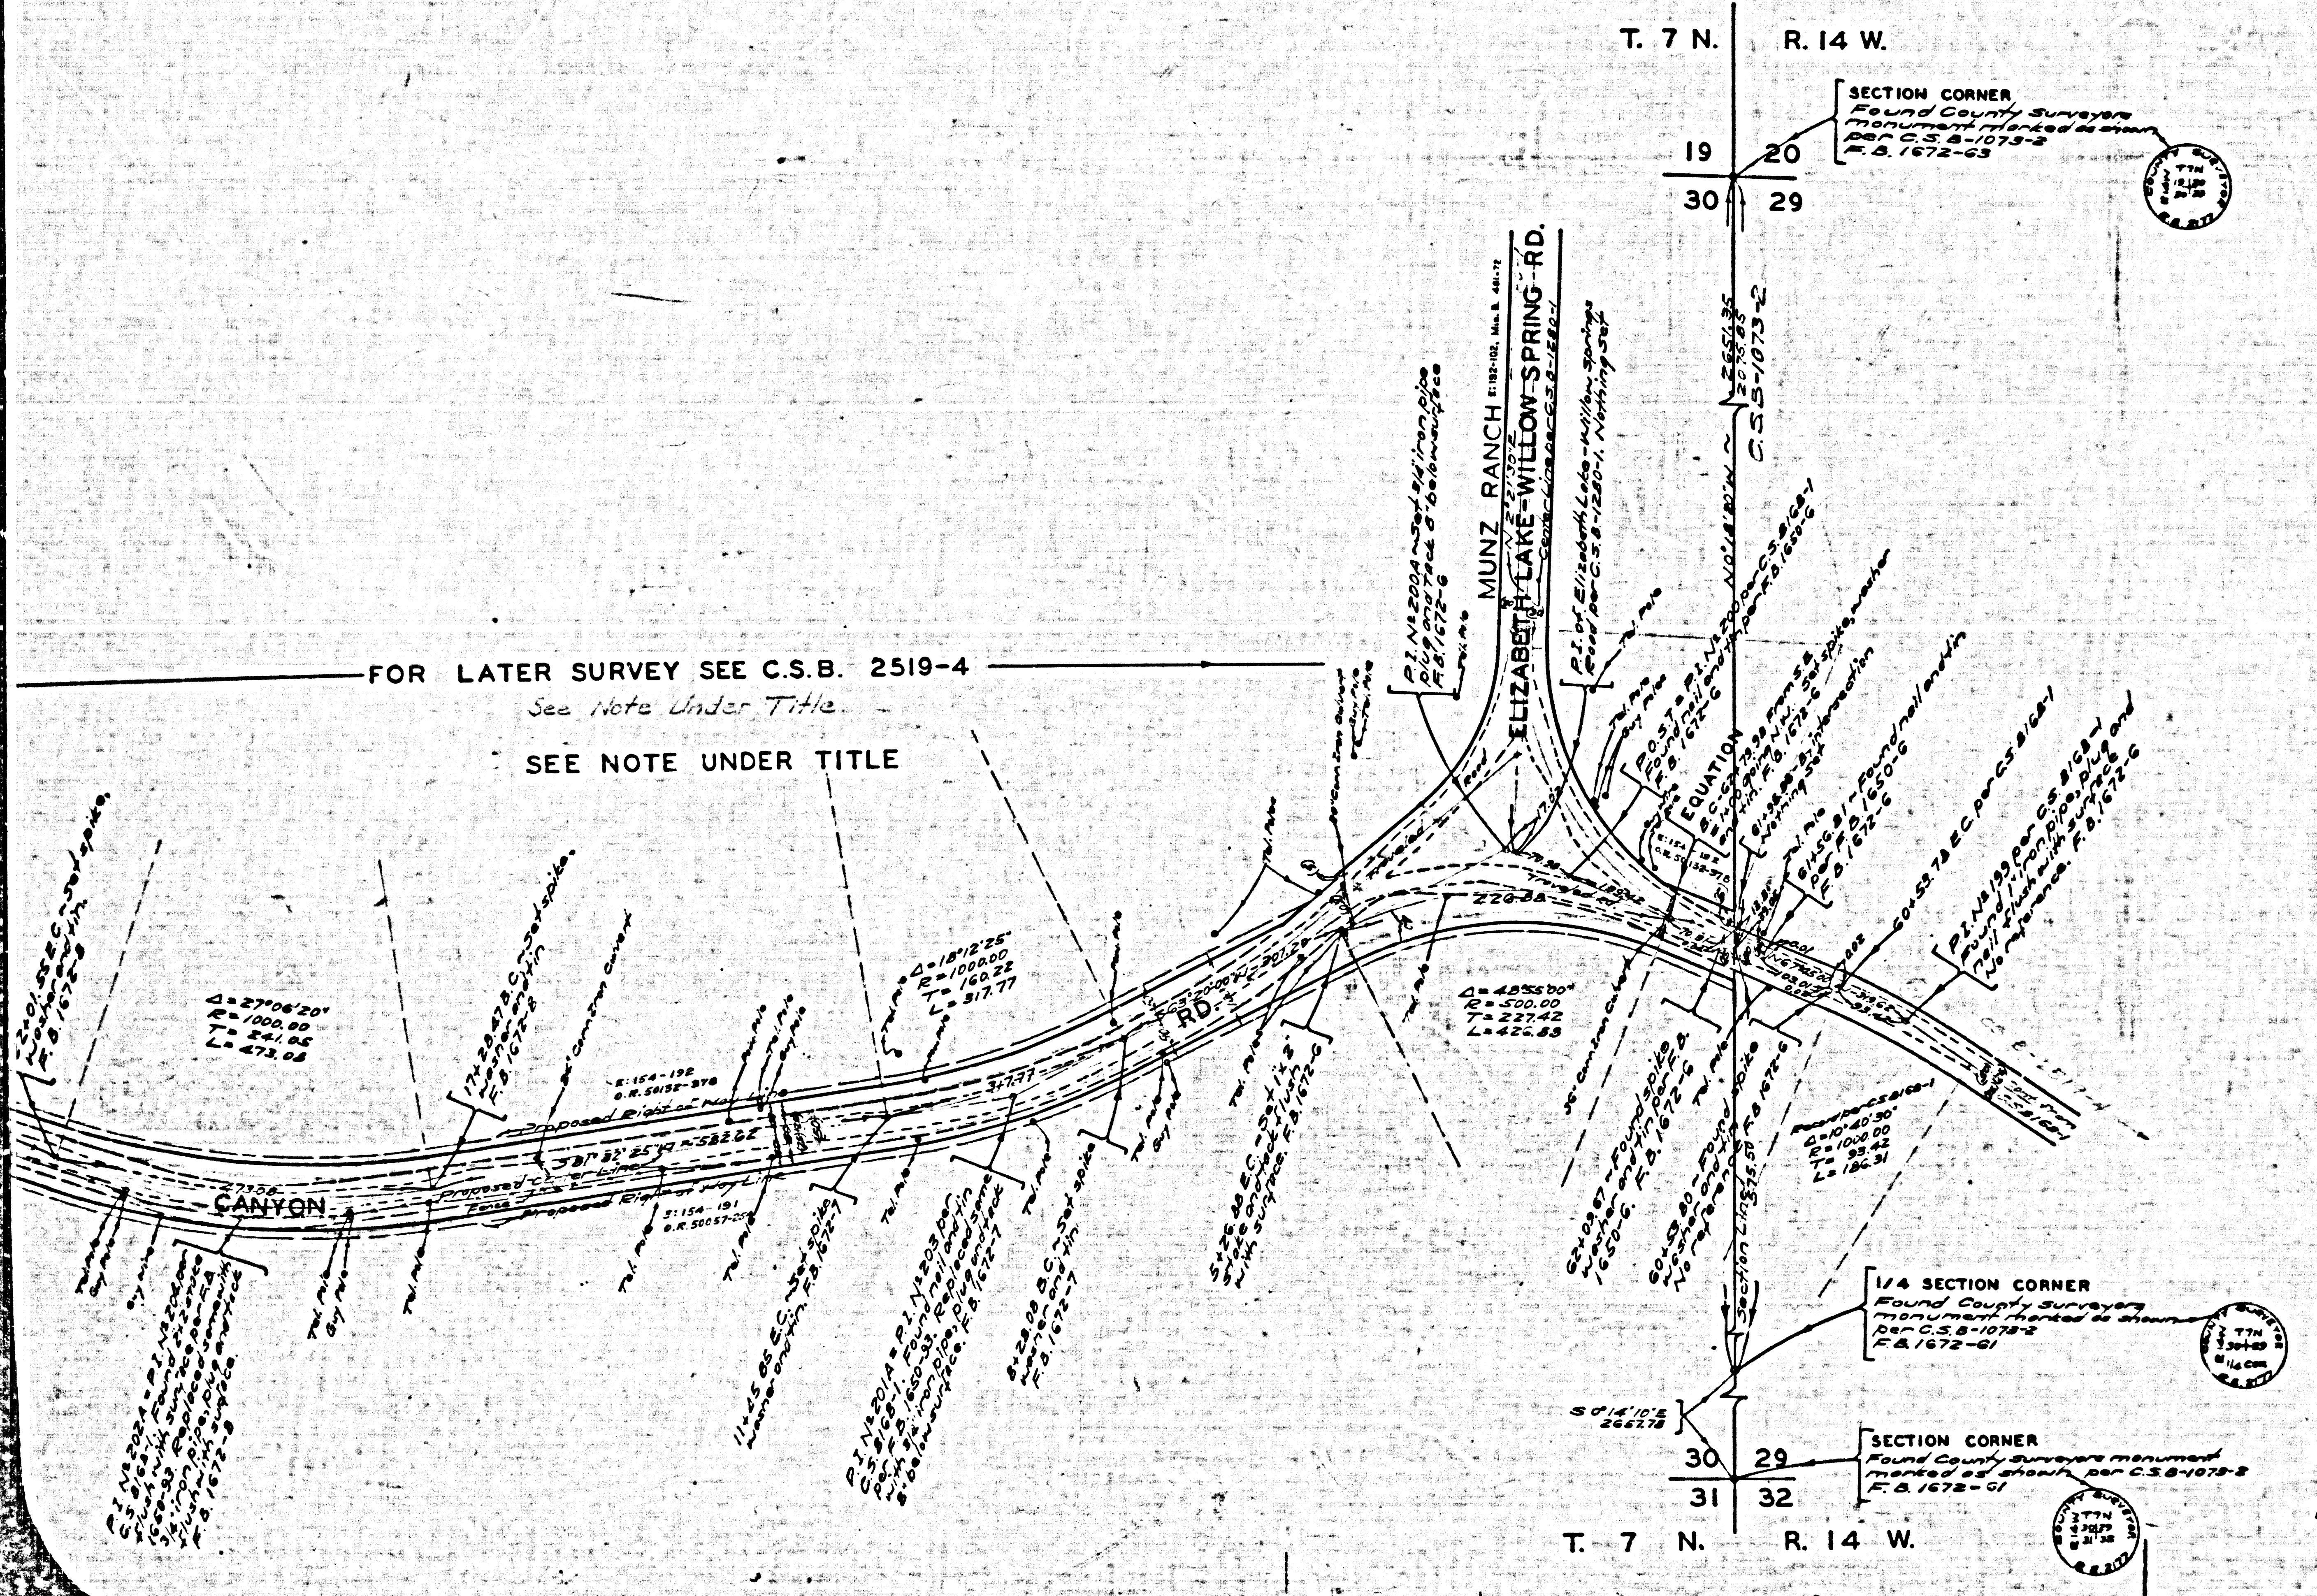

CSB-2313
A1 OF A4

LOS ANGELES COUNTY
MAP OF

REALIGNMENT OF ELIZABETH LAKE-~~PINE CANYON~~ ROAD

FROM MUNZ RANCH
~~ELIZABETH LAKE-WILLOW SPRING~~ ROAD
TO
WEST LINE OF THE S.E. 1/4 OF SEC. 23, T. 7 N. R. 15 W.

COUNTY SURVEYORS MAP № B-2313
SCALE: 1 INCH = 100 FT.

JOB NUMBER 0910

W.J. FOX – COUNTY SURVEYOR
SURVEYED JUNE–OCT. 1951

SURVEYED ON REQUEST OF THE ROAD COMMISSIONER UNDER SEC. 79, ORD. 4099, BY FIELD ORDER № 390 N–31 DATED JUNE 21, 1950

BEARINGS ARE BASED ON THE BEARING OF ELIZABETH LAKE–~~PINE CANYON~~ RD. AS SHOWN ON C.S. 8168-1

F.B. 1672-3-18; 53-56

FIELD WORK BY . . . . E.A. ROSECRANS
D.E. HOLMES
OFFICE WORK BY . . . . . C.W. COX
CHECKED BY . . . . S.H. MILLER

Topography added Nov. 1951 [illegible]
Revised [illegible]
L.M. 72

NOTE:
THIS ALIGNMENT REVISED FROM 80' TO 100' TO CONFORM TO MASTER PLAN OF HIGHWAYS. APRIL 1953

Alignment in [illegible] 1/2 of Sec. 30, T. 7 N., R. 14 W. revised by S.R.B. March 1969 as approved by I.E.C. 1-16-69
Proposed alignment of [illegible] revised per I.E.C. minutes, [illegible] by S.C. [illegible] 1972

CLOSING CORNER TO SECTIONS
24 & 25, T. 7 N., R. 15 W.
Found County Surveyors monument marked as shown per C.S.B-1073-2 F.B. 1372-65,71
CLOSING CORNER TO SEC. 19 & 30
T. 7 N. R. 14 W.
Found County Surveyors monument marked as shown per C.S.B-1073-2
F.B. 1672-65
24
19
25
30
37.71
64.11
N 0°35'55" W
101.82
ANGLE POINT
Found County Surveyors monument marked as shown per C.S.B-1073-2
F.B. 1672-75, 71
R. 15 W.
R. 14 W.
SEE NOTE UNDER TITLE
ELIZABETH
LAKE
PINE
CANYON
Proposed Right of Way Line
Proposed Center Line
VACATED
Tel. Pole
Guy Pole
N 0°23'30" W
1042.18
EAST 1/4 CORNER OF
SECTION 25, T. 7 N., R. 15 W.
Found County Surveyors monument marked as shown per C.S.B-1073-2
F.B. 1672-71
ANGLE POINT
A County Surveyors brass-capped monument as shown on C.S.B-1073-2
1/4 SECTION CORNER TO SEC. 30
T. 7 N. R. 14 W.
Found County Surveyors monument marked as shown per C.S.B-1073-2
F.B. 1672-64
T. 7 N. R. 15 W.
T. 7 N. R. 14 W.
30
25
31
36
S'ELY CORNER OF
SECTION 25, T. 7 N., R. 15 W.
Found County Surveyors monument marked as shown per C.S.B-1073-2. F.B. 1672-72
N 85°24'20" W 2554.49'
295.52'
274.05'
L=542.12'
Proposed Center Line
Proposed P.I. Nothing Set
P.I. No 204A A 3/4" iron pipe, plug & tack flush with surface F.B. 1672-10
P.O.S.T. Established by intersection Nothing set
S 64°31'48" E per C.S.B-2519-41
S 64°41'53" E 723.94'
S 58°20'50" E 638.33' to P.I. No 203A
510.47'
Proposed E.C. - Nothing Set
Proposed B.C. - Nothing Set
Proposed Center Line
Curve Data
Δ=20°42'27"
R=1500.00'
T=274.05'
L=542.12'
IDENTICAL
IDENTICAL
THIS ALIGNMENT ESTABLISHED BY
COUNTY ENGINEER MARCH 1969
THIS ALIGNMENT ABANDONED BY
COUNTY ENGINEER MARCH 1969
T. 7 N.
R. 14 W.
SEC. 30
Proposed E.C. Nothing Set
FOR LATER SURVEY SEE C.S.B.
See Note Under Title
SEE NOTE UNDER TITL

CSB-2313
A2 OF A4

1/4 SECTION CORNER
Found stone, 24"×8"×4", 3" above surface marked 1/4 on north face per C.S. 9199-20. Replaced stone with 2" iron pipe set in concrete, 6" above surface, with brass cap marked ~ F.B. 1672-71
T7N R15W 24 25 1/4 Cor.
Section Line data added April, 1952
CLOSING CORNER TO SECTIONS 24 & 25, T. 7 N., R. 15 W.
Found County Surveyors monument marked as shown per C.S.B-1073-2 F.B. 1672-65,71
T7N 24 25 30 C.C.
24
19
25
30
N 0°35'45"W 101.82
CLOSIN
T. 7 N.
ANGLE
SEE NOTE UNDER TITLE
CANYON
RD
R. 15 W.
T. 7 N.
SEC. 25
R. 15 W.
R. 14 W.
ELIZABETH
Vineyard
EQUATION
EAST 1/4 CORNER OF SECTION 25, T. 7 N., R. 15 W.
Found County Surveyors monument marked as shown per C.S.B-1073-2 F.B. 1672-71
ANGLE POINT
A County Surveyors brass capped monument as shown on C.S.B-1073-2
T7N R15W R14W L.P.
1/4 SE
T. 7 N.
T. 7 N. R. 15 W.
T. 7 N.
30
25
31
36
S'ELY CORNER OF SECTION 25, T. 7 N., R. 15 W.
Found County Surveyors monument marked as shown per C.S.B-1073-2. F.B. 1672-72
Bearing tree per C.S. 9199-18
Found 8" monzonite tree blazed on east side. Could not find scribing as tree has recently been burned. The ax marks are plain and unmistakable. The location is at a place where there would be no other reason for blazing the tree.
F.B. 1672-73
(N15E~11.88)
1/4 SECTION CORNER
Established at record bearing (S 15°W) and record distance (11.88) from bearing tree per C.S. 9199-18.
Set 2" iron pipe in concrete 2" above surface with brass cap marked
F.B. 1672-73
T7N R15W 25 36 1/4 Cor.
Section Line data added April, 1952

CSB-2313
A3 OF A4

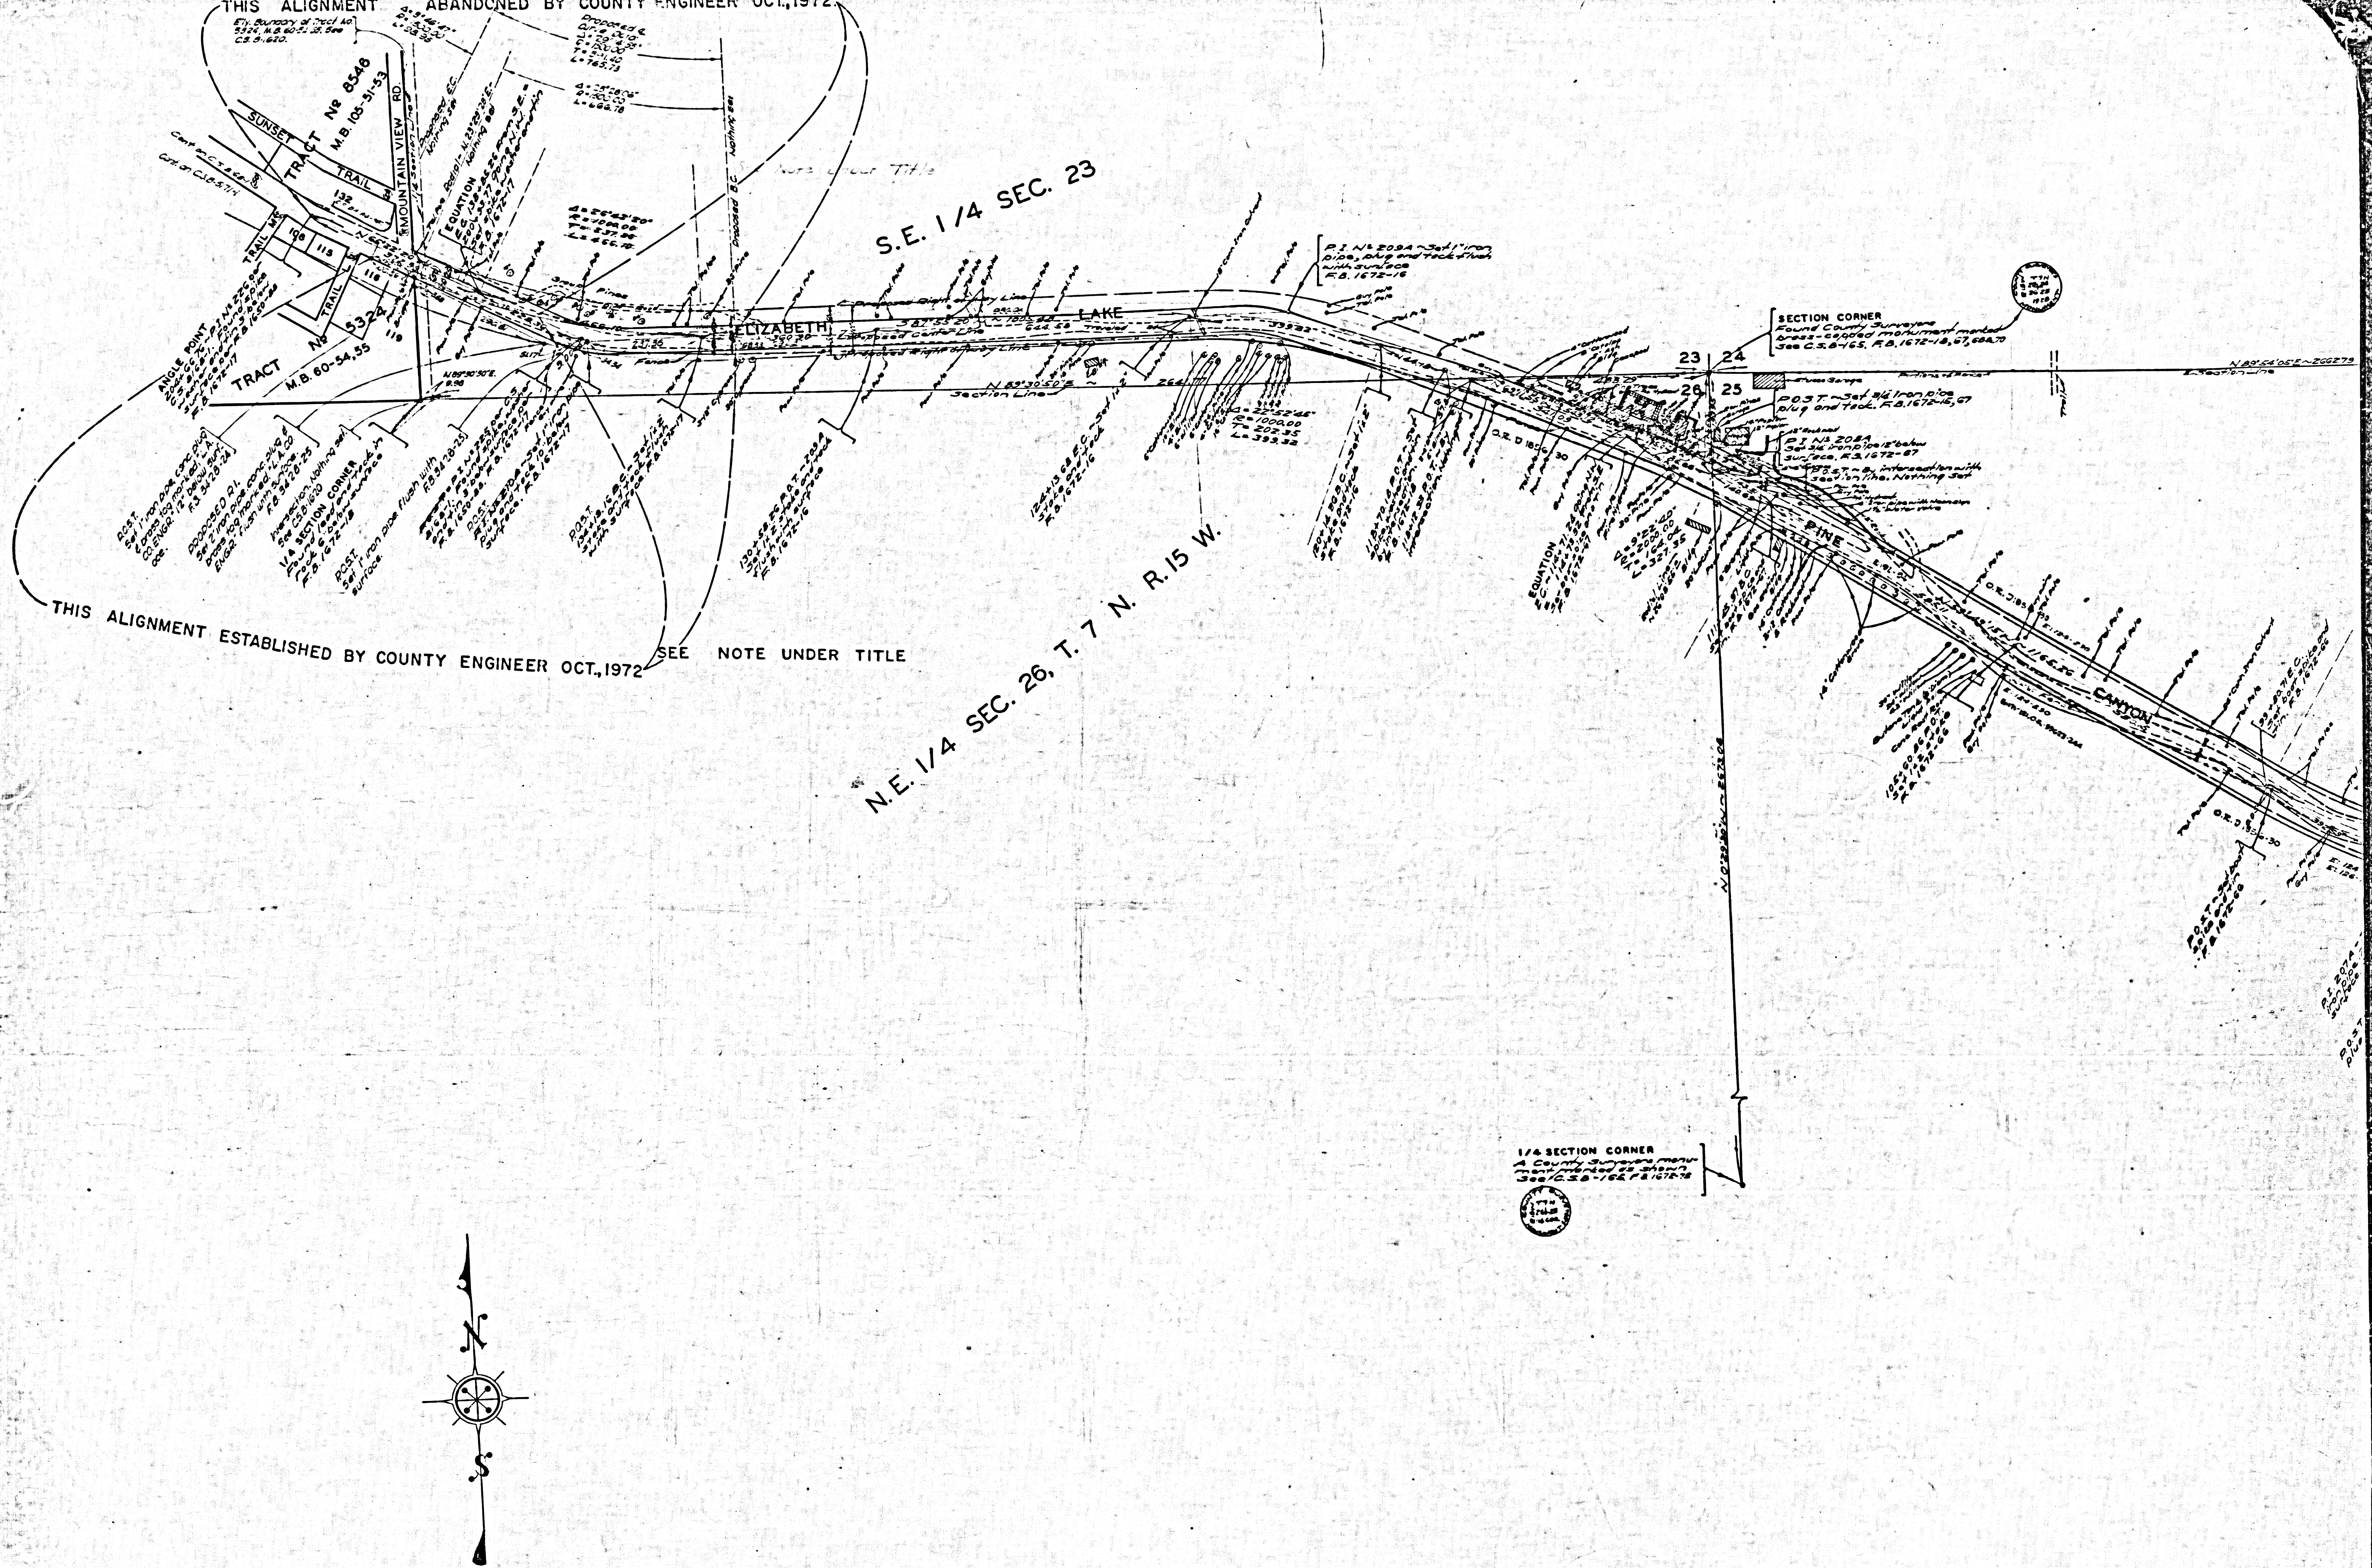
THIS ALIGNMENT ABANDONED BY COUNTY ENGINEER OCT., 1972.
THIS ALIGNMENT ESTABLISHED BY COUNTY ENGINEER OCT., 1972
SEE NOTE UNDER TITLE
See Note Under Title
S.E. 1/4 SEC. 23
N.E. 1/4 SEC. 26, T. 7 N., R. 15 W.
TRACT Nº 8546
M.B. 105-51-53
TRACT Nº 5324
M.B. 60-54,55
SUNSET TRAIL
TRAIL
MOUNTAIN VIEW RD.
ELIZABETH
LAKE
PINE
CANYON
Ely. Boundary of Tract No. 5324, M.B. 60-54,55. See C.S. 9-1620.
ANGLE POINT 204+66.76~P.I. Nº 226 od C.S. 8165-1. Found spike and tin 3" below surface per F.B. 1650-88 F.B. 1672-17
EQUATION
Proposed Right of Way Line
Proposed Center Line
Section Line
N 89°30'50" E.
1/4 SECTION CORNER
Proposed E.C. Nothing Set
Proposed B.C.
Nothing Set
1/4 Section Line
P.O.S.T. Set 1" iron pipe, conc. plug & brass tag marked "L.A. CO. ENGR." 12" below surface. F.B. 3428-24
PROPOSED P.I. Set 2" iron pipe, conc. plug & brass tag marked "L.A. CO. ENGR." flush with surface. F.B. 3428-25
P.O.S.T. Set 1" iron pipe flush with surface.
P.I. Nº 209A ~ Set 1" iron pipe, plug and tack flush with surface F.B. 1672-16
SECTION CORNER
Found County Surveyors brass-capped monument marked
See C.S.B-165. F.B. 1672-18, 67, 68 & 70
23
24
26
25
P.O.S.T. ~ Set 3/4 iron pipe plug and tack. F.B. 1672-16, 67
P.I. Nº 208A Set 3/4 iron pipe 12" below surface. F.B. 1672-67
P.O.S.T. ~ By intersection with section line. Nothing Set
N 89°54'05" E ~ 2662.79
Section Line
1/4 SECTION CORNER
A County Surveyors monument marked as shown
See C.S.B-165 F.B. 1672-78
N
S

CSB-2313
A4 OF A4

COUNTY SURVEYOR'S MAP NO B-2313