C.2.B-2208

WITNESS CORNER
A 4"X4" HOLLOW IRON POST FILLED WITH CONC. 24" ABOVE SURFACE. THE POST SCRIBED IN RAISED LETTERS R15W S24,S13,T4N S18 R14W S19,SGFR 37, PER F.B.245-137 AND C.S.B-351. SEE F.B.4143-56 AND C.S.B-5355-2. 1986-MONUMENT NOT FOUND.

TRAVERSE CONTROL STATION
" HUM J-8 "
FOUND L.A.CO.TRAVERSE CONTROL SYSTEM MONUMENT. SEE F.B.2457-33. P.W.F.B.2617-40
N-4,273,148.22
E-4,160,150.78

FOUND 1"IRON PIPE,CONC. PLUG AND BRASS TAG MARKED "L.A.CO. ENGR."TOP OF SPUR. SEE F.B.4143-56 AND C.S.B-5355-2. P.W.F.B.2616-233

1/4 SECTION CORNER
FOUND MONUMENT MARKED: SEE NOTE TO RIGHT. P.W.F.B.2617-38

FOUND 1"IRON PIPE,CONC.PLUG AND BRASS TAG MARKED"L.A.CO. ENGR."TOP OF RIDGE PER C.S. B-5355. P.W.F.B.2617-38

FOUND 1"IRON PIPE,CONC.PLUG AND BRASS TAG MARKED "L.A.CO. ENGR."TOP OF SPUR. SEE F.B. 4143-58,59 AND C.S.B-5355-2. P.W.F.B.2617-37,38

SECTION CORNER
ACCEPTED AS SECTION CORNER. IN 1928,THE COUNTY SURVEYOR FOUND GRANITE BOULDER 4"X 3"X 3" ABOVE THE SURFACE WITH A CROSS CUT ON THE TOP AND 5 NOTCHES CUT ON THE EAST CORNER AND 3 NOTCHES CUT ON THE SOUTH CORNER. ALSO SCRIBED S.G.FR. ON THE SOUTH SIDE PER LEWIS H. CUTTING'S RESURVEY IN 1896 (C.S.9369-21) AS SHOWN ON C.S.B-351 AND C.S.B-145-1.
IN 1935, FOUND SAME MONUMENT BY THE COUNTY SURVEYOR,AND REPLACED SAME WITH MONUMENT MARKED AS SHOWN. SEE F.B.488-220,221 AND C.S.B-745-5.
FROM 1958 TO 1986 FOUND SAME COUNTY SURVEYOR BRASS CAP MONUMENT MARKED: IN BOULDER. SEE F.B.1260-132 AND C.S.B-5355. P.W.F.B.2617-37

SECTION CORNER
FOUND MONUMENT MARKED: FLUSH WITH SURFACE. SEE F.B.1260-123. P.W.F.B.2616-230

FOUND 1"IRON PIPE,CONC.PLUG AND TAG MARKED " L.S.#4574 " FLUSH WITH SURFACE TOP OF SPUR. P.W.F.B.2616-230,232

SET 1" IRON PIPE,CONC.PLUG AND BRASS TAG MARKED" L.A. CO.ENGR." FLUSH WITH SURFACE. P.W.F.B.2616-230

FOUND FOREST RESERVE BOUNDARY POST#132. SEE F.B.1260-123 P.W.F.B.2616-230

FOUND 3/4" IRON PIPE,CONC. PLUG AND BRASS TAG MARKED " L.A.CO. ENGR." FLUSH WITH SURFACE. SEE F.B.1260-123 P.W.F.B.2616-237

FOUND 1"IRON PIPE CONC. PLUG AND TAG MARKED "L.S. #4574"FLUSH WITH SURFACE TOP OF SPUR. P.W.F.B.2616-232

1/4 SECTION CORNER
FOUND MONUMENT MARKED: 6"BELOW SURFACE. SEE F.B. 1260-127. P.W.F.B.2616-232

SECTION LINE RESURVEYED BY LEWIS H. CUTTING IN 1896, ADOPTED BY THE LOS ANGELES COUNTY SURVEYOR AS SHOWN ON MAP C.S.B-351.

FOUND 4"X 6" ROCK 12" ABOVE SURFACE WITH 5 NOTCHES ON S.E. CORNER AND 3 NOTCHES ON S.W. CORNER,IN MOUND OF ROCKS,24"AT BASE AND 12" HIGH. ALSO MOUND OF ROCKS 3'NORTH OF ROCK AS DESCRIBED ON C.S.B-145-1.
NOT ACCEPTED AS THE ORIGINAL CORNER WHICH WAS A 4"SQUARE POST PER C.S.9054-17. SEE F.B.1260-132

SECTION CORNER
ACCEPTED AS SECTION CORNER. IN 1928,THE COUNTY SURVEYOR FOUND 8"X10"X8" WASHED ROCK ABOVE THE SURFACE MARKED S.G.FR ON THE SOUTH AND 1/4 ON THE NORTH FACE. MOUND OF STONES 4' AT ITS BASE BY 2' HIGH COVERED WITH EARTH 4' NORTH OF THE CORNER IN LIEU OF 20"X 12"X10"WASHED BOULDER PER LEWIS H. CUTTING'S RESURVEY IN 1896 (C.S.9369-22) AS SHOWN ON C.S.B-351 AND C.S.B-145-1.
IN 1935,THE COUNTY SURVEYOR FOUND SAME MONUMENT AND REPLACED SAME WITH MONUMENT MARKED: SEE F.B.488-220 AND C.S.B-745-5.
FROM 1958 TO 1986 , FOUND SAME COUNTY SURVEYOR'S MONUMENT FLUSH WITH SURFACE. SEE F.B.1260-132,C.S.B-5355 AND F.B.4143-57. P.W.F.B.2617-38

SECTION CORNER
FOUND SCATTERED STONE MOUND ABOUT 4'IN DIAM.AND 12"HIGH, REMOVED STONES AND DUG TO NATURAL GROUND, FOUND MORE STONES BUT NO EVIDENCE OF 4"SQUARE POST. THIS LOCATION GENERALLY FITS THE ASCENDING CALL FROM THE SOUTH AND THE DESCENDING CALLS TO NORTH,EAST AND WEST.
ACCEPTED AS LOCATION OF THE S.E.COR.SEC.19 PER C.S.9054-16. SET MONUMENT MARKED:FLUSH WITH SURFACE IN THE CENTER OF STONE MOUND. P.W.F.B.2617-31

SET 1"IRON PIPE,CONC. PLUG AND BRASS TAG MARKED "L.A.CO.ENGR." FLUSH WITH SURFACE, TOP OF SPUR. P.W.F.B.2617-32,33,34

WITNESS CORNER
6-1959-FOUND ROCK MOUND ON RIDGE, 3'IN DIAM.12"HIGH. SEE C.S.9054-17. SET MONUMENT MARKED:IN CENTER OF ROCK MOUND. F.B.1260-134,144
9-1985-FOUND SAME MONUMENT MARKED:2"ABOVE SURFACE. P.W.F.B.2617-36

TRAVERSE CONTROL STATION
"LANG C-10"
FOUND L.A.CO.SURVEY CONTROL MONUMENT. SEE F.B.2457-49 P.W.F.B.2617-40
N-4,264,925.44
E-4,173,037.11 } 75 ADJ

SET 2" IRON PIPE,CONC. PLUG AND BRASS TAG MARKED " L.A.CO.ENGR." TOP OF SPUR. P.W.F.B.2616-235

FOUND 2"IRON PIPE,CONC. PLUG AND BRASS TAG MARKED " L.A.CO. ENGR." TOP OF SPUR. SEE F.B.3172-166. P.W.F.B.2616-235

FOUND 2"IRON PIPE,CONC. PLUG AND BRASS TAG MARKED "L.A.CO. ENGR." SIDEHILL. SEE F.B.3172-165. P.W.F.B.2616-235

1/4 SECTION CORNER
FOUND COUNTY SURVEYOR MONUMENT 40" BELOW SURFACE. SEE F.B.1260-123,140,F.B.3172-164 AND C.S.B-745-5.
SET MONUMENT MARKED: FLUSH WITH SURFACE OVER SAME. P.W.F.B.2616-236

FOUND 2"IRON PIPE,CONC. PLUG AND BRASS TAG MARKED "L.A.CO. ENGR." SEE F.B.3172-162. P.W.F.B.2616-237

SET 2"IRON PIPE,CONC.PLUG AND BRASS TAG MARKED"L.A. CO. ENGR."TOP OF SPUR. P.W.F.B.2617-39

SET 1"IRON PIPE,CONC.PLUG AND BRASS TAG MARKED"L.A. CO.ENGR."TOP OF SPUR. P.W.F.B.2617-39

SET 1"IRON PIPE,CONC. PLUG AND BRASS TAG MARKED"L.A.CO.ENGR." TOP OF SPUR. P.W.F.B.2617-35
5548.44 GRID
5548.93 GRID

FOUND 3/4"IRON PIPE CONC.PLUG AND TAG MARKED " L.S.#3130", TOP OF SPUR. P.W.F.B.2617-39

CENTER OF SECTION
SET MONUMENT MARKED: BY INTERSECTION. P.W.F.B.2617-39

1/4 SECTION CORNER
SET MONUMENT MARKED: 3" ABOVE SURFACE BY PROPORTION BETWEEN WITNESS CORNER TO THE NORTH AND S.E. CORNER OF SECTION 19 PER C.S.9054-17. P.W.F.B.2617-35

SET 60D NAIL WITH PUNCH MARK. P.W.F.B.2617-35

IN JUNE 1958,THE 1/4 SECTION CORNER WAS ESTABLISHED INCORRECTLY BY THE COUNTY ENGINEER.
THIS CORNER WAS ESTABLISHED CARDINAL IN DIRECTION AND RECORD DISTANCE (1020.36') S'LY FROM FOUND WITNESS CORNER PER C.S.9054-17. SEE F.B.1260-136,144.
IN DEC.18,1985,SAME MONUMENT WAS DESTROYED BY ROAD CONSTRUCTION. SEE F.B.1260-144

SET 1"IRON PIPE,CONC.PLUG AND BRASS TAG MARKED"L.A. CO.ENGR."TOP ROAD CUT P.W.F.B.2617-35

SET 1"IRON PIPE,CONC. PLUG AND BRASS TAG MARKED "L.A.CO.ENGR." FLUSH WITH SURFACE,TOP OF SPUR. P.W.F.B.2617-32,33,34

SET 2"IRON PIPE,CONC.PLUG AND BRASS TAG MARKED"L.A. CO. ENGR."TOP OF SPUR. P.W.F.B.2617-39

SET 2"IRON PIPE,CONC.PLUG AND BRASS TAG MARKED"L.A. CO. ENGR." TOP OF SPUR. P.W.F.B.2616-232

SET 1"IRON PIPE,CONC. PLUG AND BRASS TAG MARKED "L.A.CO.ENGR." FLUSH WITH SURFACE. P.W.F.B.2617-31

SECTION LINE

1/4 SECTION LINE

TRANSIT LINE

SECTION LINE

TRAVERSE LINE

RANGE & SECTION LINE

NATIONAL FOREST BOUNDARY

T.4 N.,R.15 W.

T.4 N.,R.14 W.

ANGELES

S.89°37'36"E. 1008.41 850.22 3681.33 GRID 3681.65 GRID 1561.71 S.89°27'36"E. 1805.41 2611.63 GRID 2611.86 GRID N.0°02'44"E. 12.62 481.26 126.15 104.24 94.80 115.57 145.74 282.06 1222.20 2648.51 GRID 2648.74 GRID N.0°22'46"E. 328.95 412.45 403.08 958.62 255.54 2649.37 GRID 2649.14 GRID N.0°21'55"E. 1220.42 S.57°27'29"E. 1123.68 15286.32 GRID INVERSE 5398.88 GRID 5398.35 GRID 1323.45 2716.48 GRID 2716.24 GRID N.23°18'08"E. 1822.11 GRID 1822.22 GRID 1016.30 GRID 1016.39 GRID S.3°58'07"E. 972.59 N.89°01'48"W. 2959.86 3256.03 GRID 3255.74 GRID 296.17 269.35 304.94 415.78 2292.90 GRID 2292.70 GRID 1572.18 N.89°40'52"E. 41.32 GRID 91.88 48.82 41.47 417.29 3643.82 GRID 3664.14 GRID N.2°21'14"E. 1519.10 S.9°23'52"W. 2081.03 2682.87 GRID 2682.64 GRID 436.11 165.73 224.55 3.96 832.87 0.05 N.88°56'07"W. 481.62 2834.66 GRID 2834.91 GRID 543.73 752.14 N.89°17'32"W. 1542.98 2621.98 GRID 2622.21 GRID 455.27 623.96 572.99

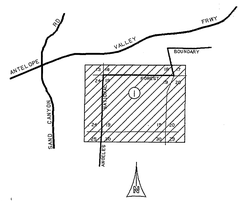

INDEX MAP
NOT TO SCALE

N
AUTOMATED GRAPHICS
METERS 0 20 40 60 120 180
FEET 0 100 200 400 600

NOTE :
THIS MAP SUPERSEDED BY C.S.B.-5517 TO CORRECT THE ERROR OF GRID DISTANCE ALONG THE EAST LINE OF SECTION 19.

NOTE :
THIS MAP WAS FILED FOR THE PURPOSE OF ESTABLISHING SECTION LINES. ALL OTHER CADASTRAL DATA HAS BEEN OMITIED

COUNTY OF LOS ANGELES DEPARTMENT OF PUBLIC WORKS T. A. TIDEMANSON - COUNTY ENGINEER PREPARED BY MAPPING AND PROPERTY MANAGEMENT DIVISION AND SURVEY DIVISION SURVEYED BY D. BURKHOLDER CHECKED BY R. HILABIO DRAWN BY G.D. BAILEY	MAP OF SECTION 19 T.4 N., R.14 W. BASIS OF BEARINGS CALIFORNIA COORDINATE SYSTEM ZONE 7	COUNTY SURVEYOR'S MAP NO B-5508 SHEET 1 OF 1 SHEET FILED: April 18, 1986 ASST. DEPUTY DIRECTOR SURVEYED SEPTEMBER,1985 REFERENCE P.W.F.B.2616 P.W.F.B.2617 JOB NUMBER 0208.11 INDEX MAP NO 264-157 248-157

C.2.B-2208