

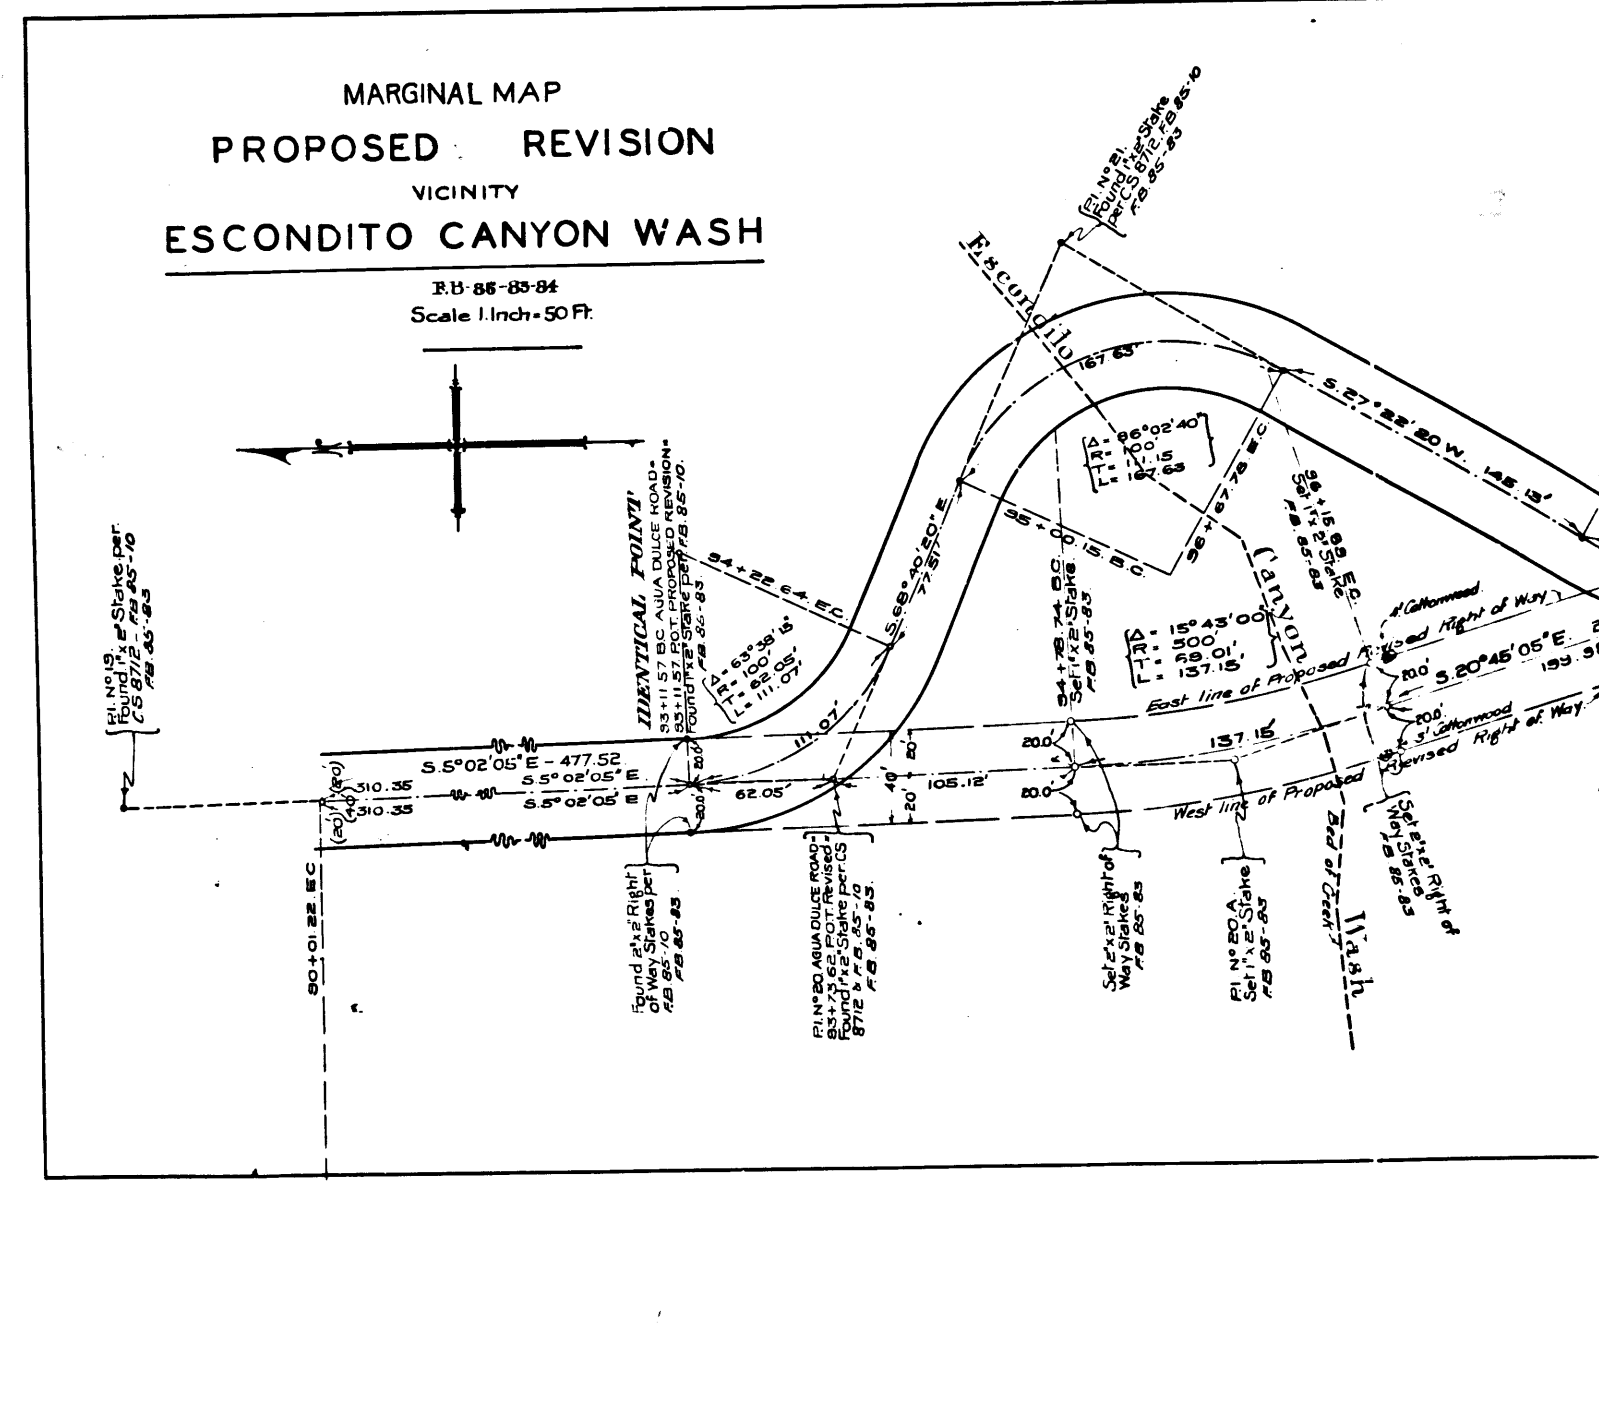
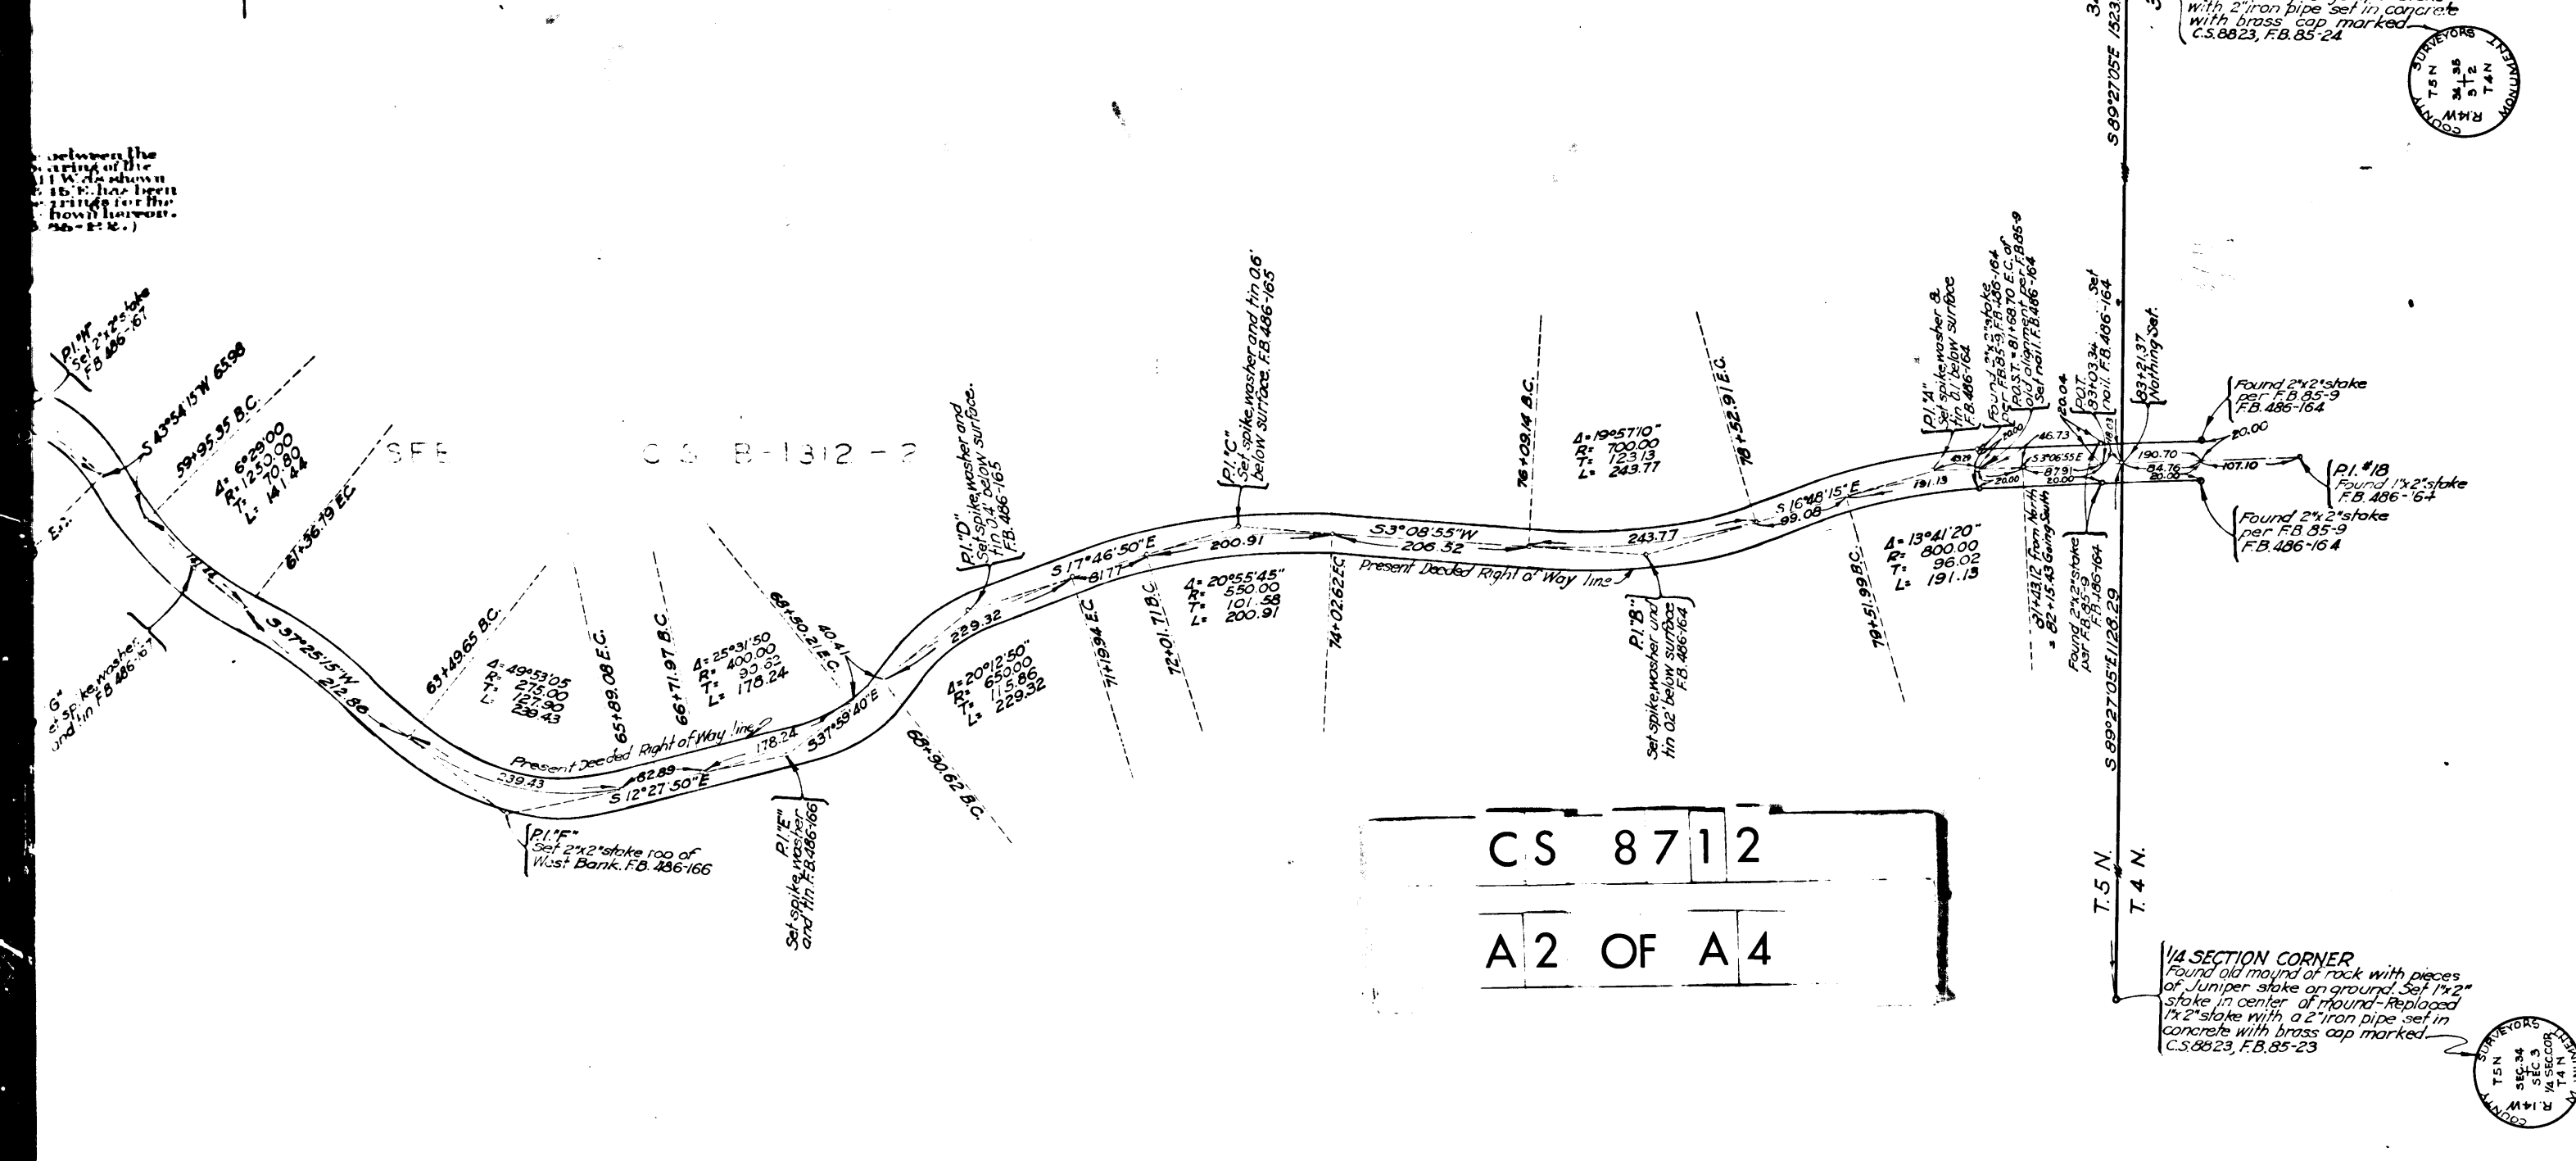


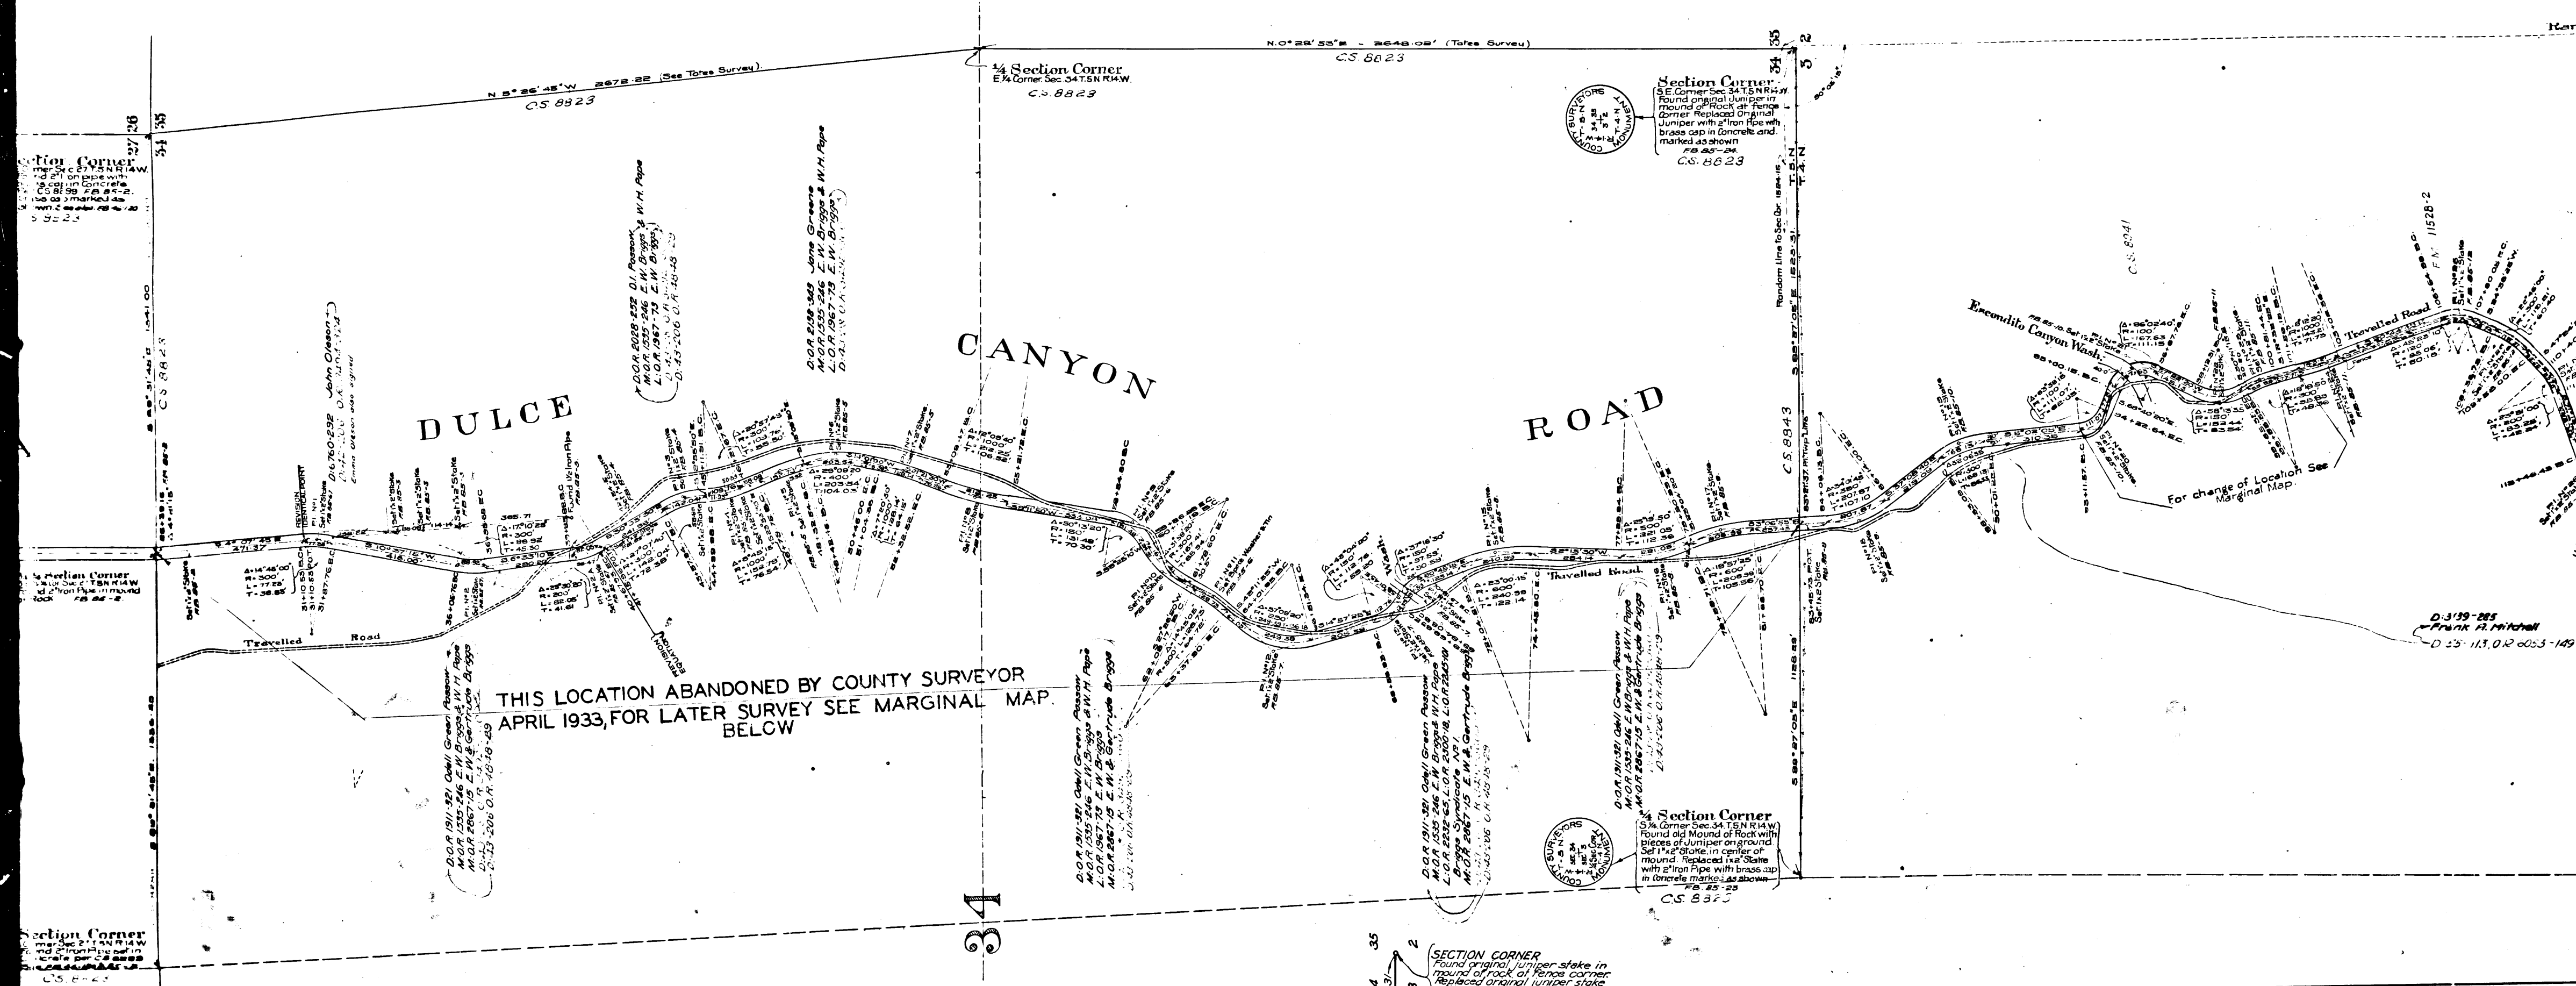

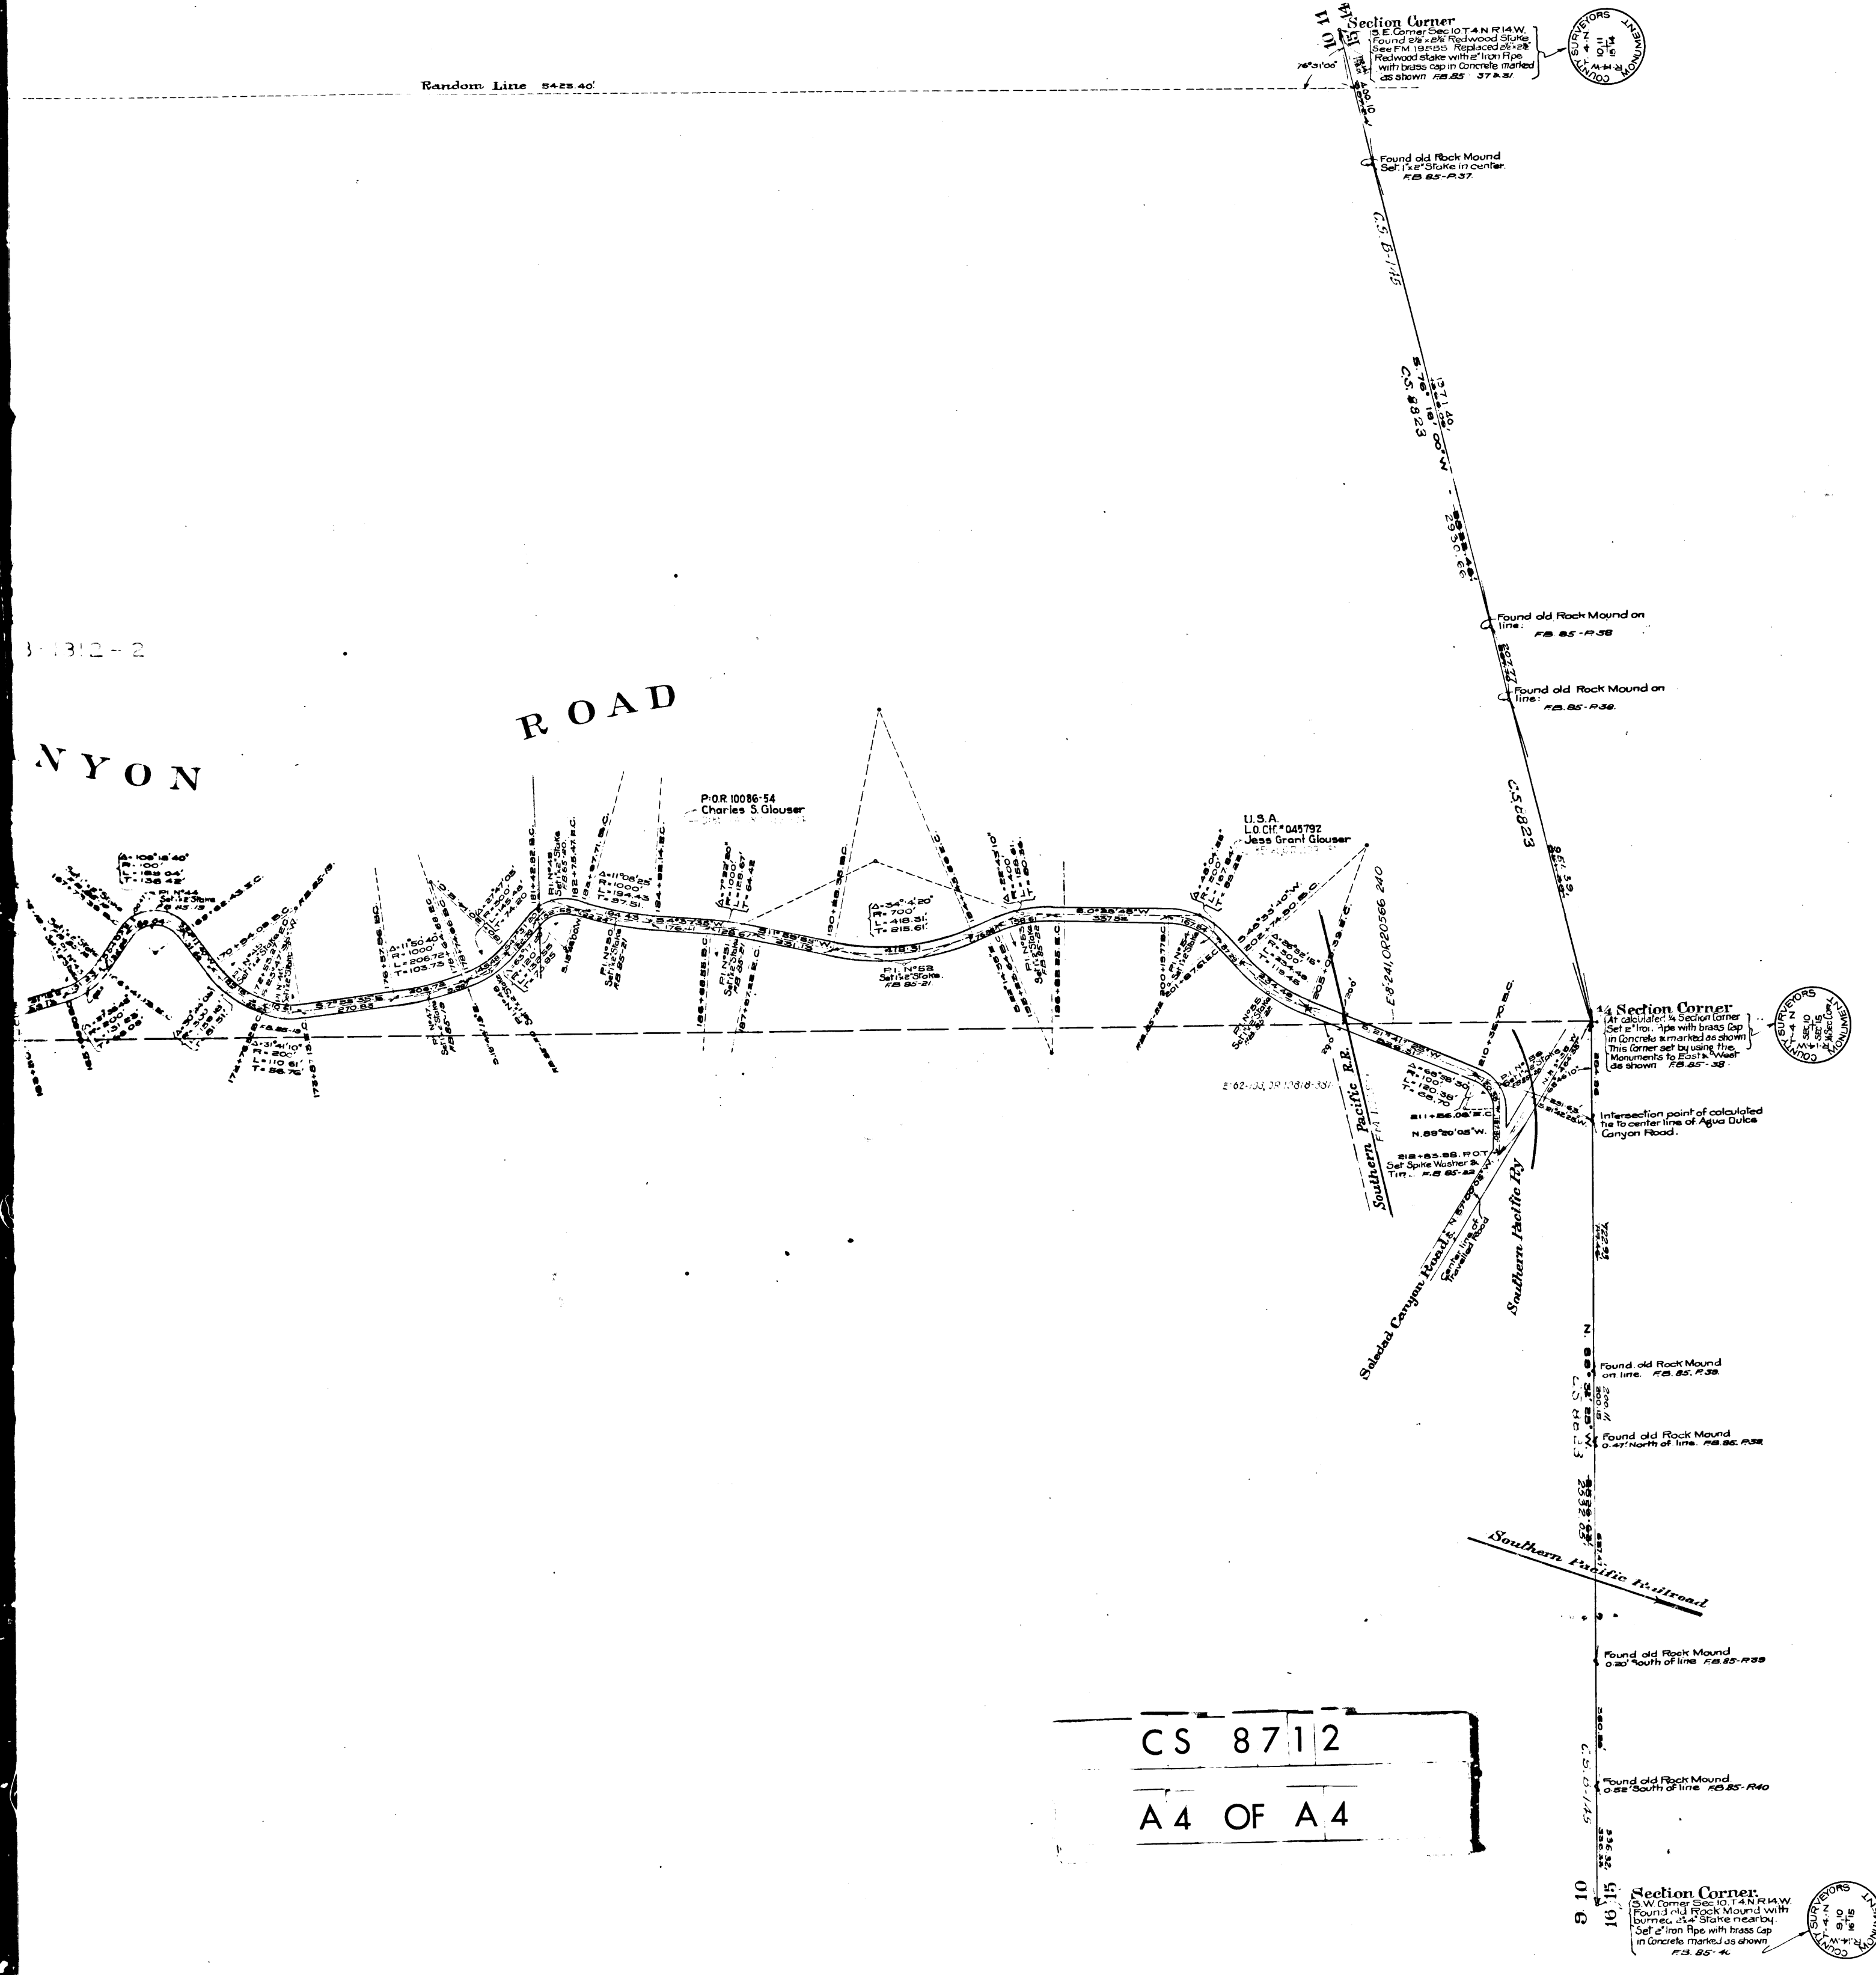

MAP OF AGUA DULCE CANYON ROAD

FROM
MORGAN ROAD
TO
SOLEDAD CANYON ROAD

COUNTY SURVEYORS MAP No 8712
Scale 1 Inch = 200 Ft.
J.E. Rockhold County Surveyor
Surveyed April-June-1924

Surveyed under instructions of the Board of Supervisors
per order dated September 11th-1923. Bearings based on South
line of Section 27 T. 5 N. R. 14 W. as shown on C.S. No 8289.

FIELD WORK BY T. MANKEY
OFFICE WORK BY K. H. HIGGINS
CHECKED BY K. R. McPHERSON.

Sheet 10
Sht. 10

Per Morgan Road changed to Agua Dulce Canyon
D-49-27 R. 14 S. 36-73

CS 8712
A4 OF A4

Random Line 5544.47

Random Line 5425.40

Found very old Rock Mound.
Found no signs of Stake. Set
1/2" stake in center
NOT ACCEPTED AS SECTION
CORNER BY COUNTY SURVEYOR
Feb. 28-28
This point now accepted
as section corner.
See Feb. 28-28
County Surveyor 1-12-28

Land Off. Cert. 037025
Robert A. Tate
D-42-252,0 R 3806-74

Bearings Sly. of Sta 125+33.82 in deed vary
one minute in each case from this map.
Dist. bet. Sta 166+41.13 and Sta 167+73.39
in error in deed.
County Surveyor 1-11-28

C S. B-1312-2

RE-ALIGNMENT (60' WIDE) SEE

AGUA

DULCE

CANYON


ROAD

D. 3159-285
P.R. 10086-54

-D. 55-113,0 R 6055-149

Bearings Sly. of Sta 125+33.82 in deed vary
one minute in each case from this map.
County Surveyor 1-11-28

1/4 Section Corner
S 1/4 Corner Sec 3 T4N R14W
Found original jumper standing
in Rock Mound. Stake sent Feb. 28-28
Replaced Original Jumper with 2" iron
Pipe with brass cap in concrete.
marked as shown. Feb. 28-28
C.S. 8823

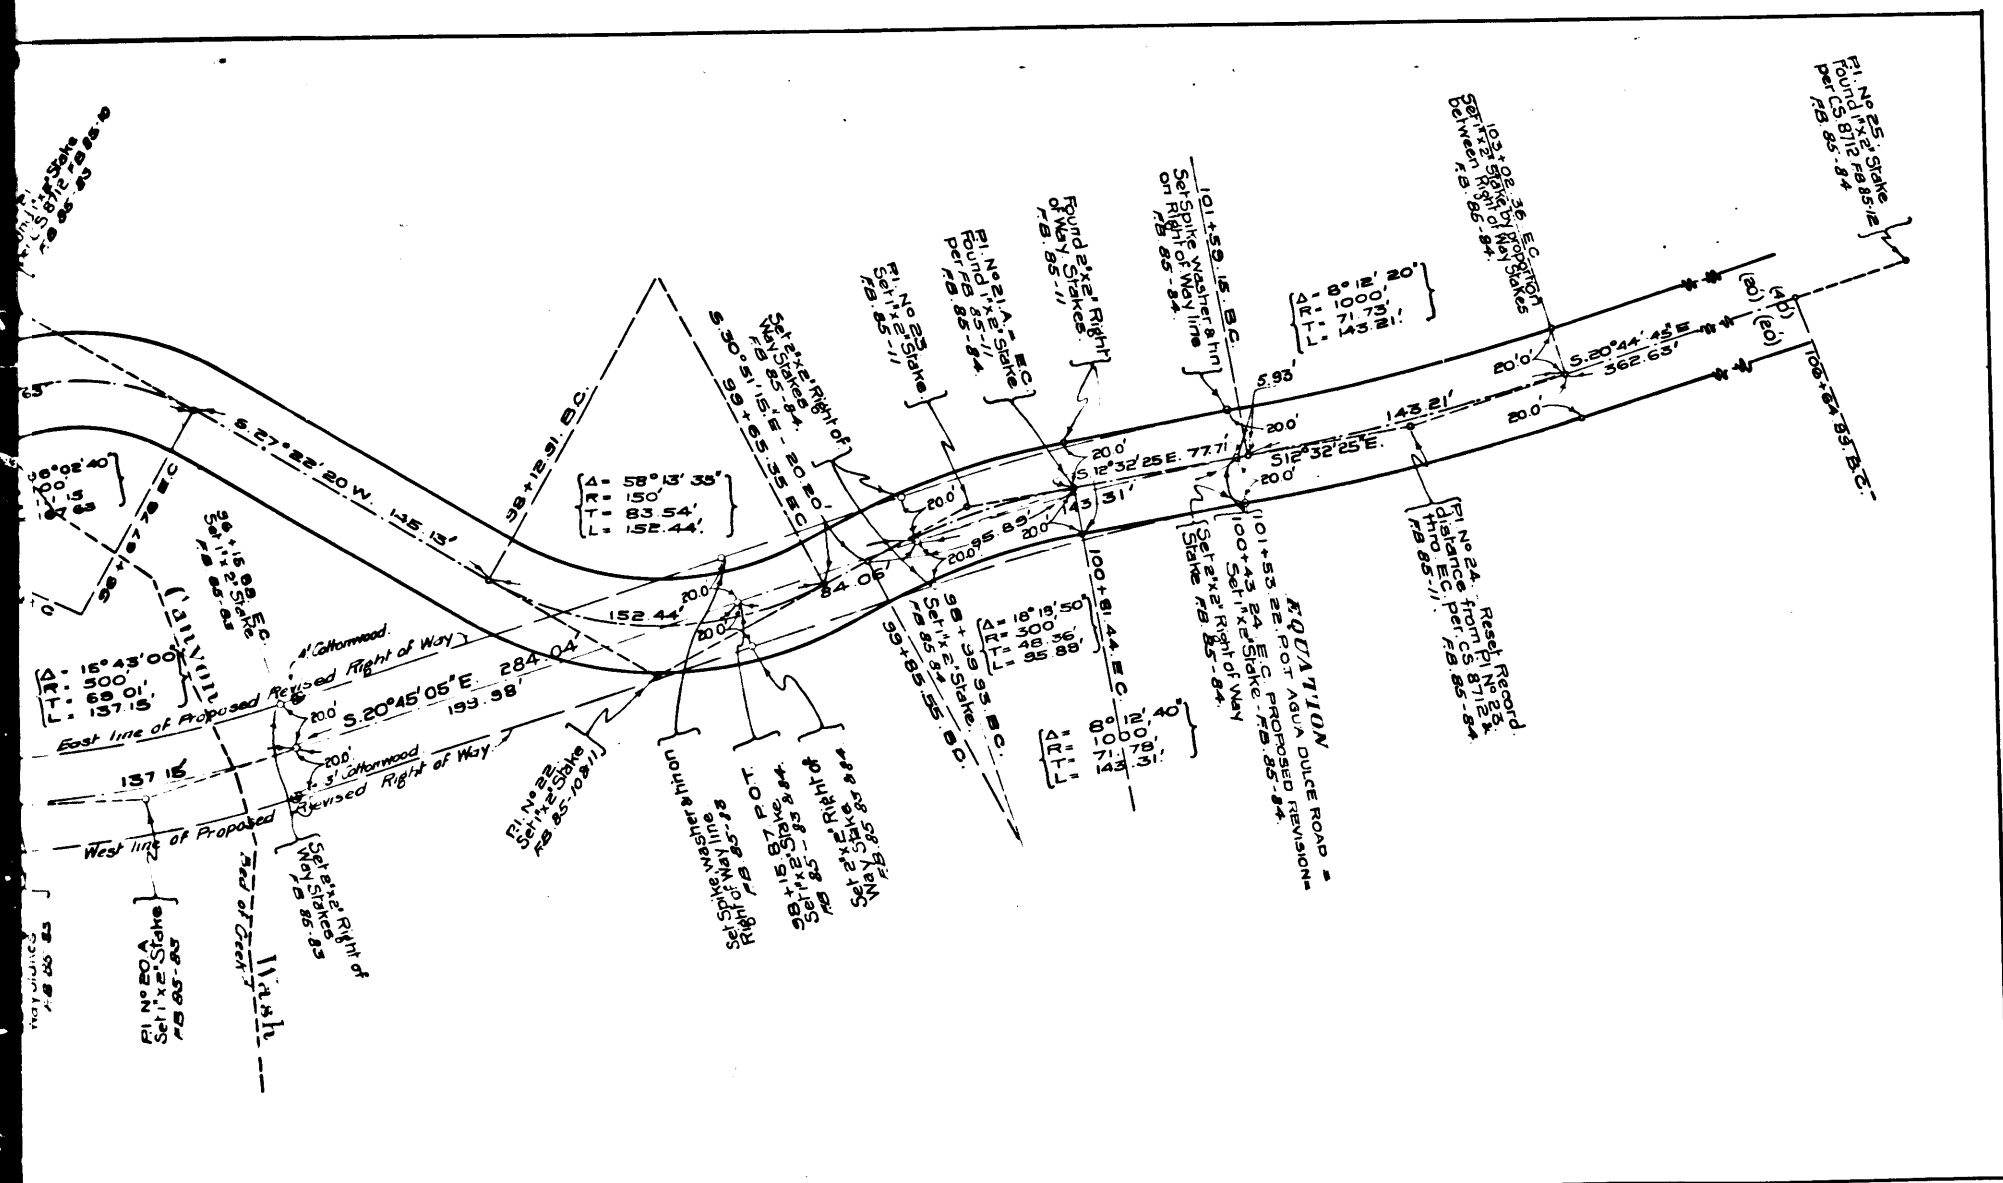

CS 8712

A3 OF A4