


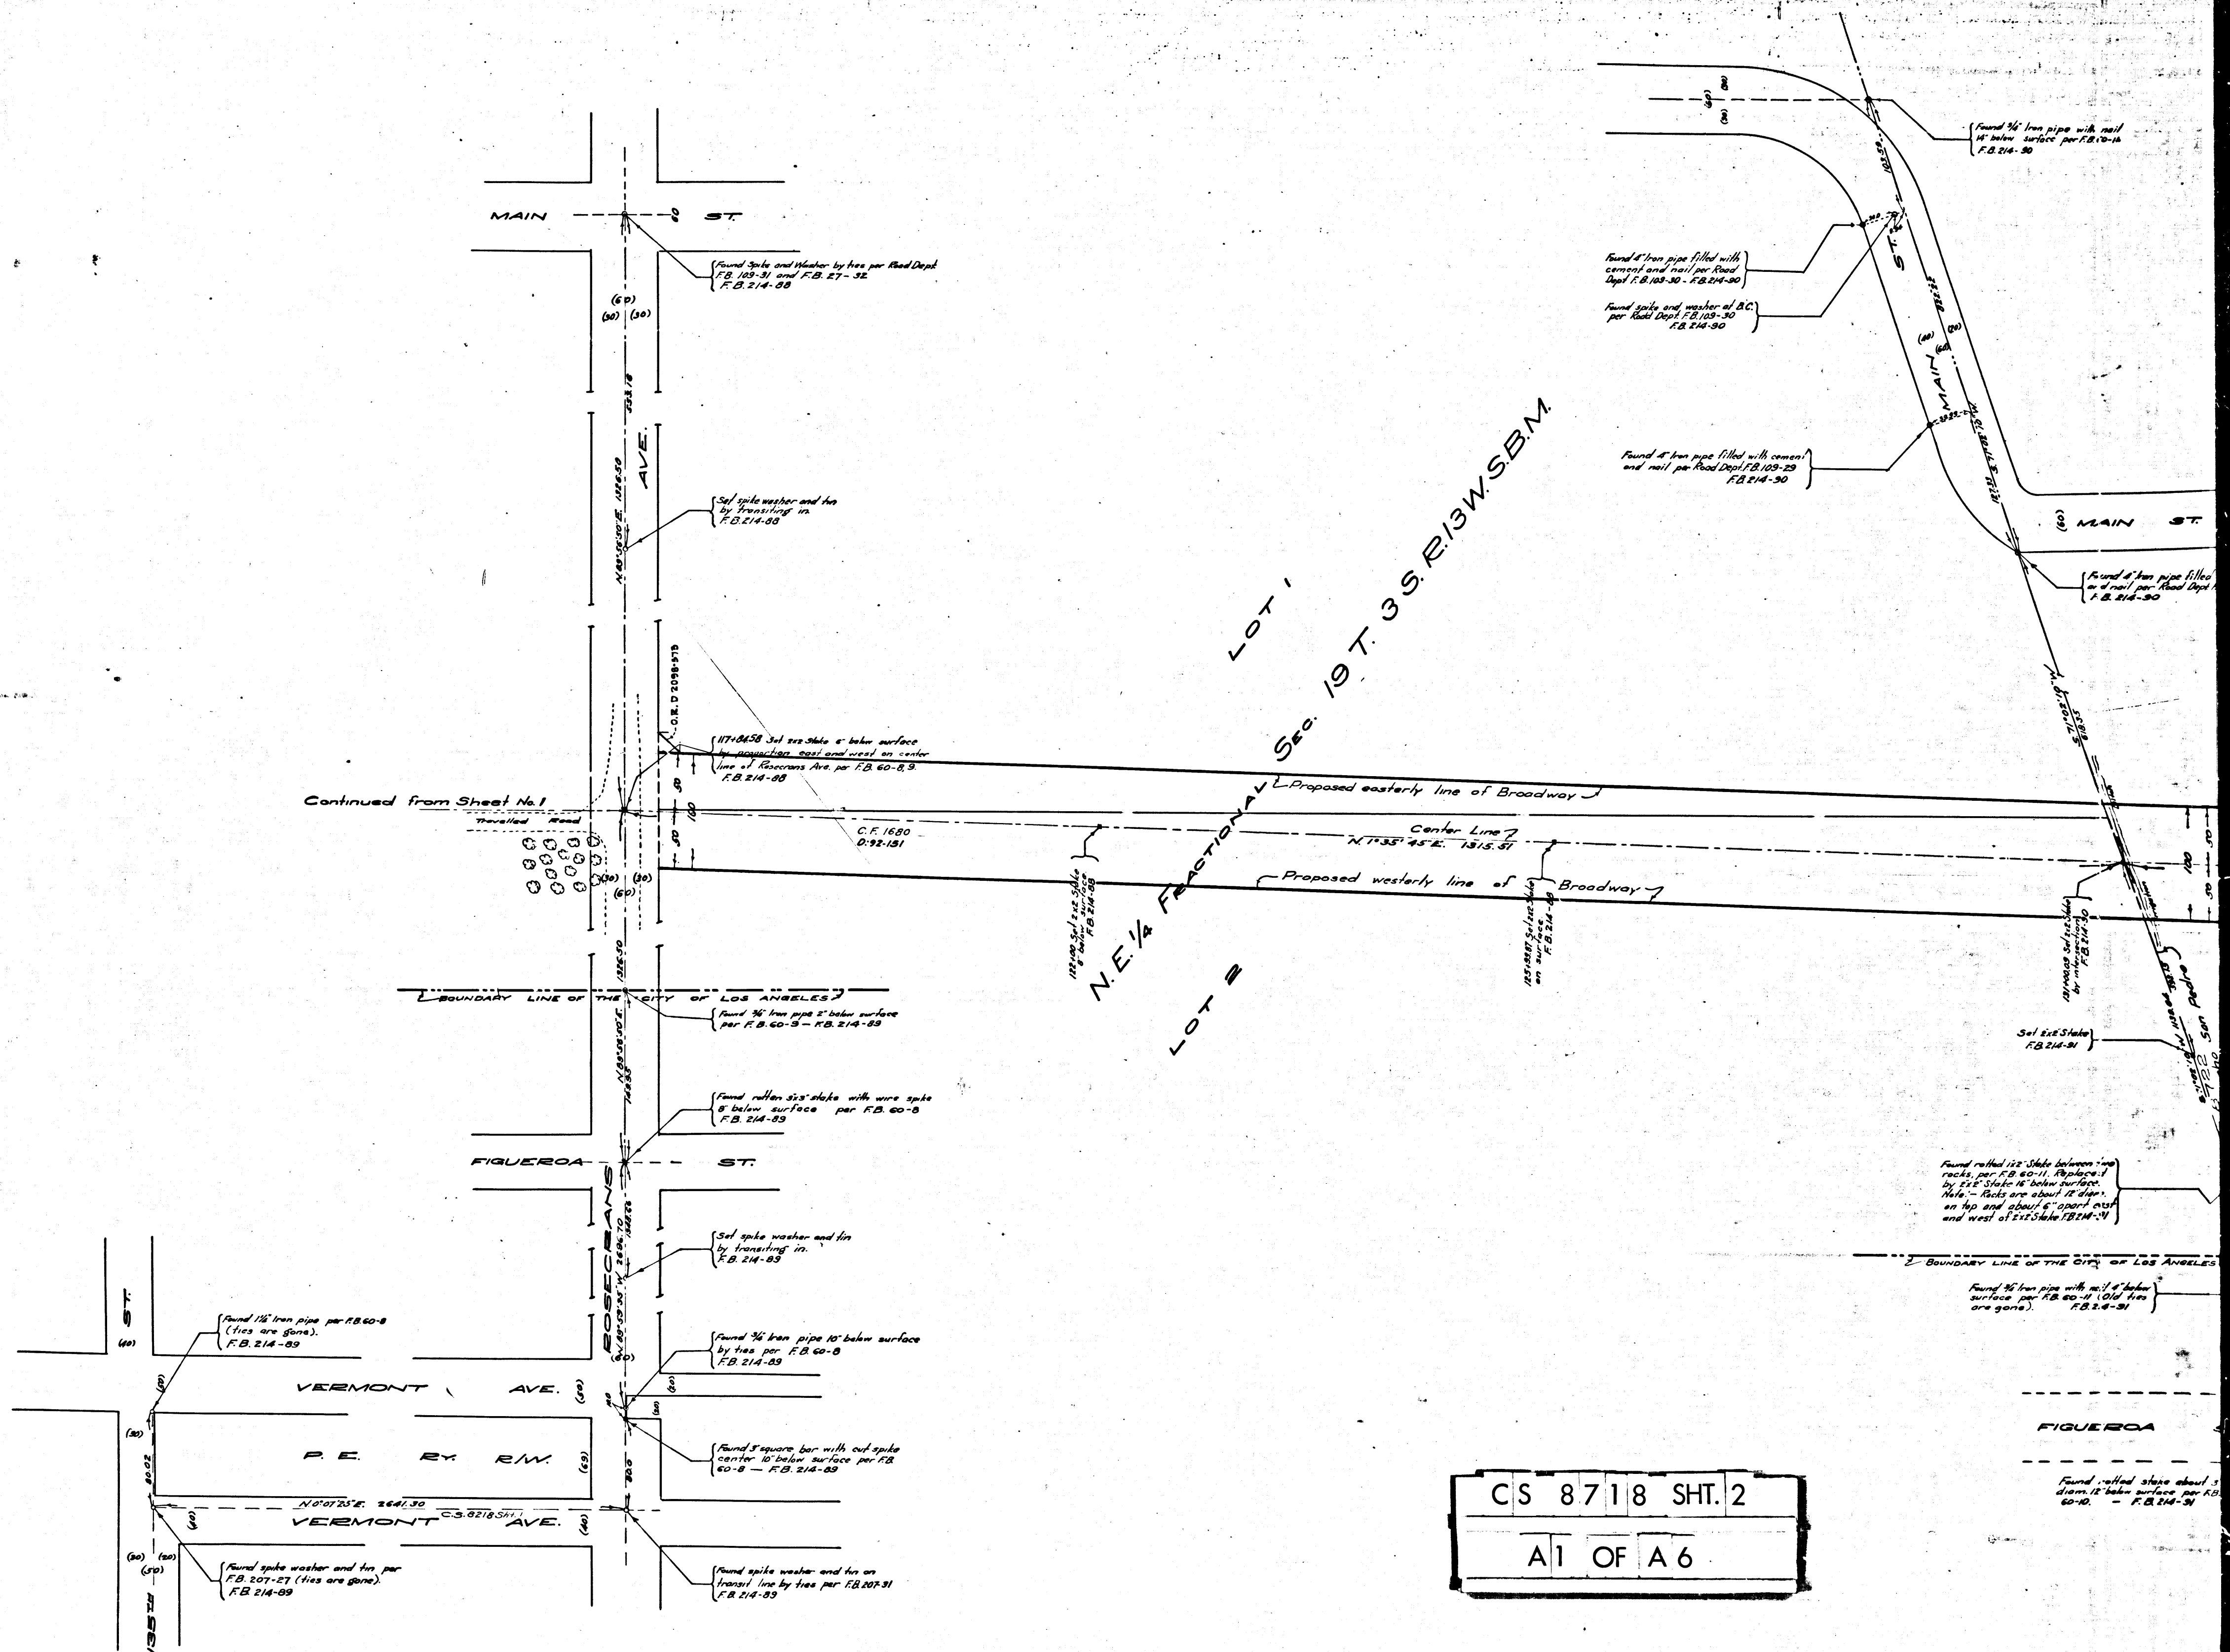

Found 3/4" iron pipe with nail
14" below surface per F.B. 60-11
F.B. 214-30

(80) MAIN ST.

Found 4" iron pipe filled with cement
and nail per Road Dept. F.B. 103-29.
F.B. 214-30

LOT 1

LOT 8

LOT 2

LOT 7

Found rebar 1/2" x 12" between two
1/2" x 12" rebar. Replaced
1/2" x 12" rebar 18" below surface.
Rebar are about 12" diam.
top and about 6" apart east
and west of 21/2" x 12" rebar.

BOUNDARY LINE OF THE CITY OF LOS ANGELES

Found 3/4" iron pipe with nail 4" below
surface per F.B. 60-11 (Old ties
are gone). F.B. 214-31

FIGUEROA ST.

Found rebar 1/2" x 12" about 5'
diam. 18" below surface per F.B.
60-10. F.B. 214-31

Found 1/2" iron pipe with plug and tack
on surface per F.B. 60-10.
F.B. 214-31

BOUNDARY LINE OF THE CITY OF LOS ANGELES

FIGUEROA ST.

100+20.00
Set 21/2" x 12" stake
F.B. 214-92

Earth Irrigation Reservoir
(4' deep)

N. 1° 35' 45" E. 1977.61

Proposed easterly line of Broadway

Center Line 7

Proposed westerly line of Broadway

Set spike, washer and
nut - F.B. 214-35

Found rebar
1/2" x 12"

Found rebar
1/2" x 12"


100+17.70 Found rebar
1/2" x 12" set by
and in by rebar
and rebar. F.B. 214-34


Found 1/2" x 12" rebar
per F.B. 60-10.
F.B. 214-35

BOUNDARY LINE OF THE



(80) FIGUEROA

CS 8718 SHT. 2
A 2 OF A 6

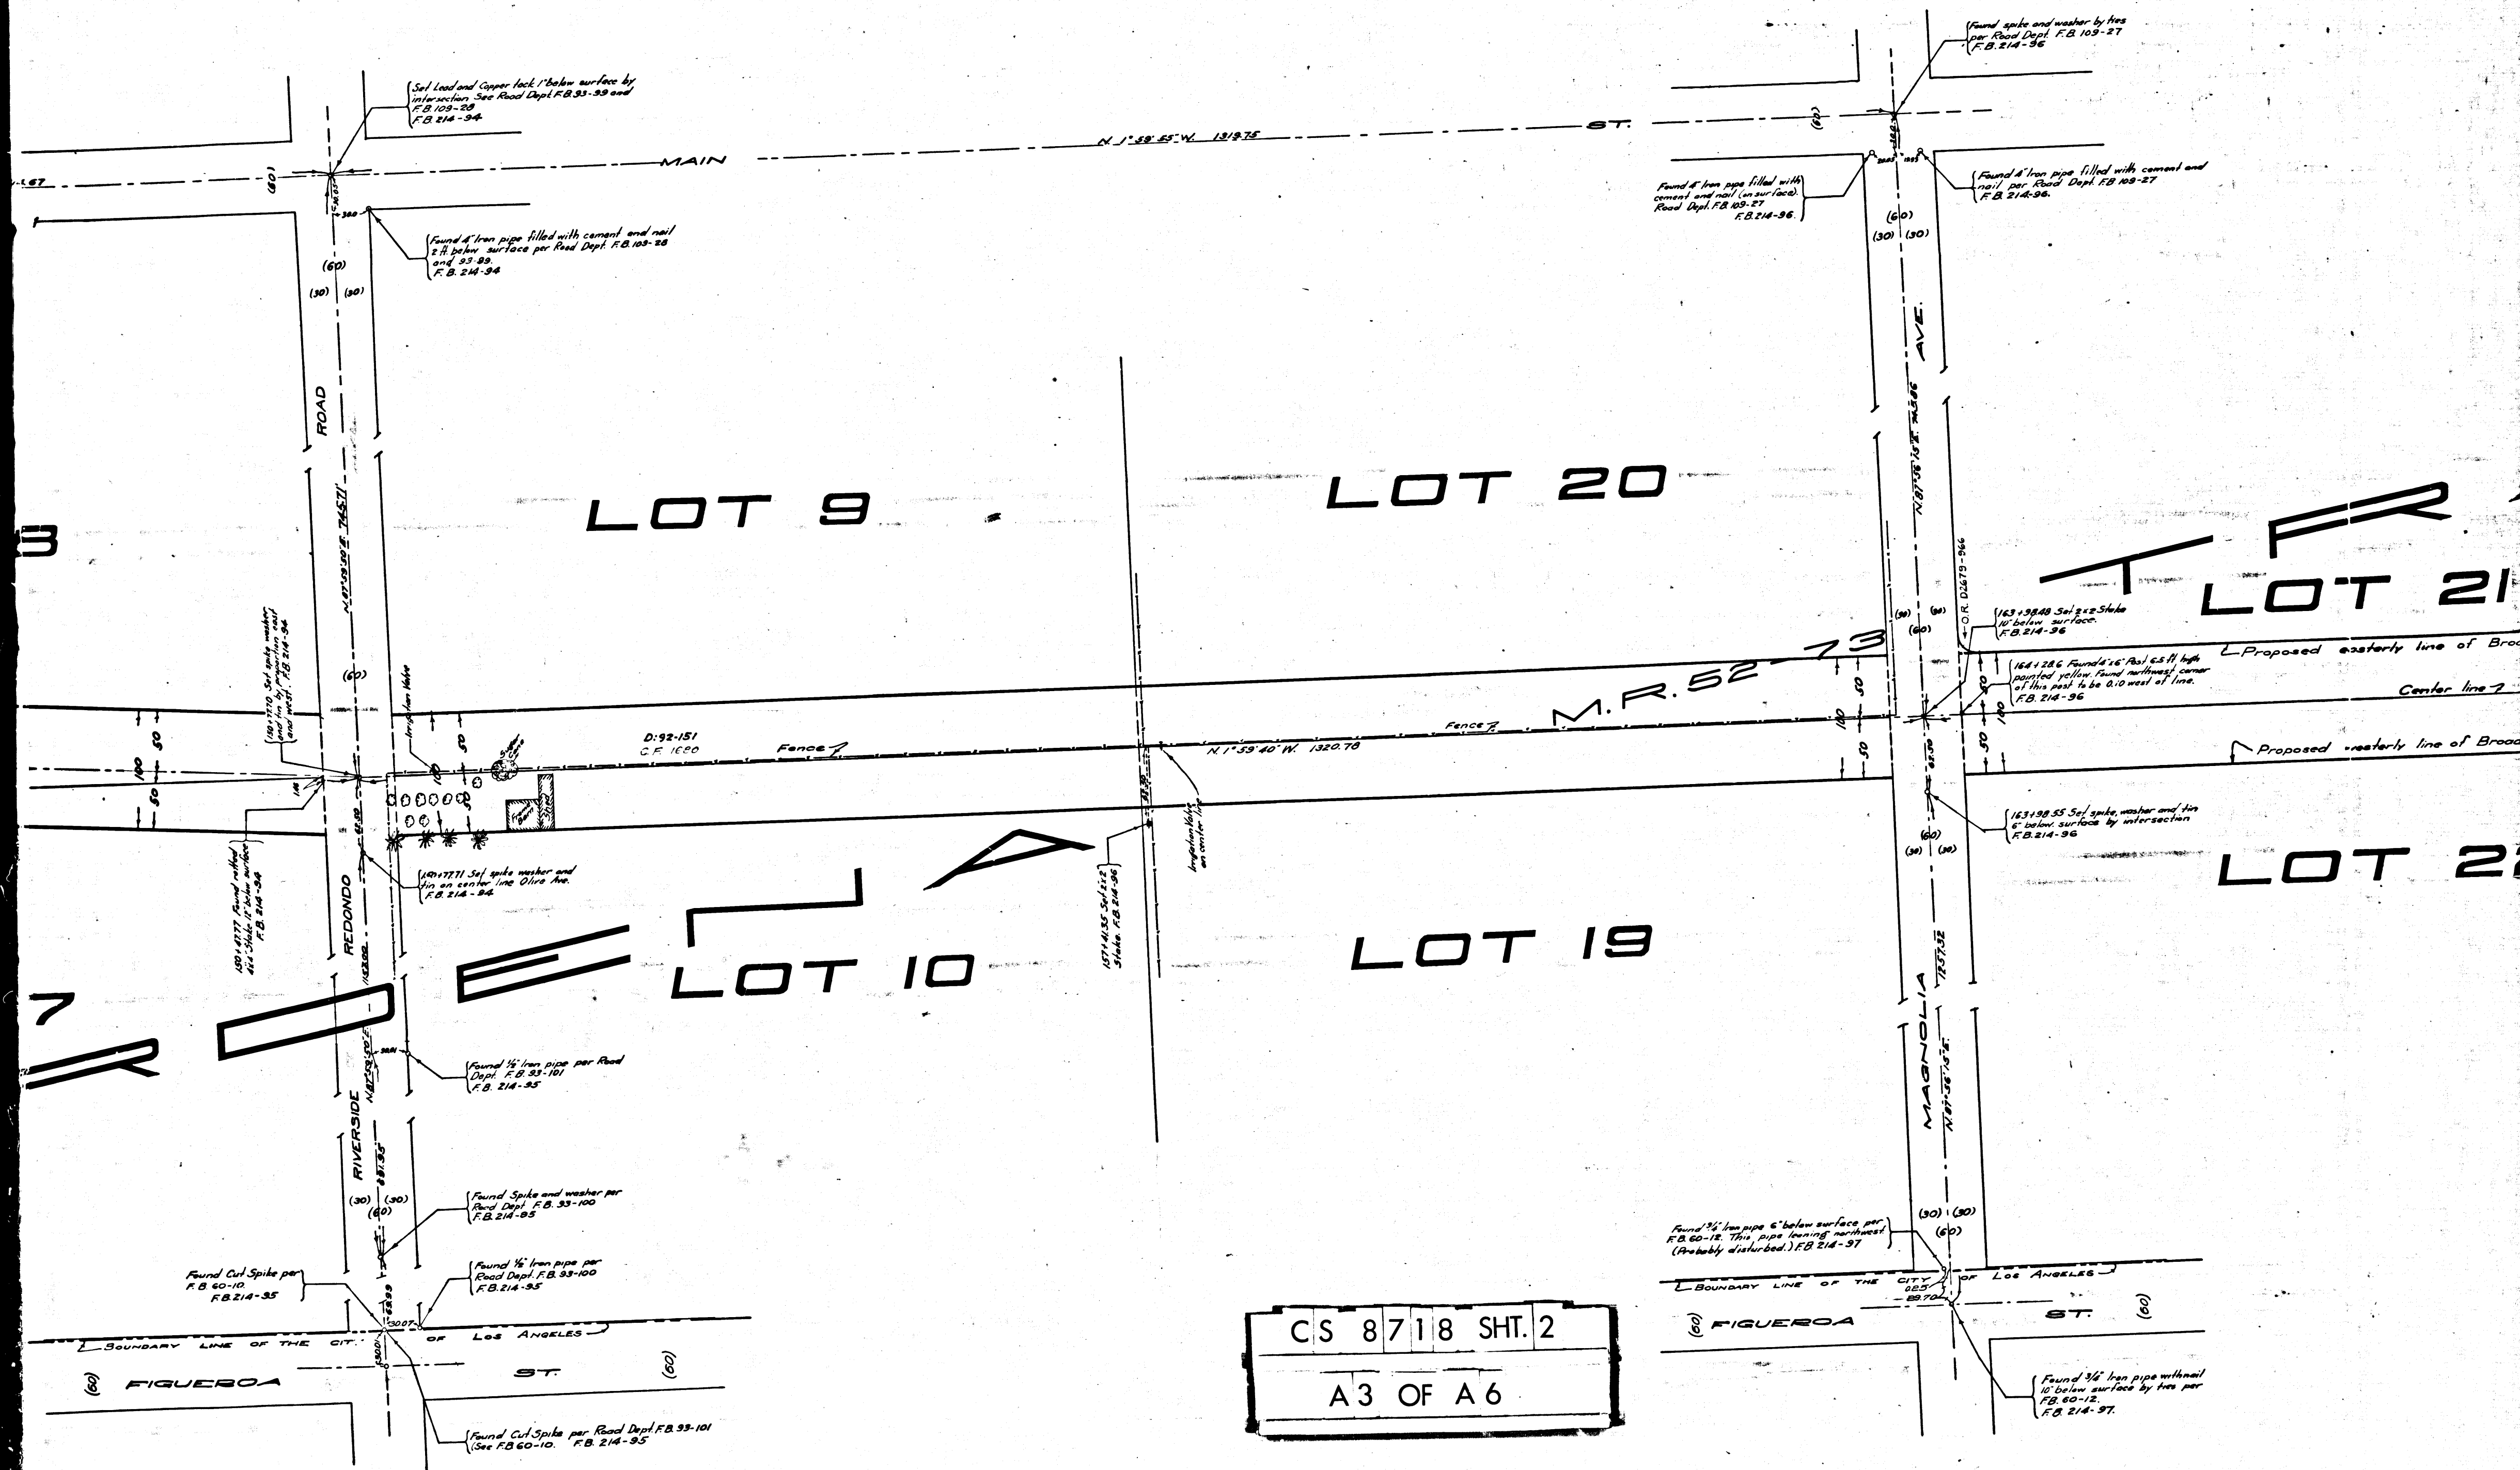

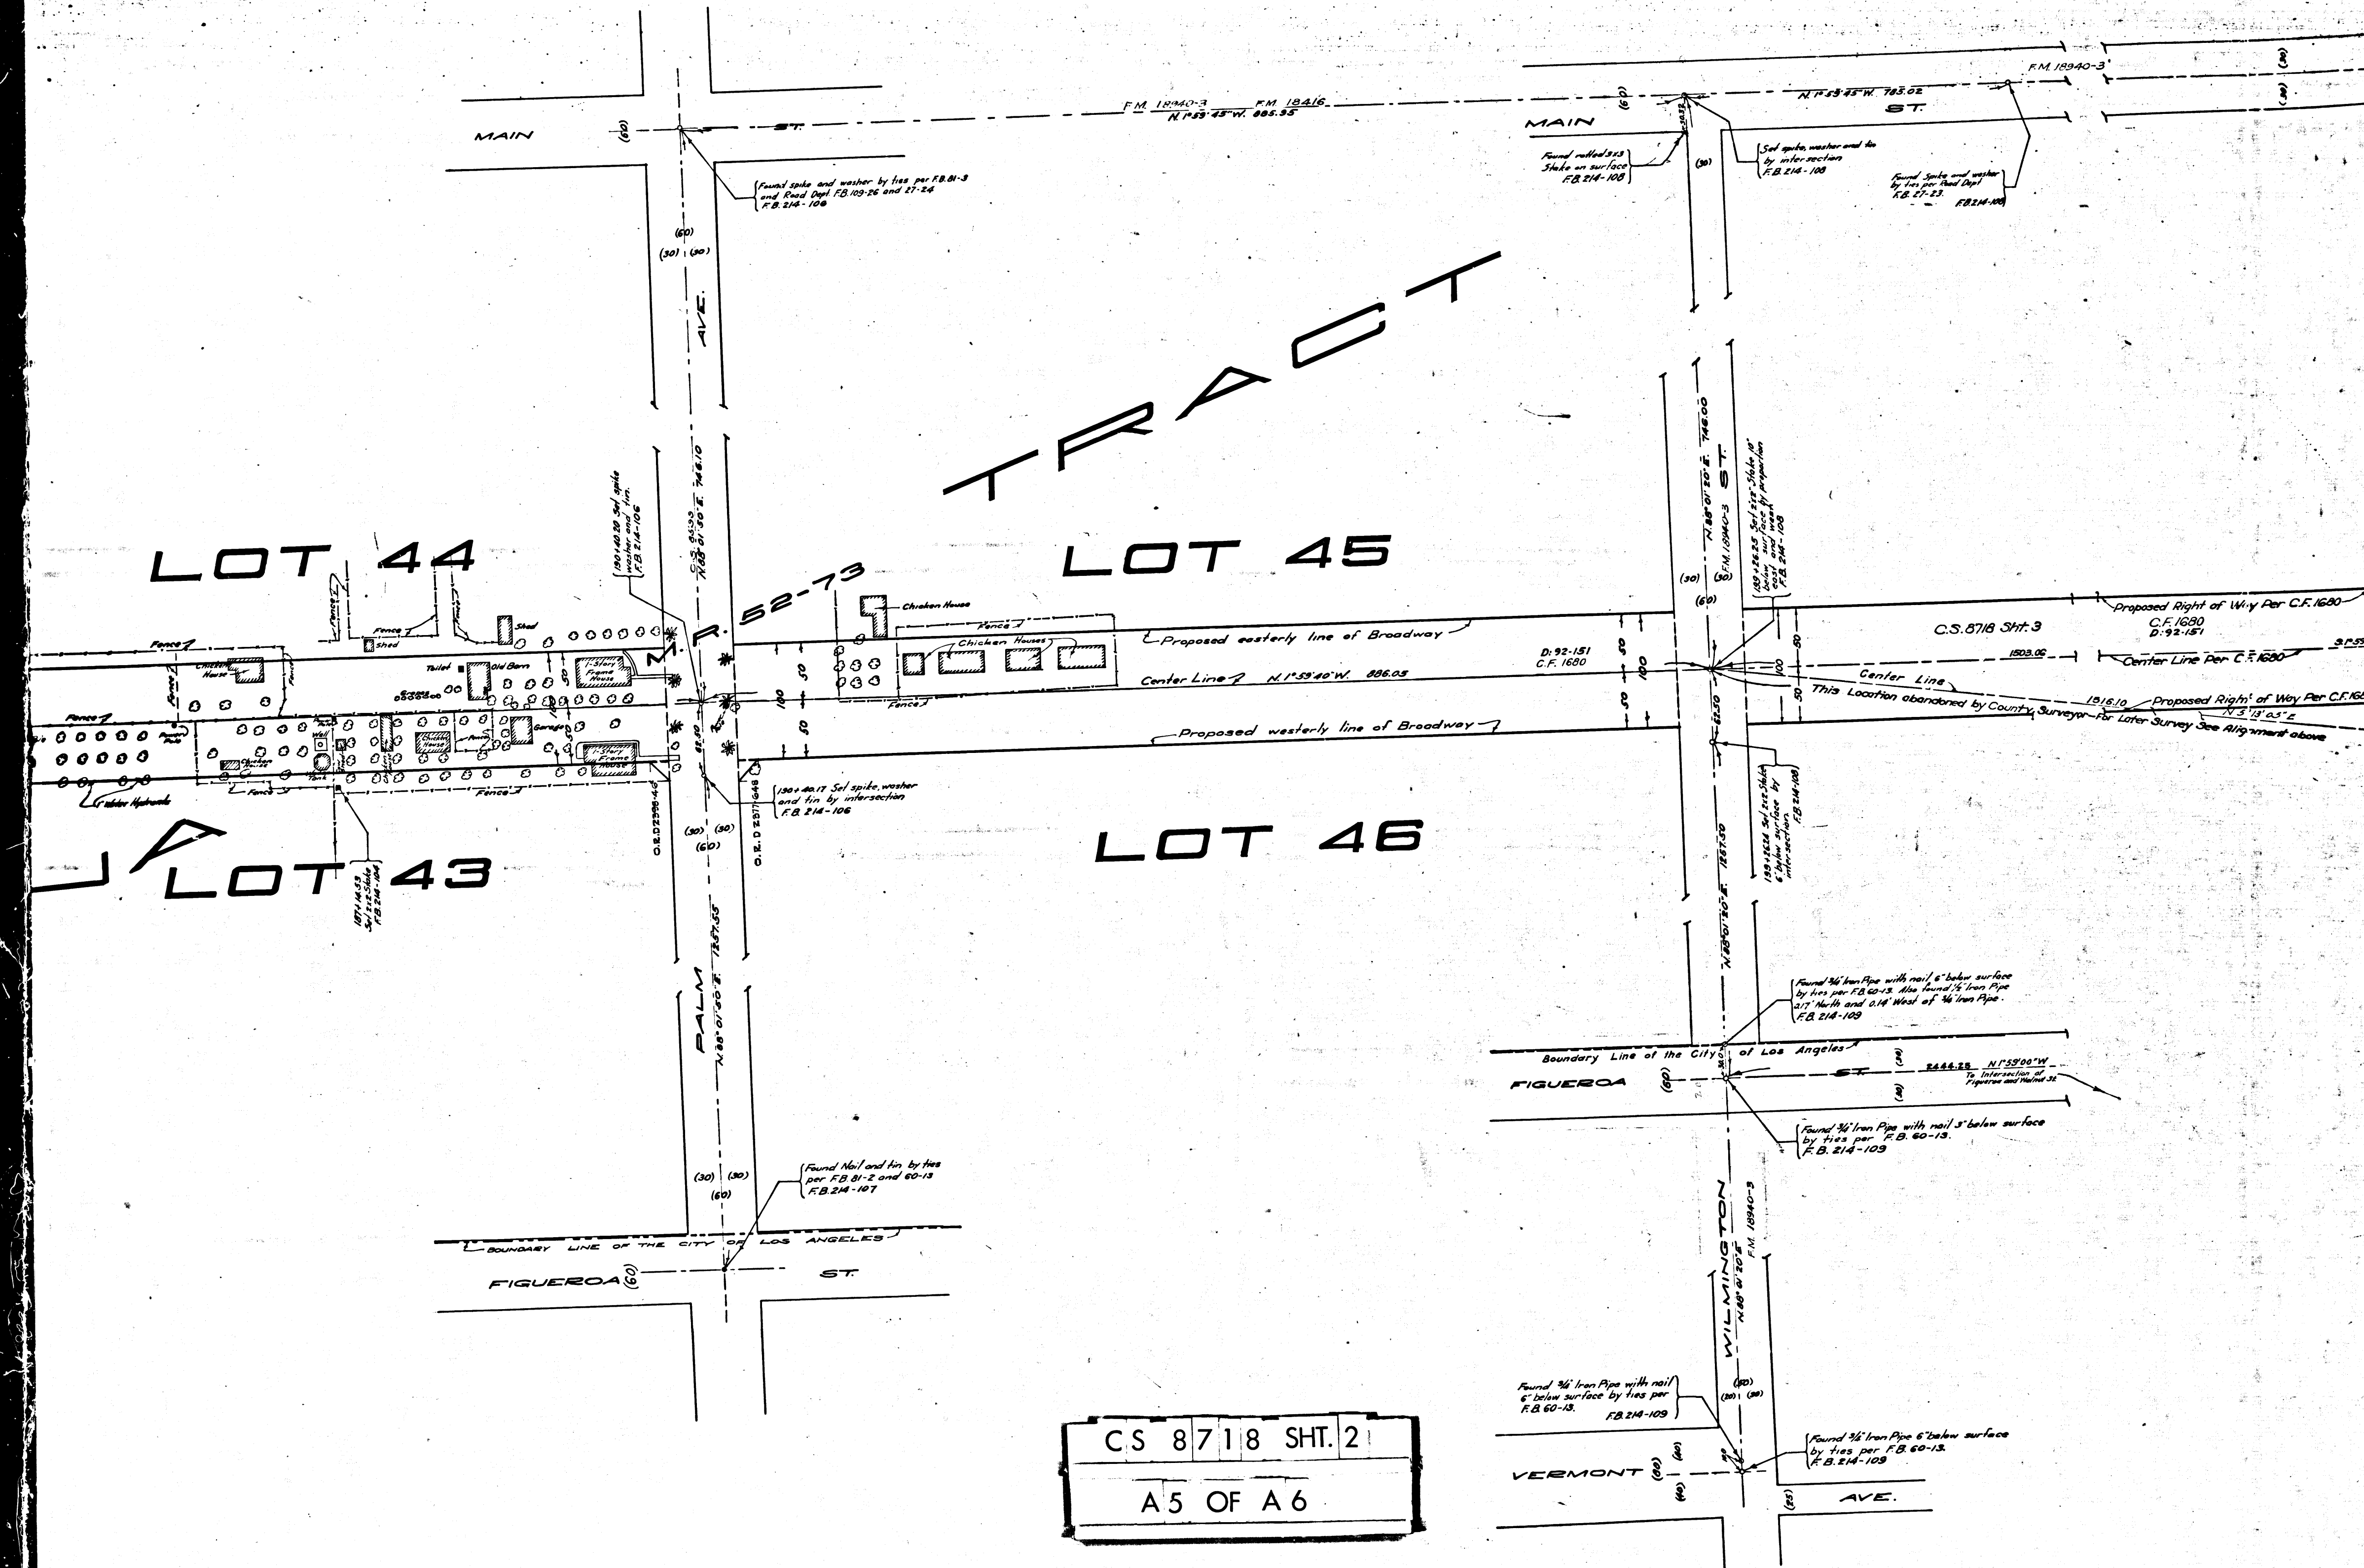

CS 8718 SHT. 2
A5 OF A6

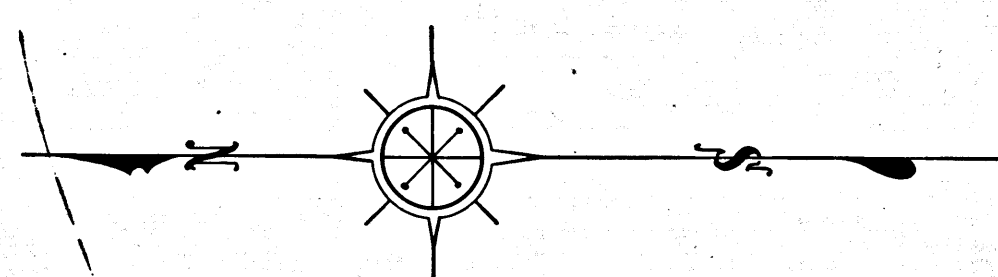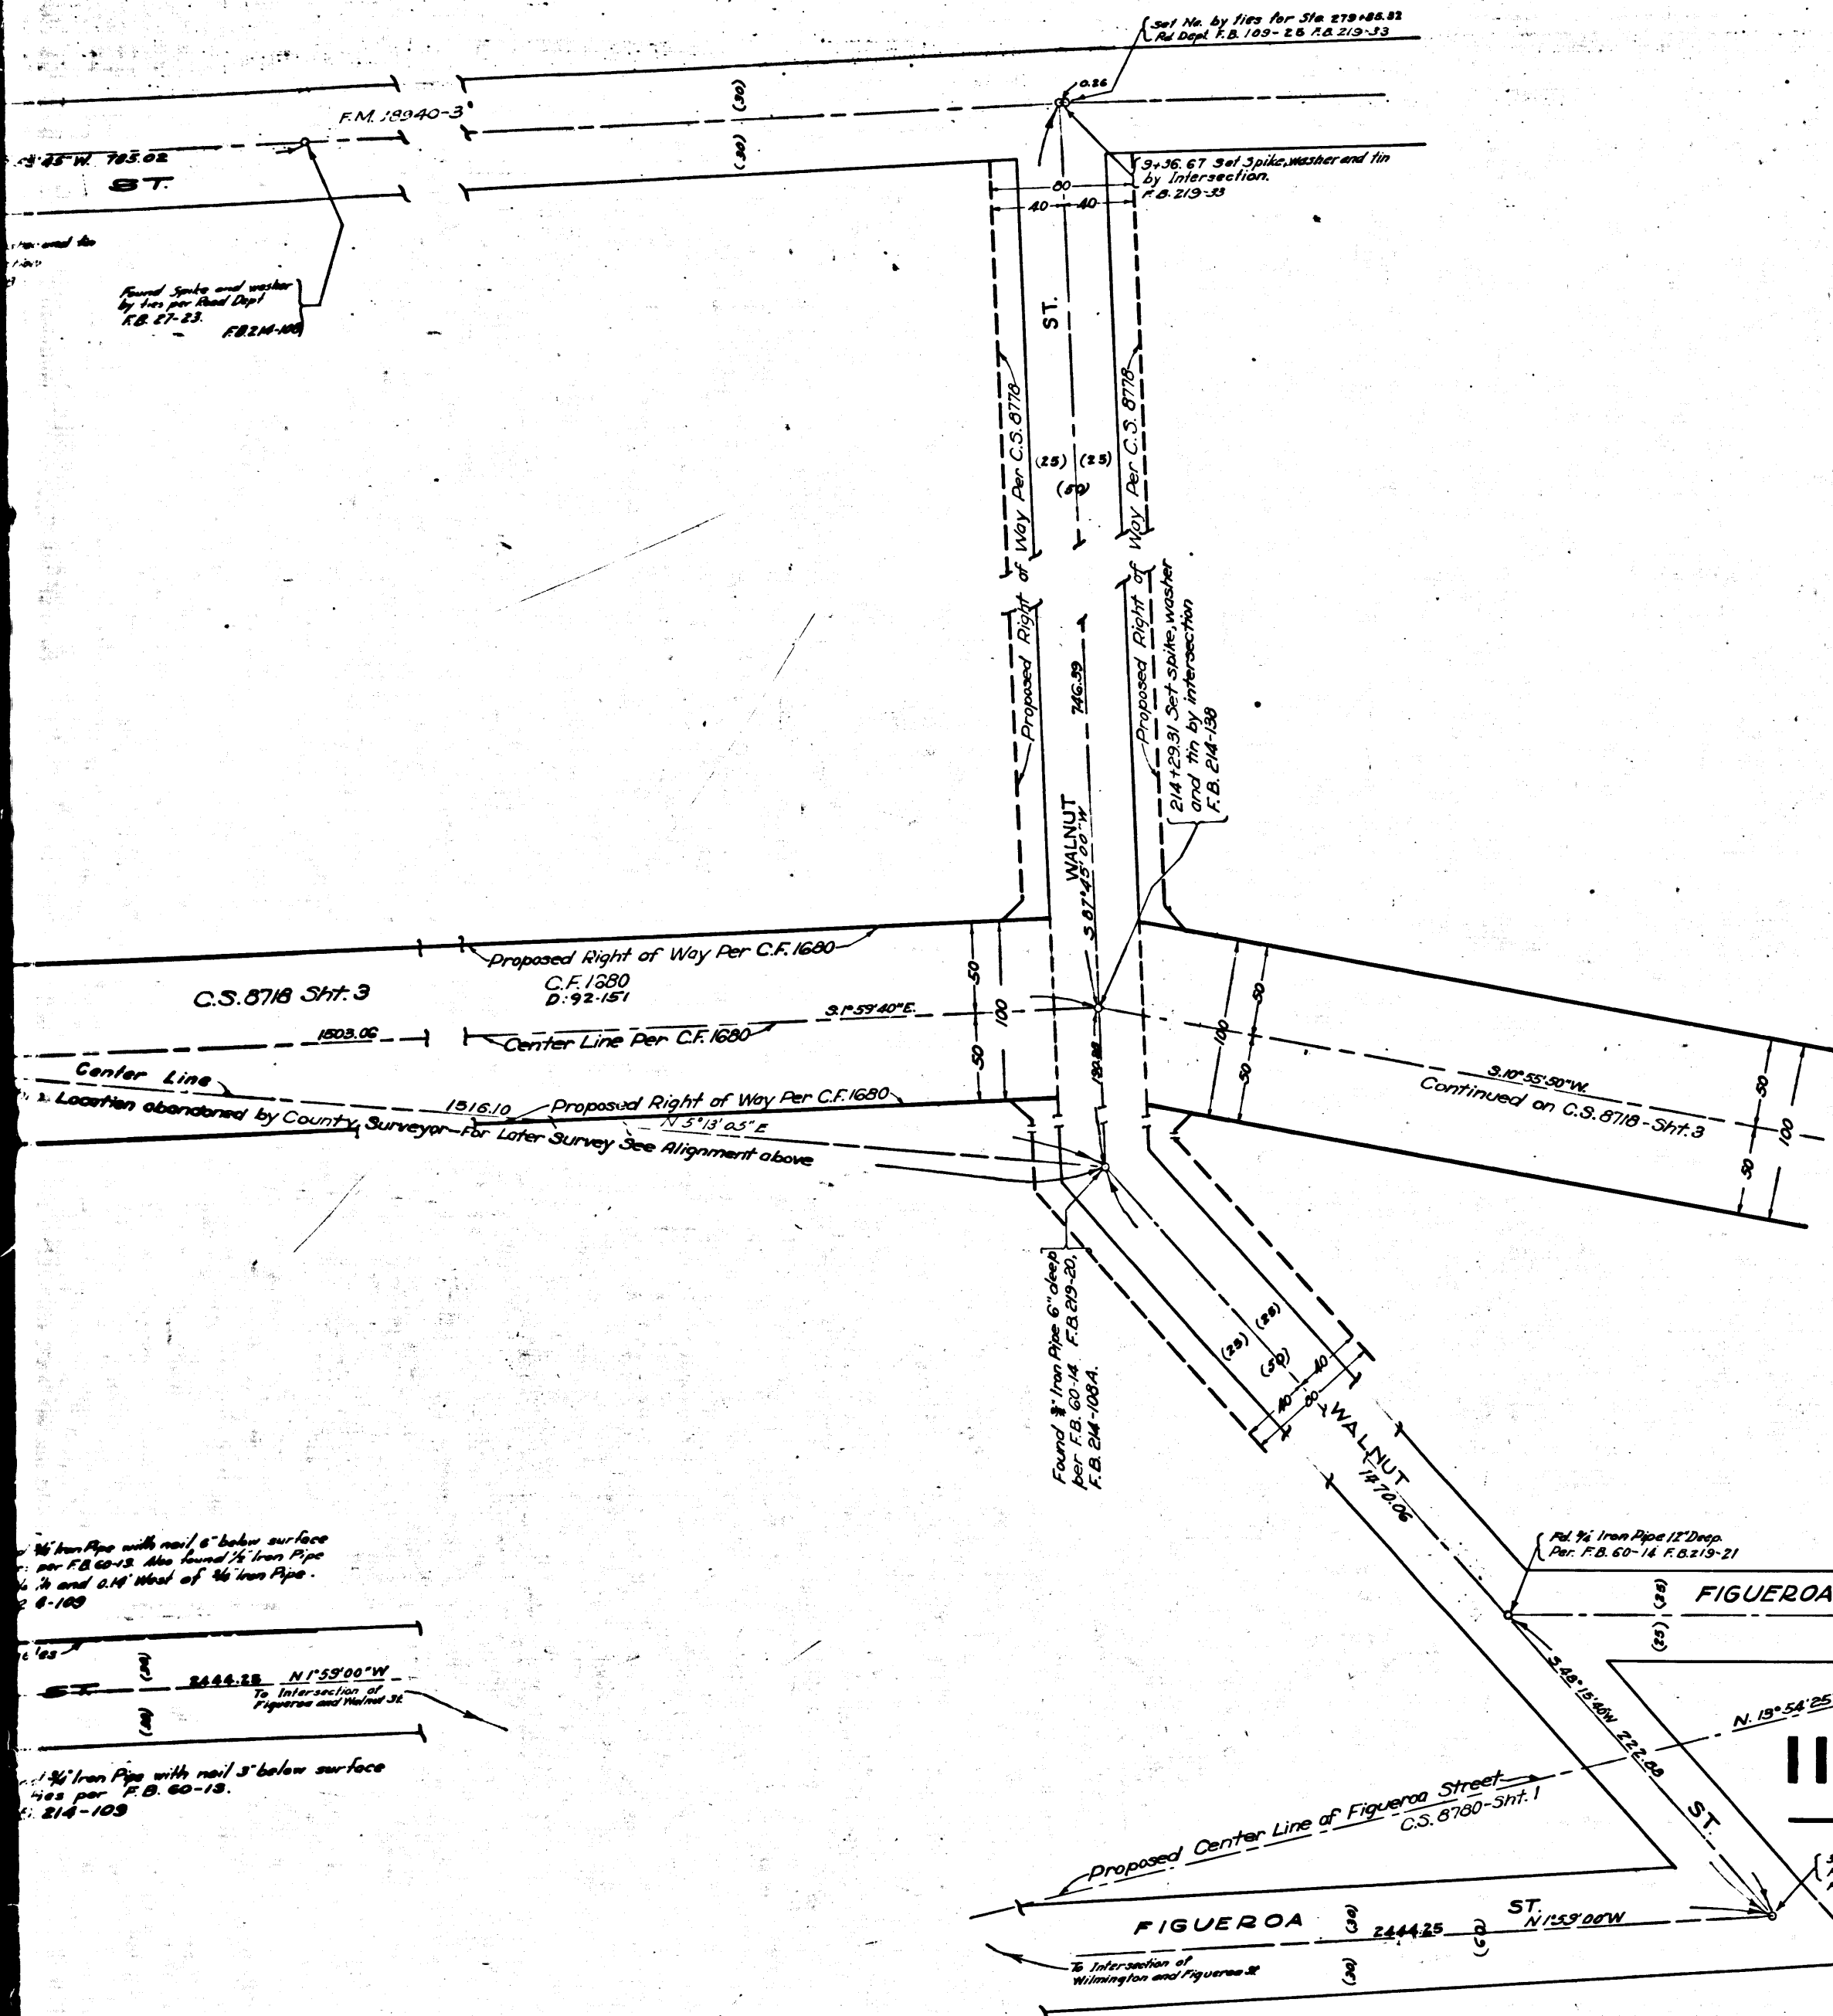

MAP OF BROADWAY FROM 110TH STREET TO WILMINGTON STREET

COUNTY SURVEYORS MAP NO. 8718
SHEET 2 OF 3 SHEETS
SCALE 1 INCH = 50 FEET

J.E. ROCKHOLD COUNTY SURVEYOR
SURVEYED JANUARY TO JUNE 1924

Surveyed under instructions of the Board of Supervisors
per order dated January 14, 1924.

Bearings based on bearing of center line of
Palm Ave. per C.S. Map No. 8599

F.B. 214 - 64 to 109

Field Work by A.E. Dunn
Office Work by J.F. Armstrong
Checked by E.J. Brook

CS 8718 SHT. 2
A 6 OF A 6