

F. D. 9367

CERTIFIED COPY


from

U. S. CADASTRAL ENGINEER'S OFFICE  
SAN FRANCISCO

---

RANCHO LINES AND SECTION LINES

T. 2 N., R. 17 W., S. E. M.

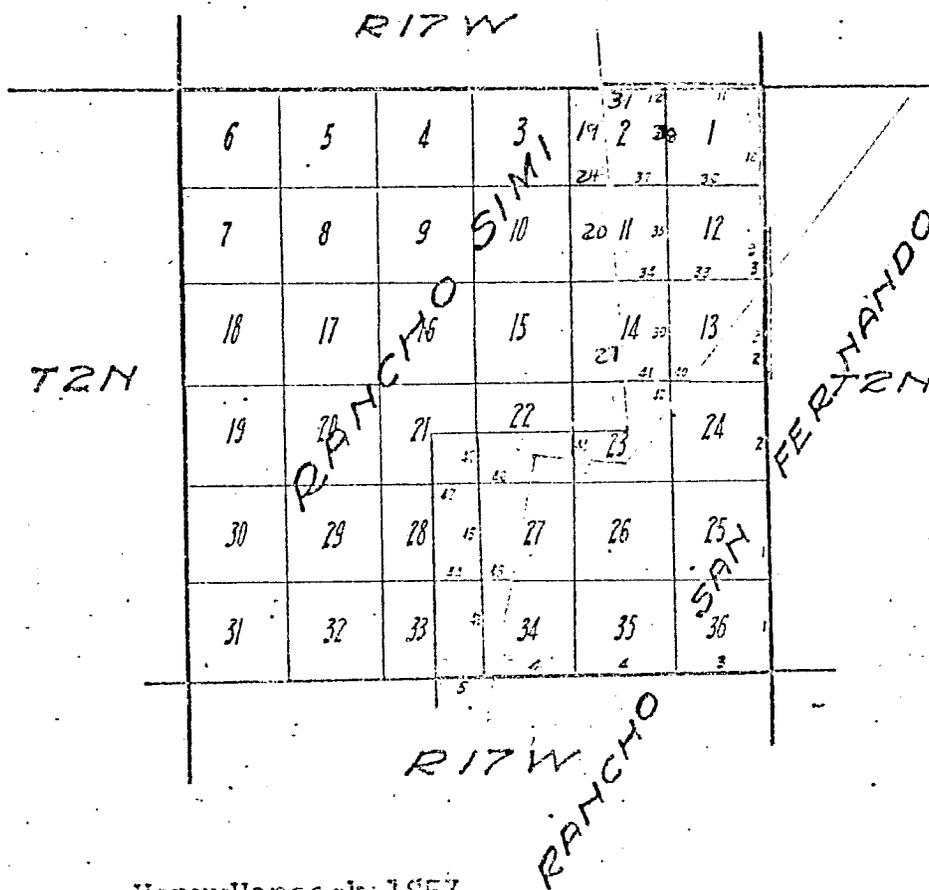

- Henry Hancock 1853
- W. P. Reynolds 1872
- J. R. Glover 1895
- M. F. Reilly 1895

*County Surveyor's Map No. 9367*


DEPARTMENT OF THE INTERIOR  
GENERAL LAND OFFICE.

-----  
Public Survey Office,  
San Francisco, California.

-----  
I, FRANK E. BARKER, Office Cadastral Engineer, do hereby certify that the annexed transcript of the field notes of fractional Township 2 North, Range 17 West, San Bernardino Meridian, is a full, true and literal exemplification of said notes, as they remain on file and of record in this office.

*Frank E. Barker*  
Office Cadastral Engineer  
for California.

May 31, 1928.

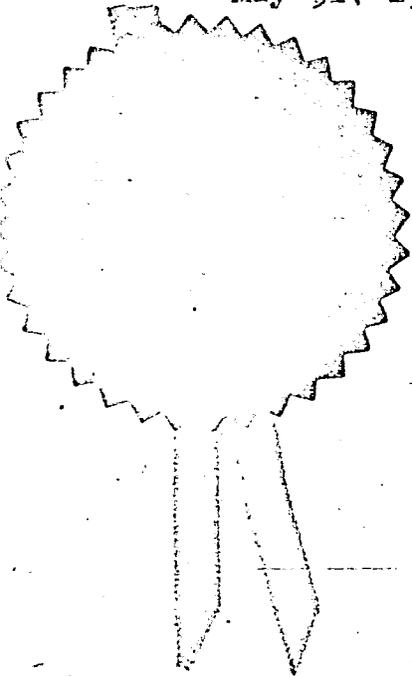

Book 273-14

Survey by Henry Hancock, Deputy Surveyor.  
Contract of December 31, 1853.

Township 1 North, Range 16 West,  
S. B. M.

On west boundary of section 6.

x x x x x x x x x x x x x x x

80.00 Set township post and charred stake in mound, corner  
of Townships 1 and 2 N., Ranges 16 and 17 W., with  
trench and pits as per instructions.

June 2.

On West Boundary Township 2 N., R. 16 West.

North, west boundary of section 31.

32.00 Across trail from ranch El Escorpion to Los Angeles,  
course S.E.

40.00 Set quarter section post, and charred stake in mound  
with trench and pits as per instructions.

80.00 Set section post and charred stake in mound, corner  
of sections 30, 25, 36, 31, with trench and pits as  
per instructions.

Second rate limestone soil.

North on west boundary of section 30.

15.00 Across main road between mission San Fernando and  
San Buenaventura, course west.

40.00 Set quarter section post and charred stake in mound  
with trench and pits as per instructions.

42.00 To base of hills.

50.00 Top of west slope of hill. a 40

55.00 Pass in hills.

65.00 Top of hill. a 200

73.00 Across trail between hills. d 150

75.00 Top of east slope of hill. a 15

Township 2 North, Range 16 West.

- 77.50 Base of hill. d 50
- 80.00 Set section post and charred stake in mound, in valley, corner of sections 19,24,25,30, with trench and pits as per instructions; from this corner a tree in the valley near the terminus of a dry arroyo, coming from the mountain, skirted with timber, bears S.63 east and a rock in mountain some 25 chains west of the head of the cañon out of which the dry arroyo starts, N.12 E.

-----  
 :  
 -----  
 On west boundary of section 19.

6.50 To dry arroyo, course S.E. about 10 links wide.

16.00 Across cart trail to west.

32.00 Base of spur of hill.

40.00 Set quarter section post and charred stake, from which a 30

A. oak 6 in. diameter S 24 E 288 links.

" " " 16 " " S.72 W. 193 "

46.00 Top of hill. a 80

66.00 Base of hill and valley.

80.00 Set section post and charred stake, corner of sections 18,13,24,19; from which bears

A white oak 18 in. diameter N.83 W. 112 links.

" " " 22 " " S.36½ W. 297 "

" " " 26 " " S.63 E. 263 "

" " " 17 " " N.70 E. 293 "

North and the tree on dry arroyo before taken bears south 26 east, and the rock do do N.17½ east.

Soil of the valley, second rate and dry.

-----  
 On west boundary of section 18.

11.64 Black oak 8 inches diameter on line.

Township 2 North, Range 16 West.

40.00 Set quarter section post and charred stake from which bears  
 A white oak 18 inches S.  $87\frac{1}{2}$  west, 185 links dist.  
 and A white oak 17 inches diameter S. 73 E. 706 links dist.

80.00 Set section post and charred stake in mound, corner of sections 7, 12, 13, 18, with trench and pits as per instructions.

Soil, second rate but dry, with scattering timber.

On west boundary of section 7.

25.06 Live oak 6 inches diameter.

40.00 Set quarter section post at base of mountain, from which bears

A black oak 12 inches diameter S.  $2\frac{1}{2}$  W. 155 links.

A black oak 10 inches diameter S.E. 153 links.

S.W. corner of granite boulder, 50 feet high and 60 feet thick S. 32 east, 39 links dist.

I find it impracticable to extend the line any farther.

Township 2 North, Range 17 west.

West on south boundary of section 36.

Variation  $13^{\circ}30'$

40.00 Set quarter section post and charred stake in mound, with trench and pits as per instructions.

80.00 Set section post and charred stake in mound, corner of sections 36, 35, 2, 1, with trench and pits as per instructions.

Soil, second rate.

Township 2 North, Range 17 West.

On south boundary of section 35.

35.00 Across trail to N.

40.00 Set quarter section post and charred stake, with trench and pits as per instructions.  
West

68.50 Across trail, course S.E.

80.00 Set section post and charred stake in mound, with trench and pits as per instructions, at base of hills, corner of sections 35, 34, 3, 2.

Soil, second rate, but dry, from this corner, towards S.E. point of an oak grove in the valley at the base of the mountain, and within small hills in which is situated the ranch house of the ranch "El Escorpion" bearing S.W., which ranch, contains 2 leagues.

On south boundary of section 34.

12.50 North slope of hill. a 40

19.00 Ravine, course N. d 30

26.50 Top of hill.

32.00 Ravine and across trail. d 40

40.00 Set quarter section post and charred stake in mound, with trench and pits as per instructions; from which bears S.E. corner of point of timber, S.88 W.

59.50 Ravine or gulch about 70 links wide. d 250

62.00 Across road, course S.W.

71.50 Ravine, course S.E.

80.00 Set section post and charred stake in rock mound, corner of sections 34, 33, 3, 4; from which bears

A walnut N.67 E. 37 links dist.

Ranch house bears S.3°E.

Township 2 North, Range 17 West.

On south boundary of section 33.

- 8.50 To top of a mountain spur. a 400
- 24.00 Across dry arroyo to S.E. about 12 links wide.
- 27.00 Across old trail.
- 29.50 To base of mountain.

Set post and charred stake, from which bears a  
 B.oak 7 inches diameter N.13½ W. 14 links distant.  
 Black oak 24 inches diameter 14 links distant.  
 " " 24 " " S.15½ E. 208 links  
 distant.

Finding it too rough to measure further west on account of the roughness of the mountain, I discontinue it.

-----  
 Book 164-26  
 Survey by Henry Hancock, Deputy Surveyor,  
 Contract of October 1st, 1857.  
 Survey executed November 9th - 18th, 1857.  
 -----

N.Bdy T.2 N., R.18 W. S. B. M.

East on the N.bdy of sec.1:

x x x x x. x x x x x x x x x x x

- 80.00 Set a sandstone rock 28 in.long, 14 in. wide and 6 in.thick  
 for cor. to Tps. 2 and 3 N., Rs.17 and 18 W., San B.M.  
 from the peaks of the mountain on the S. of valley before  
 taken bear respectively and in the order above mentioned,  
 S.24 E. and S.65½ E.

Land, undulating.

Soil, 2d rate.

-----  
 On the N.Bdy of Tp.2 N., R.17 W.,  
 S. B. M.  
 -----

Va.13°20'E.

East on the N.bdy of sec. 6.

N.Bdy T.2 N., R.17 W., S. B. M.

- 40.00 Set a post for  $\frac{1}{4}$  sec. cor. and deposited 3 rubble  
rock, 3 in. dia. and dug trench as per instructions.  
From which  
A W. oak 15 in. dia. bears S.40 W. 500 lks.dist.
- 64.50 Across dry arroyo 50 lks. wide, course S. with water  
some 20 chs.N.
- 65.00 To W.base of central portion of a high hill.
- 80.00 Set a rock 14 in.long, 13 in. wide, and 10 in.thick for  
cor. to secs. 5, 6, 31 and 32, on the W.face of hill.  
Land, principally undulating.  
Soil, 2d rate.

-----  
East on the N.bdy of sec.5.

Va.13°20'E.

- 6.00 To a point on N.side of the pinnacle of hill, some 300 feet  
above the valley.
- 20.00 To East base.
- 40.00 Set a rock 14 in. long, 11 in. wide, and  $2\frac{1}{2}$  in.thick for  
 $\frac{1}{4}$  sec. cor.
- 80.00 Set a rock 15 in. long, 6 in. wide, and 4 in.thick for  
a cor. of secs. 4, 5, 32 and 33.  
From which  
A W. oak 30 in. dia. bears N.5 E. 329 lks.dist.  
Land, hilly.  
Soil, 2d rate.  
Undergrowth, sage.

-----  
East on the N.Bdy of sec. 4.

Va.13°20'E.

- 40.00 Set a rock for  $\frac{1}{4}$  sec cor. 16 in. long, 14 in. wide and  
 $2\frac{1}{2}$  in. thick.
- 42.00 To a sandstone boulder, 10 ft. long, 4 ft. high and 4 ft.

N. Bdy. T.2 N., R.17 W., S. B. M.

thick, in center of ravine, course S. on the S.W. face  
of a rocky range and finding it impracticable to measure  
further, I return to cor. of Tps.2 and 3 N., Rs.17 and  
18 W.

-----  
W. Bdy of T.2 N., R.17 W., S. B. M.

South bet. Rs.17 and 18 W., Tp.2 N.  
Va.13°20'E.

S. bet secs. 1 and 6.

40.00 Set a post for 1/4 sec. cor. drove a charred stake and raised  
a mound with trench and pits as per instructions.

80.00 Set a post for a cor. to secs. 1, 6, 7 and 12; drove a  
charred stake and raised a mound with trench and pits as  
per instructions.

Land, level; soil, 2d rate.

-----  
South bet. secs. 7 and 12.

Va.13°20'E.

36.00 Across trail, course E.

40.00 Set a rock 17 in.long, 9 in. wide and 4 in.thick for 1/4 sec.  
cor.

56.00 Cross a dry arroyo 30 lks. wide, course W.

62.00 To base of mountain on the S.

80.00 Set a rock 14 in. long, 7 in. wide and 6 in.thick.  
From which bears

A W.oak 11 in. dia. N.66 1/2 E. 318 lks. dist.

Soil 2d rate.

-----  
South bet. secs. 13 and 18.

Va.13°20'E.

40.00 Set a rock 13 in.long, 12 in.wide and 7 in. thick for 1/4  
sec. corner.

8

W. Bdy T 2 N., R. 17 W., S.B.M.

From which bears

A sycamore 14 in. dia. S.  $15\frac{1}{2}$  W. 231 lks. dist.  
A " " 28 in. dia. S. 15 E. 318 lks. dist.  
45.50 Across dry arroyo 40 lks. wide, course N.W. on the S. side  
of a cañada, some 10 chs. wide from E.

80.00 Set a rock 24 in. long, 16 in. wide and 3 in. thick, for  
cor. to secs. 13, 18, 19 and 24.

Land, broken.

Soil, 3d rate.

South bet. secs. 19 and 24.

Va.  $13^{\circ}20'E$ .

14.20 Across cañon 1 ch. wide, from the S.E. to a sycamore 15 in  
dia. beyond which it is impracticable for the mountain.

Nov. 18th, 1857.

Book 164-11

Survey by W.P. Reynolds; Deputy Surveyor,  
Contract of March 19th, 1872.  
Survey executed May 23rd - 28th, 1872.

---

Bet. Rs. 16 & 17 W. Tp. 2 N., S.B.M.

To locate the line between Ranges 16 and 17 W. Tp. 3 N.

I proceed on to the Rancho Ex Mission San Fernando on South

side of the Santa Susana Hills, or low range of moun-

tains, and reestablish from the bearing trees, the cor.

of secs. 13, 18, 19 & 24, on line bet. Ranges 16 & 17 W. in

Tps. 2 North, I set a post in mound; from which bears

A wh. oak 22 in. dia. N. 83° W. 112 lks.

" " " 26 " " S. 36½° W. 297 "

" " " 30 " " S. 63° E. 263 "

" " " 20 " " N. 70° E. 293 "

---

North bet. secs. 13 and 18.

Va. 15° 10' E.

11.63 A wh. oak 15 in. dia.

40.00 Point for ¼ sec. cor. Set no post.

Witness trees bear as follows:

A wh. oak 24 in. dia. S. 87½° W. 185 lks.

" " " 22 " " S. 73° E. 706 "

80.00 Set a post for cor. to secs. 7, 12, 13 & 18, and raised

mound of earth with pits as per instructions.

Land, level.

2nd rate.

Scattering white & black oak.

---

North bet. secs. 7 and 12.

Va. 15° 10' E.

25.04 A live oak 22 in. dia.

30.00 S. point of sandrock bluff, 200 ft. high bears E. 5 chs.  
dist.

T.2 N., R.16 W., S. B. M.

40.00 To  $\frac{1}{2}$  sec. post in rock mound, from which witness trees bear as follows:

A blk oak 15 in. dia. S.  $2\frac{1}{2}^{\circ}$ W. 155 lks.

" " " 18 " " S.  $46^{\circ}$ E. 153 "

The S.W. corner of a sandrock boulder, 30 ft. high & 60 ft. thick, bears N.  $30^{\circ}$  E. 40 lks. dist.

The north point of a sandrock bluff bears S.  $72^{\circ}$ E. 3 chs dist.

Leave valley and ascend hill.

61.60 Summit of sandrock ledge, N.E. and S.W.

66.00 Foot of N. slope of ridge and enter small valley 10 chs wide, N. & S.

76.00 Leave valley and ascend steep hill E. and W.

80.00 Point for cor. to secs. 1, 6, 7 & 12.

It being on steep hillside, at 80.60 chs. set a sandrock 20 x 14 x 10 in irregular mound of sandrock for witness cor. as per ins.

Land, first part level, 2nd rate.

Last part hilly & broken, 3rd rate.

Timber, first part live & black oak.

-----  
North, bet. secs. 1 & 6.

Va.  $15^{\circ}10'$ E.

1.00 Summit of hill E. & W.

5.00 Top of hill and run over broken ground.

23.00 To the right and S. bank of Cañada de los Alisos, running S.  $73^{\circ}$ E. with perpendicular banks, 50 ft. high.

Set a sandstone 18 x 9 x 6.

I cause a flag to be set on the north and left bank of the Cañada, and in line bet. secs. 1 & 6, and run a base East from said sandstone 5 chs. E. to a point from which the flag bears N.  $30^{\circ}$ W. which gives by calculation for the distance across the Cañada

T.2 N., R.16 W., S. B. M.

on the said line bet. secs. 1 & 6, 8.66 chs. to which  
add 23. chs. the distance to the cañada makes

31.66 To the flag on the left and north bank of cañada to  
which point I proceeded and set a shale rock 16 x 11 x  
8 in place of the flag.

Ascend spur of hill bears S.10°W.

61.00 To the left and E. bank of a deep, dry ravine, runs S.20°W

67.50 To the right and west bank of ravine.

73.50 To summit of ridge runs S.60°E. 1 ch. wide.

77.00 Foot of a ridge and ascend.

80.00 Set a sandrock 24 x 16 x 11 for cor. to Tps. 2 & 3 N.,  
Rs. 16 & 17 W. in an irregular mound of sandrock, as per  
ins. 60 lks. from the summit of the E. point of a hill,  
running N.80°W.

Land, broken valley.

3rd rate with chamisal brush.

-----  
South Bdy of T.3 N., R.17 W.

San Bernardino Meridian.  
-----

West on a true line along the S. bdy of sec. 36.

Va. 15°10'E.

8.00 Summit of main ridge S.20°W.

10.00 Cross do & descend.

17.00 Cross a dry ravine 60 lks wide, S.20°W.

23.00 Summit of ridge S.22°W.

28.00 Cross do and descend.

33.00 " a ravine 80 lks. wide at foot of descent.

39.50 Summit of ridge S.W. and continue down gently sloping  
descent.

40.00 Set a sand rock 18 x 12 x 7 for  $\frac{1}{4}$  sec. cor. in an irreg-  
ular mound of sandrock, as per ins.

S. Bdy T.3 N., R.17 W., S. B. M.

47.28 To the left and E. bank of the Cañada de los Alisos running S.25°E. with perpendicular banks 50 ft.high.

Set a sand rock 14 x 9 x 6.

I cause a flag to be set on the right & west bank and in line of the true S.bdy of sec.36; thence from the said sand rock I run a base north 6.00 chs.

From which the flag bears S.53°W., which gives by calculation for the distance across the Cañada on the prolongation of this line 7.96 chs. which added to 47.28 chs makes

55.24 To the flag on the right and W.bank of the Canada to which point I proceed and place a sand rock in line of the flag, 15 x 10 x 5.

63.00 Sm't of ridge N.W. & S.E.

67.00 Cross do and descend.

73.00 Cross a 80 lks. wide, S.60°E.

77.50 Top of bank of ravine.

80.00 Set sandrock 24 x 16 x 10, for cor to secs. 1,2,35 and 36, in irregular mound of rocks as per ins.

Land, broken, 3rd rate.

-----  
West on a true line along the S.bdy of sec.35.

Va.15°10'E.

13.00 Cross a dry ravine, 60 lks. wide, S.60°E.

25.00 Cross a dry ravine 100 lks. wide, S.65°E.

33.00 Set a sand rock 20 x 14 x 8, for cor. to frac. secs. 2 & 35, and raised an irregular mound of sand rock as per instructions.

Land, same as last mile.

It is impracticable to run the line any further west on account of the mountainous character of the country.

I therefore stop at this point.

May 25th, 1872.

Book 362-20 Survey by J.R. Glover, Deputy Surveyor,  
Contract of November 20th, 1884.  
Survey commenced August 5th, 1895.  
Survey completed August 21st, 1895.

Resurvey. N.W. Boundary Line Rancho San Fernando, through  
T. 2 N., Rs. 16 & 17 W., S.B.M.

From station 30 on N.W. boundary line of Rancho San Fernando, which is a post set firmly in the ground marked S.F. on S.E. face, Sta. 30 with a stone mound which I rebuild around post. I run  
S. 38° W. along the boundary on a random line.

Variation 14° 30' E.

273.63 To a point 9 lks N. 52° W. from station No. 31, which is a post set firmly in the ground marked S.F. on S.E. face station 31, with a stone mound which I rebuild around post. August 5th and 6th, 1895.

Thence N. 37° 59' E. on a true line along boundary..

Variation 14° 30' E.

Descend.

- 4.63 Cross gulch 20 lks. wide, course south and ascend.
- 28.63 Top of spur bears northwest and southeast and descend.
- 57.85 Cross gulch 10 lks. wide, course south and ascend.
- 63.23 Top of round hill, bears north and south and descend.
- 71.63 Enter valley bears northwest and southeast.
- 81.25 Cross wire fence bears northwest and southeast.

An oak tree 34 in. dia. marked S.F.

- 90.23 Cross gulch 10 lks. wide, course south.  
Leave level valley and over rolling land.

101.63 Cross road bears east and west.

Resurvey  
N.W. Boundary Line Rancho San Fernando, through  
T.2 N., R.17 W. S.B.M.  
-----

- 102.13 A telegraph line bears east and west.
- 132.63 Cross road bears northwest and southeast.
- 152.63 A road bears N.  $37^{\circ}59'E$ . and S. along same.
- 180.13 Cross road bears north and south.
- 221.63 Leave road bears N.  $37^{\circ}59'E$ . and E.
- 221.88 Enter corn field bears northwest and southeast.
- 231.63 Leave corn field bears northwest and southeast.
- 238.38 Cross wash, 15 links wide, course south.  
Leave rolling land and ascend through chaparral.
- 266.63 Top of hill bears north and south and descend.
- 273.63 To station No. 30.  
Land, for about 19.00 chains level valley.  
For about 148.00 chains, rolling, remainder rough and broken.  
Soil, second and third rate.  
Scattering oak timber and dense undergrowth of chaparral.
- August 7, 1895.

-----

From station No. 31, on boundary I run

S.  $39^{\circ}W$ . on a random line.

Variation  $14^{\circ}30'E$ .

- 8.30 To station No. 32, which is a post set firmly in the ground marked S.F. No. 32, on S.E. face, with a stone mound which I rebuild around post.

Thence I run

N.  $39^{\circ}E$ . on a true line along boundary.

Variation  $14^{\circ}30'E$ .

Over rolling land.

- 8.30 To station No. 31.  
Land, rolling; soil, third rate.  
Dense undergrowth of chaparral.
-

## Resurvey

N.W. Boundary Line Rancho San Fernando, through  
T. 2 N., R. 17 W., S. B. M.

From station No. 32 on boundary I run

N.  $85^{\circ}26'W.$  on a random line along boundary.

Variation  $14^{\circ}30'E.$

72.64 To a point 15 links S.  $4^{\circ}34'W.$  of station No. 33, which  
 is a post set firmly in the ground, marked S.F.No. 33  
 on S. face, with a stone mound which I rebuild around  
 post. Thence I run

S.  $85^{\circ}19'E.$  on a true line along boundary.

Variation  $14^{\circ}30'E.$

Descend.

- 4.39 Cross gulch 6 links wide, course southeast and ascend.  
 8.64 Top of spur bears north and south and descend.  
 14.16 Cross gulch 7 links wide, course south and ascend.  
 20.64 Top of spur bears north and south and descend.  
 42.14 Cross road bears north and south.  
 42.64 House bears N. 4.00 chains dist.  
 43.64 Cross Spring branch 4 links wide, course south and  
 ascend.  
 49.64 Top of ridge bears north and south and descend.  
 56.64 Enter cultivated land in low sag bears northeast and southwest  
 and ascend.  
 57.10 Leave cultivated land bears northeast and southwest.  
 60.64 Top of spur bears north and south and descend.  
 65.10 Cross low sag bears north and south and ascend.  
 72.64 To station No. 32.  
 Land, broken and mountainous.  
 Soil, second and third rate.  
 Dense undergrowth of chaparral.

August 8, 1895.

## Resurvey

W. Boundary Line Rancho San Fernando, through  
T. 2 N., R. 17 W., S. B. M.

From station No. 33 on boundary I run

S.  $11^{\circ}32'W.$  on random line along boundary.

Variation  $14^{\circ}30'E.$

201.14 To a point 18 links S.  $89^{\circ}28'W.$  of station No. 34, which  
 is an iron post set firmly in cement at the foot of  
 an old stump lying on the ground, marked S.F. 34

August 9th and 10th, 1895.

Thence N.  $11^{\circ}29'E.$  on a true line along boundary.

Variation  $14^{\circ}40'E.$

Ascend.

- 44.22 Cross road bears east and west.
- 65.42 Top of spur bears east and west and descend.
- 69.92 Cross road in low sag bears east and west and ascend.
- 82.37 A post set firmly in the ground, bears east 84 links  
 dist.
- 88.42 Top of spur bears east and west and descend.
- 104.51 A stone set firmly in the ground, marked H.A. 3 bears E.  
 7 links dist.
- 104.62 Cross road bears east and west.
- 105.42 Cross creek 10 links wide, course east and ascend.
- 122.42 Top of spur bears northwest and southeast and descend.
- 123.20 A post set firmly in the ground.
- 128.42 Cross gulch 4 links wide, course east and ascend.
- 139.42 Top of spur bears east and west and descend.
- 154.42 Cross gulch 4 links wide, course east and ascend.
- 155.92 Top of spur bears east and west and descend.
- 163.30 A post set firmly in the ground.
- 178.62 Cross gulch 5 links wide, course east and ascend.
- 184.32 Cross wood road on top of ridge bears east and west and  
 descend.

W. Boundary Line San Fernando Rancho through  
T.2 N., R.17 W., S.B.M.

191.92 Cross ravine, 2 links wide, course southeast and ascend  
over open land.

193.22 Leave open land bears east and west and descend.

201.10 To station No. 33.

Land; rough, broken and mountainous.

Soil, third rate.

Scattering oak timber and dense undergrowth of chamisal  
and chaparral.

August 12th, 1895.

---

Book 302-21 Survey by J.R.Glover, Deputy Surveyor,  
 Contract of November 20th, 1884.  
 Survey commenced August 23rd, 1895.  
 Survey completed September 20th, 1895.

-----  
 Resurvey.

Boundary Line of Rancho Simi, through  
 T. 1 & 2 N., R. 17 W., S.B.M.

I commence my survey at station 8, on the boundary line  
 of Rancho Simi, which was a broken white lime stone  
 marked S.8 and L.A. and V., it being on the County line  
 between Los Angeles and Ventura Counties.

To remark the station, I set a limestone 34 x 12 x 12 ins.  
 25 ins. in ground, marked S.8 on W.face and raised a stone  
 mound alongside, on which I placed the old marked stone.  
 Pits impracticable.

Thence I run

North on a random line along boundary.

Variation 14°30'E.

400.18 To a point 8 links east of old station 9, which I find  
 nearly destroyed. I obliterated all traces of old corner  
 and in its place, set a sandstone 24 x 12 x 10 ins. marked  
 S 9 on W.face, on top of a sandstone boulder 10 x 8 x 6  
 feet and raised a stone mound alongside.  
 Pits impracticable.

August 23, 24, 26, 27 and 28, 1895.

Thence I run

S.0°1'E. on a true line along boundary.

Variation 14°30'E.

Descend.

.18 Set a sandstone 24 x 15 x 6 ins. 18 ins. in the ground for  
 corner on line, marked 10/400 on S. and S. on W. faces  
 and raised a stone mound alongside.  
 Pits impracticable.

18.00 Cross gulch 10 links wide, course east and ascend.

## Resurvey

Boundary Line of Rancho Simi, through  
Tps. 1 and 2 N., R.17 W., S.B.M.

---

- 28.14 Cross wood road bears northwest and southeast.
- 40.18 A sandstone 15 ft. high, which I mark 9/360 on S. and S. on W.faces, for corner on line.
- 46.18 Top of ridge bears east and west and descend.
- 53.00 Cross gulch 10 links wide, course northeast and ascend.
- 54.18 Top of spur bears east and west and descend.
- 62.78 Cross Spring branch 10 links wide, course east and ascend.
- 67.18 Top of spur bears east and west and descend.
- 80.18 Set a sandstone 24 x 12 x 8 ins. 18 ins. in the ground, for corner on line marked 8/320 on S. and S. on W.faces and raised a stone mound alongside.
- Pits impracticable.
- 97.75 Cross gulch 8 links wide, course east and ascend.
- 98.22 Cross wood road bears east and west.
- 99.68 Top of spur bears northeast and southwest and descend.
- 101.88 Cross gulch 6 links wide, course northeast and ascend.
- 115.18 Top of ridge bears northeast and southwest and descend.
- 120.18 Set a sandstone 20 x 10 x 8 ins. 15 ins. in the ground for corner line marked 4/280 on S. and S. on W.faces, and raised a stone mound alongside.
- Pits impracticable.
- 123.58 Cross spring branch 15 links wide, course east and ascend.
- 130.92 Cross trail bears northeast and southwest.
- 132.18 Top of low spur bears east and west and descend.
- 134.18 Enter flat bears east and west.
- 140.18 Leave flat bears east and west and ascend.
- 144.18 Top of ridge bears east and west and descend.
- 151.18 Cross head of gulch, course southeast and ascend.
- 153.18 Top of spur bears northwest and southeast and descend.
- 160.18 Set a cement stone 20 x 10 x 8 ins. 15 ins. in the ground for corner on line marked 6/240 on S. and S. on W.faces,

## Resurvey

Boundary Line of Rancho Simi, through  
Tps. 1 and 2 N., R. 17 W., S.B.M.

- and raised a mound of stone alongside.
- Pits impracticable.
- 163.96 Cross ravine 6 links wide, course east and ascend.
- 175.58 Top of ridge bears east and west and descend.
- 186.88 Cross gulch 10 links wide, course east and ascend.
- 190.80 Cross road bears east and west.
- 200.18 Set a sandstone 30 x 18 x 12 ins. 22 ins. in the ground for corner on line marked 5/200 on S. and S. on W. faces and raised a stone mound alongside.
- Pits impracticable.
- 217.18 Top of ridge bears east and west and descend.
- 224.18 Cross low sag bears east and west and ascend.
- 229.95 Top of ridge bears east and west.
- The land in advance consists of precipitous cliffs, impossible to chain, I leave flag at this point, and proceed to a point on true line, from which I run a base east of 3.50 chains from the east end of which the flag bears N.18°54'W. giving by calculation, a distance of 10.23 chains and a total distance from station 9 of
- 240.18 To foot of cliffs and set a sandstone 22 x 16 x 12 ins. 16 ins. in the ground for corner on line marked 4/160 on S. and S. on W. faces, and raised a stone mound alongside.
- Pits impracticable.
- 248.18 Cross creek 12 links wide, course southeast and ascend.
- 266.18 Top of spur bears east and west and descend.
- 280.18 Set a limestone 18 x 12 x 10 ins. 12 ins. in the ground for corner on line marked 3/120 on S. and S. on W. faces, and raised a stone mound alongside.
- Pits impracticable.
- 283.12 Cross gulch 4 links wide, course east and ascend.

## Resurvey

Boundary Line of Rancho Simi, through  
T.1 N., R.17 W., S. B. M.

- 299.68 Top of ridge bears east and west and descend.
- 307.14 Cross gulch 5 links wide, course east and ascend.
- 311.18 Top of ridge bears east and west and descend.
- 316.18 Cross gulch 6 links wide, course east and ascend.
- 320.18 Set a limestone 18 x 12 x 6 ins. 12 ins in the ground  
for corner on line marked 2/80 on S. and S. on W.faces,  
and raised a stone mound alongside.
- Pits impracticable.
- 322.68 Top of ridge bears east and west and descend.
- 336.68 Cross head of gulch, course east and ascend.
- 342.18 Top of ridge bears east and west and descend.
- 346.93 Cross gulch 10 links wide, course southeast and ascend.
- 356.18 Top of ridge bears northwest and southeast and descend.
- 360.18 Set a limestone 20 x 8 x 6 ins. 15 ins. in the ground  
for corner on line marked 1/40 on S. and S. on W.faces,  
and raised a stone mound alongside.
- Pits impracticable.
- 366.70 Cross gulch 6 links wide, course S.45°E. and ascend.
- 376.68 Top of ridge bears east and west and descend.
- 388.78 Cross gulch 4 links wide, course southeast and ascend.
- 391.18 Top of ridge bears east and west and descend.
- 394.33 Cross fence bears east and west.
- 396.93 Cross gulch 4 links wide, course east and ascend.
- 400.18 To station No.8.  
Land, mountainous.  
Soil, third rate.  
Scattering oak timber and dense undergrowth of chaparral.

August 29, 30 and 31.

From station No.9, I run

East on a random line along boundary

## Resurvey

Boundary of Rancho Simi, through T.2 N.,  
R.17 W., S.B.M.

Variation  $14^{\circ}30'E$ .

- 162.94 To station No.10, which I find in bad condition.  
To remark same, I set a post 4 feet long, 6 ins. square,  
12 ins. in the ground, marked S. 10 on N.W. face, dug  
pits 18 x 18 x 12 ins. in line N. and W. of post,  $5\frac{1}{2}$   
feet dist., and raised an earth mound 2 feet high  
 $4\frac{1}{2}$  ft. base around post; from which bears  
A live oak 30 ins. dia.  $N.17^{\circ}E$ . 40 links dist.  
marked S 10 B T.

September 6, 1895.

Thence I run

West on a true line along boundary.

Variation  $14^{\circ}30'E$ .

Ascend.

- 16.94 Top of spur bears north and south and descend.  
28.84 Cross ravine, 8 links wide, course south and ascend.  
33.94 Top of ridge bears north and south and descend.  
42.94 Set a sandstone 24 x 10 x 8 ins. 18 ins. in the ground  
for corner on line marked  $3/120$  on W. and S. on N.  
faces, and raised a stone mound alongside.  
Pits impracticable.  
48.84 Cross gulch 6 links wide, course south and ascend.  
60.94 Top of spur bears north and south and descend.  
68.90 Cross gulch 6 links wide, course south and ascend.  
75.94 Top of spur bears northeast and southwest and descend.  
80.94 Cross wood road bears north and south.  
81.94 Cross gulch, 4 links wide, course south and ascend.  
82.94 Set a sandstone 26 x 16 x 7 ins. 19 ins. in the ground  
for corner on line marked  $2/80$  on W. and S. on N. faces  
and raised a stone mound, alongside.

## Resurvey

Boundary Line of Rancho Simi, through  
T.2 N., R.17 W., S.B.M.

---

Pits impracticable.

- 105.04 Top of spur bears north and south, and descend.  
108.83 Cross gulch 4 links wide, course south and ascend,  
121.94 Top of spur bears north and south and descend.  
122.94 Set a sandstone 20 x 16 x 8 ins. 15 ins. in the ground  
for corner on line marked 1/40 on W. and S. on N. faces  
and raised a stone mound alongside.

Pits impracticable.

- 125.92 Cross gulch 4 links wide, course southeast and ascend.  
133.94 Top of spur bears northwest and southeast and descend.  
158.94 Cross gulch 4 links wide, course southeast and ascend.  
162.94 To station No.9.

Land, broken and mountainous.

Soil, third rate.

Scattering oak timber and dense undergrowth of chaparral.

September 7, 1895.

---

From station No.10, I run

N.1°20'W. on a random line along boundary.

Variation 14°30'E.

It being impossible to chain this line on account of  
precipitous cliffs, I offset N.88°40'E. 4.00 chains.

Thence N.1°20'W. 40.00 chains.

Thence S.1°20'W. to line.

Thence N.1°20'W.

- 124.90 To a live oak tree, marked S.8 on W. face.

September 9, 1895.

Thence I run

S.1°20'E. on a true line along boundary.

Variation 14°30'E.

Descend.

## Resurvey

Boundary Line of Rancho Simi, through  
T.2 N., R.17 W., S. B. M.

- 4.90 A sandstone in place 6 x 6 x 3 feet above ground marked S.3/120 for corner on line.
- 17.93 Cross gulch 10 links wide, course east and ascend.
- 19.90 Top of spur bears east and west and descend.
- 31.55 Cross gulch 10 links wide, course east and ascend.
- 44.90 Set a sandstone 24 x 18 x 12 ins. 18 ins. in the ground for corner on line marked S 2/80 on S. face and raised a stone mound alongside.
- Pits impracticable.
- 68.90 Top of spur bears east and west and descend.
- 84.90 Set a sandstone 14 x 12 x 10 ins. 9 ins. in the ground for corner on line marked S. 1/40 on S. face and raised a stone mound alongside.
- Pits impracticable.
- 124.90 To station No.10.
- Land, mountainous.
- Soil, third rate.
- Scattering oak timber and dense undergrowth of chaparral.

September 10, 1895.

Having verified the course of the last line as being N.1°20'W. I continue on this angle from the live oak tree marked S.8 to what I consider a proper distance for the north boundary of T.2 N., R.17 W. and at

- 162.31 Set temporary corner for sections 2 and 35, on north boundary of Township.

September 11 and 12.

corner to  
I now go to Townships 2 and 3 N. Rs.16 and 17 W. and run W., see book of exteriors.

The length of boundary line of Rancho Simi from the live oak tree marked S.8 to north boundary of T.2 N.,

## Resurvey

Boundary Line of Rancho Simi, through  
T.2 N., R.17 W. S.B.M.

R.17 W., is therefore 162.41 chains where I set corner, description of which is given in Book of exteriors.

Thence I run

S.1°20'E. on a true line along boundary.

Variation 14°30'E.

Ascend.

- 5.31 Top of ridge bears east and west and descend.
- 7.31 Set a sandstone 16 x 12 x 4 ins. 11 ins. in the ground for corner on line; marked S. 7/280 on S.face and raised a stone mound alongside.
- 18.96 Cross gulch, 10 links wide, course east and ascend.
- 47.31 A sandstone in place, 12 x 8 x 6 feet above ground which I marked S.6/240 on S.face, for corner on line.
- 57.46 Top of spur bears northeast and southwest and descend.
- 83.71 Cross gulch 10 links wide, east and ascend.
- 86.96 Cross trail bears east and west.
- 87.31 Set a sandstone 24 x 18 x 12 ins. 18 ins. in the ground for corner on line marked S.5/200 on S.face and raised a stone mound alongside.
- Pits impracticable.
- 98.31 Top of ridge bears east and west and descend.
- 107.35 Cross gulch 8 links wide, course S.30°E. and ascend.
- 111.81 Top of spur bears northwest and southeast and descend.
- 118.46 Cross gulch 6 links wide, course east and ascend.
- 122.76 Top of spur bears east and west and descend.
- 127.31 Set a sandstone 24 x 14 x 8 ins. 18 ins. in the ground for corner on line marked S 4/160 on S.face and raised a stone mound alongside.
- Pits impracticable.
- 131.26 Cross gulch 6 links wide, course east and ascend.

## Resurvey

Boundary Line of Rancho Simi, through  
 T.2 N., R.17 W. S.B.M.  
 -----

- 131.35 Cross road from Los Angeles to Ventura bears east and west.
- 144.31 Top of spur bears east and west and descend.
- 148.96 Cross low sag bears east and west and ascend.
- 162.11 Cross old road from Los Angeles to Ventura bears east and west.
- 162.41 To live oak tree marked S.8.  
 Land, mountainous.  
 Soil, third rate.  
 Scattering oak timber and dense undergrowth of chaparral.

September 18, 19 and 20.

-----

Book 128-15 Survey by J.R.Glover, Deputy Surveyor,  
 Contract of November 20th, 1884.  
 Survey commenced September 13th, 1895.  
 Survey completed October 28th, 1895.

E. Boundary T.2 N., R.17 W., S.B.M.

From the cor. to Tps. 2 and 3 N., Rs.16 and 17 W., which  
 I find nearly destroyed, the stone out of the ground  
 and the mound torn down and to remark which I set a  
 post  $4\frac{1}{2}$  ft. long, 4 ins. square, with old marked stone 12  
 ins. in the ground, marked  
 T 3 N S 31 on N.E. R 16 W S 6 on S.E.  
 T 2 N. S 1 on S.W. and R 17 W S 36 on NW.faces,  
 with 6 notches on each edge and raised a stone mound  
 around post. Pits impracticable. I run  
 South on a true line bet. secs.1 and 6.

Lat.  $34^{\circ}07'N$ . Va.  $14^{\circ}30'$  East.

Descend.

- 13.00 Cross gulch 10 lks wide, course  $S.40^{\circ}E$ . and ascend.  
 27.50 Top of ridge bears  $N.40^{\circ}W$ . and  $S.40^{\circ}E$ . and descend.  
 40.00 Set a post 3 ft. long, 3 ins. square, with marked stone  
 12 ins. in the ground, for  $\frac{1}{4}$  sec. cor. marked  $\frac{1}{4}$  S. on W.  
 face, and raised a stone mound around post. Pits imprac-  
 ticable.  
 Cor. set in low sag, bears E. and W, and ascend.  
 41.40 Top of spur bears E. and W. and descend .  
 48.50 Cross cañon 30 lks. wide, course E. and ascend.  
 56.00 Top of ridge bears NE. and S.W. and descend.  
 72.10 Cross road bears E. and W.  
 80.00 Set a post 4 ft. long, 4 ins. square, with marked stone  
 12 ins. in the ground, for cor. to secs. 1, 6, 7 and 12,  
 marked  
 T 2 N S 6 on N.E. R 16 W S 7 on S.E.  
 R 17 W S 12 on S.W. and S 1 on N.W:faces, with 1  
 notch on N. and 5 notches on S. edges, and raised a stone

E. Boundary T.2 N., R.17 W. S. B. M.

Earth mound around post.

Pits impracticable.

Land, rough, broken and mountainous.

Soil, 3rd rate.

Scattering oak timber and dense undergrowth of chaparral.

South on a true line bet. secs. 7 and 12.

Va.  $14^{\circ}30'$  East.

Descend.

- 6.00 Enter valley bears E. and W.
- 12.00 Leave valley bears E. and W. and ascend.
- 17.00 Top of ridge bears E. and W. and descend.
- 28.50 Cross road, bears E. and W.
- 36.00 Cross road bears  $N.80^{\circ}E.$  and  $S.80^{\circ}W.$
- 37.00 Cross gulch, 6 lks. wide, course  $S.80^{\circ}W.$  and ascend.
- 40.00 Set a post 3 ft. long, 3 ins. square, 12 ins. in the ground for  $\frac{1}{4}$  sec. cor. marked  $\frac{1}{4}$  S on W. face; from which bears  
A live oak 16 ins. dia.  $S.27^{\circ}W.$  233 lks. dist. marked  $\frac{1}{4}$  S B T.

No other tree within limits; dug pit 18 x 18 x 12 ins N. of post,  $5\frac{1}{2}$  ft. dist. and raised an earth mound  $1\frac{1}{2}$  ft. high  $3\frac{1}{2}$  ft. base around post.

- 40.85 Cross fence bears E. and W. Enter County road, bears N. and S. and along same.

- 80:00 The true point for cor. to secs. 7, 12, 13 and 18, falling in center of County road, I sunk a sandstone 14 x 12 x 12, marked with 2 notches on S. and 4 notches on S. edges at this point and at a point 39 lks. due W. of cor. set a post 4 ft. long, 4 ins. square, with marked stone 12 ins in the ground, for witness cor. to said sections, marked

E. Boundary T.2 N., R.17 W., S.B.M.

W.C.T. 2 N. S 7 on N.E. R 16 W S 18 on S.E.

R.17 W S 13 on S.W. and S 12 on N.W.faces, with 2 notches on N. and 4 notches on S. edges, and raised a stone mound around post.

Pits impracticable.

Land, broken and mountainous for 40 chs; remainder level and rolling.

Soil, 2nd and 3rd rate.

Scattering oak timber and dense undergrowth of chaparral.

From true point for cor. to secs. 7, 12, 13 and 18, I run South on a true line bet. secs. 13 and 18.

Va.  $14^{\circ}30'$  East.

Over rolling land.

0.16 Intersect N.W. boundary of San Fernando Rancho, at a point 92.20 chs. S.  $37^{\circ}59'$  W. from station No. 30, which is a post set firmly in the ground, marked S.F. 30 on S.E. face, with a stone mound, in good order around same, and set a post 4 ft. long, 4 ins. square, with marked stone 12 ins. in the ground, for closing cor. to secs. 13 and 18, marked

C.C. T 2 N on N. R 16 W S 18 on E. and R.17 W. S 13 on W.faces, with 3 notches on S. and N. edges, and raised an earth mound 2 ft. high  $4\frac{1}{2}$  ft. base around post. Pits impracticable, as the cor. falls in the forks of a road.

Land, rolling,

Soil, 2nd rate.

Dense undergrowth of chaparral.

No timber.

September 13th and 14th, 1895.

N. Boundary T.2 N., R.17 W., S.B.M.

From the cor. to Tps.2 and 3 N., Rs.16 and 17 W. I run  
West on true line bet. secs. 1 and 6.

Va.13°40'E.

Ascend.

- 2.00 Top of ridge bears N.E. and S.W. and descend.
- 7.00 Cross gulch, 8 lks wide, course S.W. and ascend.
- 8.60 Top of spur bears N. and S. and descend.
- 10.15 Cross gulch 10 lks. wide, course S. and ascend.
- 16.00 Top of ridge bears NE. and SW. and descend.
- 23.00 Cross gulch 8 lks. wide, course S.W. and ascend.
- 31.50 Top of spur bears N. 60°E. and S.60°W. and descend.
- 40.00 Set a post 3 ft.long, 3 ins.square, with marked stone  
12 ins. in the ground for  $\frac{1}{4}$  sec. cor. marked  $\frac{1}{4}$  S. on N.  
face and raised a stone mound around post.  
Pits impracticable.
- 42.00 Cross cañon 30 lks. wide, course S.40°E. and ascend  
abruptly.
- 55.00 Top of ridge bears N.W. and S.E. and descend.
- 59.15 Cross gulch 6 lks. wide, course N.W. and ascend.
- 80.00 Set a post 4 ft.long, 4 ins. square, with marked stone  
12 ins. in the ground for cor. to secs. 1, 2, 35 and  
36, marked  
T 3 N S 36 on N.E. R 17 W S 1 on S.E.  
T 2 N S 2 on S.W. and S 35 on N.W.faces, with 1  
notch on E. and 5 notches on W.edges, and raised a stone  
mound, around post.  
Pits impracticable.  
Land, rough, broken and mountainous .  
Soil, 3rd rate.  
Scattering oak timber and dense undergrowth of chaparral.

N. Boundary T.2 N., R.17 W., S.B.M.

West on true line bet. secs. 2 and 35.

Va.  $14^{\circ}30'$  East.

Ascend.

- 2.00 Top of ridge bears N.E. and S.W. and descend.
- 12.45 Cross gulch 4 lks. wide, course S. and ascend.
- 57.50 Top of ridge bears N.W. and S.E. and descend.
- 34.08 Cross gulch 4 lks. wide, course S. and ascend.
- 40.00 Set a post 3 ft. long, 3 ins. square, with marked stone 12 ins. in the ground for  $\frac{1}{4}$  sec. cor. marked  $\frac{1}{4}$  S on N. face and raised a stone mound around post.
- Pits impracticable.
- ✓ 46.70 Intersect E. boundary of Rancho Simi, at a point 10 lks. N.  $1^{\circ}20'$  W. of temporary cor. to secs 2 and 35, on bd. of Ro. Simi, and set a post 4 ft. long, 4 ins. square with marked stone 12 ins. in the ground, for closing cor. to Tps. 2 and 3 N., R.17 W. marked
- C.C. R.17 W on E. face; T 3 N. S 35 on N. face and T 2 N S 2 on S. face, with 6 notches on north, south and east faces and raised a stone mound around post.
- Pits impracticable.
- Land, rough, broken and mountainous.
- Soil, 3rd rate.
- Scattering oak timber, and dense undergrowth of chaparral.

Sept. 16 and 17th, 1895.

From the cor. of secs. 3, 4, 33 and 34 on S. boundary of T.2 N., R.17 W., which is a post set firmly in the ground, marked

T 2 N S 34 on N.E. R.17 W S 3 on S.E.

T 1 N S 4 on S.W. and S 33 on N.W. faces, with 3 notches on E. and W. edges, and a stone mound in good order around post, I run

S. Boundary T. 2 N., R. 17 W., S. B. M.

East on a true line bet. secs. 3 and 34.

Va.  $14^{\circ}30'$  East.

Descend.

- 15.19 Intersect boundary of Ro. Ex Mission San Fernando, 21.00  
chs. N.  $11^{\circ}29'$  E. from station No. 34, previously described,  
and set a post 4 ft. long, 4 ins. square, with marked stone  
12 ins. in the ground, for closing cor. to Tps. 1 and 2 N.,  
R. 17 W., marked  
C. C. R. 17 W. on W. T 1 N. S 3 on S. and  
T 2 N S 34 on N. faces, with 6 notches on N. and S. and  
W. edges faces; dug pits 18 x 18 x 12 ins. N., S. and W.  
of post,  $5\frac{1}{2}$  ft. dist. and raised an earth mound 2 ft. high  
 $4\frac{1}{2}$  ft. base around post.  
Land, rolling and broken.  
Soil, 2nd and 3rd rate.  
Scattering oak timber and dense undergrowth of chaparral.

-----  
From the cor. to secs. 3, 4, 33 and 34, I run  
West on true line bet. secs. 4 and 33.

Va.  $14^{\circ}30'$  East.

Ascend.

- 9.00 Top of spur bears N.W. and S.E. and descend.  
24.50 Cross creek, 10 lks. wide, course S.E. and ascend.  
26.52 Cross, road bears N.W. and S.E.  
37.00 Top of spur bears N. and S. and descend.  
40.00 Set a cement gravel stone 20 x 12 x 10 ins. 15 ins. in the  
ground for  $\frac{1}{4}$  sec. cor. marked  $\frac{1}{4}$  on N. face, and raised a  
stone mound alongside.  
Pits impracticable.  
43.50 Intersect E. boundary of Rancho Simi, 7.18 chs. N.W. of  
sandstone set firmly in the ground, marked  $\frac{5}{200}$  on S. and  
S. on W. faces, and set a cement gravel stone 22 x 12 x 10  
ins. 16 ins. in the ground, for closing cor. to Tps. 1 and

S. Boundary T. 2 N., R. 17 W., S. B. M.

2 N., R. 17 W., marked C. C. with 6 notches on east, north and south faces, and raised a stone mound alongside.

Pits impracticable.

Land, mountainous.

Soil, 3rd rate.

Scattering oak timber and dense undergrowth of chaparral.

Sept. 21st, 1895.

Book 380-6 Survey by M. F. Reilly, Deputy Surveyor,  
Contract of November 20, 1884.  
Survey commenced September 19, 1895.  
Survey completed September 27, 1895.

Subdivisions T. 2 N., R. 17 W., S. B. M.

From witness corner to sections 7, 12, 13 and 18, on east boundary of township, which is a post set firmly in the ground marked

W. C. T 2 N S 7 on northeast; R 16 W S 18 on southeast;  
R 17 W S 13 on southwest and S. 12 on northwest faces,  
with 2 notches on north and 4 notches on south edges, and  
a stone mound in good order around post, I run  
(counting distances from true point for corner which falls  
in the center of the county road, 39 links east of witness  
corner.)

West on a true line between sections 12 and 13.

Variation 14° 30' East.

Over rolling valley.

- 19.88 Cross dry wash, 15 lks. wide, course south.  
34.00 Leave valley bears northeast and southwest and ascend.  
39.80 To foot of perpendicular bluff, 60 ft. high, impossible  
to chain and set a post 3 feet long, 3 inches square, with  
marked stone 12 inches on the ground for witness corner  
to quarter section corner, marked W. C. 1/4 S. on north face,  
and raised a stone mound around post.

Pits impracticable.

Thence offset south 1.50 chains to avoid bluff, thence west 4.20 chains, thence north 1.50 chains, thence west on true line, counting distances from true point for corner to sections 7, 12, 13 and 18,

44.00 Top of spur bears north and south and descend.

60.50 Cross gulch, 8 links wide, course south at foot of high sandstone bluff, impossible to chain, offset 1.00 chains south to avoid same, thence west on offset line 8.00 chains, thence north 1.00 chain to true line, thence west, counting distances from true corner to sections 7, 12, 13 and 18.

68.00 Top of spur bears north and south and descend.

80.00 Set a post 4 ft. long, 4 inches square, with marked stone 12 inches in the ground, for corner to sections 11, 12, 13 and 14, marked

T 2 N S 12 on northeast; R 17 W S 13 on southeast;

S 14 on southwest and S 11 on northwest faces,

with 1 notch on east and 4 notches on south edges, dug pits

18 x 18 x 12 inches in each section,  $5\frac{1}{2}$  feet distant and

raised an earth mound, 2 feet high,  $4\frac{1}{2}$  feet base around post.

Land for east 34.00 chains, rolling valley, with second rate soil, remainder rough, broken and mountainous, with third rate soil.

Scattering oak timber and dense undergrowth of chamisal and willow.

September 19, 1895.

West on a true line between sections 11 and 14.

Variation  $14^{\circ}30'$  east.

Descend.

3.10 Cross low sag bears northeast and southwest and ascend.

9.00 Top of spur bears north and south and descend.

18.94 Cross gulch 10 links wide, course south and ascend.

T.2 N., R.17 W., S. B. M.

- 39.00 Top of spur bears north and south and descend.
- 40.00 Set a post 3 feet long, 3 inches square, with marked stone 12 inches in the ground for quarter section corner, marked  $\frac{1}{4}$  S on north face and raised a stone mound around post. Pits impracticable.
- 43.10 Intersect east boundary of Rancho Simi at a point 2.38 chains N.1°20'W. from oak tree, 40 inches diameter, marked S.8 and 7.28 chains N.1°20'W. of a stone corner in good order, marked S.  $\frac{3}{120}$  and set a post 4 feet long 4 inches square, with marked stone 12 inches in the ground, for closing corner to sections 11 and 14, marked C.C.T 2 N R 17 W on east face; S 11 on north and S 14 on south faces, with 2 notches on north and 4 notches on south faces, and raised a stone mound around post. Pits impracticable.
- Land, rough, broken and mountainous.
- Soil, third rate.
- Scattering oak timber and dense undergrowth of chaparral.

September 20, 1895.

From the corner to sections 11, 12, 13 and 14 I run North on a true line between sections 11 and 12.

Variation 14°30' East.

Ascend.

- 24.50 Top of ridge bears northeast and southwest and descend.
- 37.50 Cross road bears east and west.
- 40.00 Set a post 3 feet long, 3 inches square, with marked stone 12 inches in the ground, for quarter section corner marked  $\frac{1}{4}$  S on west face; dug pits 18 x 18 x 12 inches north and south of post; 5 $\frac{1}{2}$  feet distant and raised an earth mound 1 $\frac{1}{2}$  feet high 3 $\frac{1}{2}$  feet base around post.
- 41.00 Cross same road bears east and west.
- 46.00 Cross gulch, 5 links wide, course east and ascend.

- 47.40 Cross same road bears east and west.
- 48.00 William's house bears east 3.40 chains distant.
- 57.50 Top of spur bears northwest and southeast and descend.
- 61.20 Cross gulch 10 links wide, course southeast and ascend.
- 70.00 Top of spur bears east and west and descend.
- 80.00 Set a post 4 feet long, 4 inches square, with marked stone  
12 inches in the ground, for corner to sections 1,2,11 and  
12, marked  
T.2 N. S 1 on northeast; R 17 W S 12 on southeast;  
S 11 on southwest and S 2 on northwest faces,  
with 1 notch on east and 5 notches on south edges, and raised  
a stone mound around post.  
Pits impracticable.  
Land, rough, broken and mountainous  
Soil, third rate.  
Scattering oak timber and dense undergrowth of chaparral.

-----  
East on a random line between sections 1 and 12.

Variation  $14^{\circ}30'$  East.

- 40.00 Set temporary quarter section corner.
- ✓ 79.69 Intersect east boundary of township 48 links south of cor-  
ner to sections 1,6,7 and 12, which is a post set firmly in  
the ground marked  
T 2 N S 6 on northeast; R 16 W S 7 on southeast;  
R 17 W S 12 on southwest and S 1 on northwest faces,  
with 1 notch on north and 5 notches on south edges and a  
stone mound in good order around post.

Thence I run

S.  $89^{\circ}39'$  W. on a true line between sections 1 and 12.

Variation  $14^{\circ}30'$  East.

Ascend.

- 6.50 Cross road bears north and south.
- 30.00 Top of ridge bears N.  $60^{\circ}$  E. and S.  $60^{\circ}$  W. and descend.
- 35.00 A house bears S.  $70^{\circ}$  E. about 13 chains distant.

T.2 N., R.17 W., S. B. M.

- 39.00 Enter valley bears north and south.
- 39.85 Set a post 3 feet long, 3 inches square, 12 inches in the ground for quarter section corner marked  $\frac{1}{4}$  S on north face; from which bears  
 A live oak 14 inches diameter N.62°W. 261 links distant, marked  $\frac{1}{4}$  S B T.  
 No other trees within limits, dug a pit, 18 x 18 x 12 inches east of post, 5 $\frac{1}{2}$  feet distant and raised an earth mound 1 $\frac{1}{2}$  feet high 3 $\frac{1}{2}$  feet base around post.
- 56.40 Cross gulch 6 links wide, course south and continue over rolling valley.
- 61.55 Cross road bears north and south.
- 63.60 Cross gulch 6 links wide, course S.50°E. and continue over valley.
- 67.40 Cross road bears west and southeast and along south side of same.
- X 79.69 The corner to sections 1,2,11 and 12.  
 Land, mountainous for 39.00 chains.  
 Soil, third rate.  
 Land for remaining 40.69 chains rolling valley with second rate soil.  
 Scattering oak timber and dense undergrowth of chaparral.

September 21, 1895.

-----  
 West on a true line between sections 2 and 11.

Variation 14°30' East.

Over rolling valley along south side of road.

- 2.00 W.Lindsay's house bears N.58°W. about 190 links distant.
- 4.00 Cross road bears N.80°E. and S.80°W.
- 5.06 Cross gulch 4 links wide, course south.
- 6.00 A Mexican's house bears south 3.00 chains distant.
- 6.70 Cross road bears northeast and southwest.

- 7.80 Cross gulch, 6 links wide, course south; leave valley, enter dense chaparral bears north and south and ascend.
- 24.00 Top of ridge bears northeast and southwest. And descend.
- 37.03 Cross trail bears northeast and southwest.
- ✓ 40.00 Set a sandstone 30 x 16 x 5 inches, 22 inches in the ground for quarter section corner, marked  $\frac{1}{4}$  on northface and raised a stone mound alongside.
- Pits impracticable.
- 43.00 Cross gulch, 6 links wide, course south and ascend.
- ✓ 44.84 Intersect east boundary of Rancho Simi at a point 7.23 chains N.1°20'W. from stone corner in good order, marked S.  $\frac{5}{200}$  and set a sandstone 22 x 16 x 5 inches 16 inches in the ground for closing corner to sections 2 and 11, marked C.C. with 1 notch on north and 5 notches on south edges and raised a stone mound alongside.
- Pits impracticable.
- Land for east 7.80 chains, rolling valley, second rate soil. Remainder rough and broken, third rate soil. Scattering oak timber and dense undergrowth of chaparral.
- 
- From the corner to sections 1, 2, 11 and 12, I run North on a random line between sections 1 and 2. Variation 14°30' East.
- 40.00 Set temporary quarter section corner.
- ✓ 80.12 Intersect north boundary of Township at a point 17 links east of corner to sections 1, 2, 35 and 36, which is a post set firmly in the ground; marked T 3 N S 36 on northeast; R 17 W S 1 on southeast; T 2 N S 2 on southwest and S 35 on northwest faces, with 1 notch on east and 5 notches on west edges, and a stone mound in good order around post; Thence I run S.0°7'E. on a true line between sections 1 and 2.

T. 2 N., R. 17 W., S. B. M.

Variation  $14^{\circ}30'$  East.

Descend.

- 29.50 Cross gulch 6 links wide, course east and ascend.  
 36.00 Top of ridge bears east and west and descend.  
 40.12 Set a post 3 feet long, 3 inches square, with marked stone  
 12 inches in the ground for quarter section corner marked  
 $\frac{1}{4}$  S on west face and raised a stone mound around post.  
 Pits impracticable.  
 59.40 Mrs. Johnson's house bears east 4.20 chains distant.  
 60.00 Enter valley bears east and west.  
 65.00 Cross trail bears east and west.  
 68.60 Cross gulch 6 links wide, course southwest.  
 79.90 Cross road bears east and west.  
 80.12 The corner to sections 1, 2, 11 and 12.  
 Land, for north 60.00 chains, rough, broken and mountainous,  
 with third rate soil, remainder rolling, second rate soil.  
 Scattering oak timber and dense undergrowth of chaparral.  
 September 22 - 1895.

From the corner to sections 11, 12, 13 and 14, I run

South on a true line between sections 13 and 14.

Variation  $14^{\circ}30'$  East.

Descend.

- 11.20 Cross gulch 10 links wide, course  $S. 20^{\circ} E.$  and ascend.  
 14.37 Top of spur bears east and west and descend.  
 17.80 Cross gulch 10 links wide, course east and ascend.  
 32.50 Top of spur bears east and west and descend.  
 36.70 Enter cultivated land bears northeast and southwest.  
 38.00 Banman's house bears  $N. 36^{\circ} W.$   
 A house bears  $N. 25^{\circ} E.$   
 40.00 Banman's house bears  $N. 43^{\circ} W.$   
 A house bears  $N. 13^{\circ} E.$

Set a post 3 feet long, 3 inches square, 12 inches in the

ground, for quarter section corner, marked  $\frac{1}{4}$  S on west face, from which bears

A live oak 12 inches diameter S.  $88^{\circ}$  E. 388 links distant, marked  $\frac{1}{4}$  S B T.

No other tree within limits.

Dug pit 18 x 18 x 12 inches north of post,  $5\frac{1}{2}$  feet distant and raised an earth mound  $1\frac{1}{2}$  feet high  $3\frac{1}{2}$  feet base around post.

54.20 Cross fence bears east and west, leave cultivated land and ascend.

56.00 Top of spur bears east and west and descend.

62.80 Cross gulch 8 links wide, course east and ascend.

79.00 Cross fence, bears northwest and southeast.

80.00 Set a post 4 feet long, 4 inches square, 12 inches in the ground for corner to sections 13, 14, 23 and 24, marked

T 2 N S 13 on northeast; R 17 W S 24 on southeast;

S 23 on southwest and S 14 on northwest faces, with 1

notch on east and 3 notches on south edges; from which bears

A live oak 6 inches diameter, S.  $4^{\circ}$  W. 145 links distant, marked T 2 N R 17 W S 23 B T.

No other tree within limits.

Dug pits 18 x 18 x 12 inches, in sections 13, 14, and 24,

$5\frac{1}{2}$  feet distant and raised an earth mound 2 feet high,  $4\frac{1}{2}$  feet base around post.

Land, broken and mountainous.

Soil, first and third rate.

Scattering oak timber and dense undergrowth of chaparral.

September 23, 1895.

-----  
East on a true line between sections 13 and 24.

Variation  $14^{\circ}30'$  East.

Descend.

12.00 A cornfield bears north 35 links distant.

T. 2 N., R. 17 W., S. B. M.

17.61 Intersect northwest boundary line of Rancho San Fernando at a point 80.10 chains N. 38° E. from Station No. 31, which is a post set firmly in the ground, marked S.F. 31 on south east face, with a stone mound in good order, around post and set a post 4 feet long, 4 inches square, 12 inches in the ground, for closing corner to sections 13 and 24, marked C C T 2 N R 17 W on west; S 13 on north and S 24 on south faces, with 3 notches on north and south faces, from which bears

A live oak 34 inches diameter N. 38° 38' E. 6 links distant, marked S.F. 4, I further marked tree T 2 N R 17 W S 13 B T.

No other tree within limits.

Raised a stone mound around post. Pits impracticable.

Land, mountainous.

Soil, third rate.

Scattering oak timber and dense undergrowth of chaparral.

From the corner to sections 13, 14, 23 and 24, I run West on a true line between sections 14 and 23.

Variation 14° 30' East.

Ascend.

19.00 Top of spur, bears north and south and descend.

25.25 Cross gulch 10 links wide, course N. 50° E. and ascend.

40.00 Set a post 3 feet long 3 inches square, with marked stone 12 inches in the ground, for quarter section corner, marked  $\frac{1}{4}$  S on north face and raised a stone mound around post.

Pits impracticable.

41.18 Intersect east boundary of Rancho Simi at a point 7.18 links

N. 1° 20' W. from stone corner in good order marked S 1/40 and set a post 4 feet long, 4 inches square, with marked stone

12 inches in the ground for closing corner to sections 14

and 23, marked

C.C.T 2 N R 17 W on east; S 14 on north and S 23 on south faces, with 3 notches on north and south faces, and raised a stone mound around post.

Pits impracticable.

Corner on top of spur bears northeast and southwest.

Land, mountainous.

Soil, third rate.

Scattering oak timber and dense undergrowth of chaparral.

From the corner to sections 13, 14, 23 and 24, I run

South on a true line between sections 23 and 24.

Variation  $14^{\circ}30'$  East.

Ascend.

7.30 Top of spur bears northwest and southeast and descend.

12.70 Cross gulch 4 links wide, course southeast and ascend.

22.53 Intersect northwest boundary line of Rancho San Fernando, at a point 51.50 chains  $N.38^{\circ}E.$  from station No. 31, previously described, and set a post 4 feet long, 4 inches square, 12 inches in the ground for closing corner to sections 23 and 24; marked

C.C.T 2 N R 17 W on north; S 24 on east, and S 23 on west faces, with 1 notch on east and 5 notches on west faces, from which bears

A live oak 16 inches diameter  $S.52\frac{1}{2}^{\circ}W.$  62 links distant; marked T 2 N R 17 W S 23 B T.

A sandstone  $8 \times 6 \times 2\frac{1}{2}$  feet,  $N.9\frac{1}{2}^{\circ}E.$  37 links distant, marked T 2 N R 17 W S 24.

No other tree within limits.

Raised a stone mound around post. Pits impracticable.

Land, mountainous.

Soil, third rate.

Scattering oak timber and dense undergrowth of chaparral.

East on a true line between sections 27 and 34.

Variation  $14^{\circ}30'$  East.

Descend.

- .75 Cross wood road bears north and south.
- 2.00 Cross gulch, 6 links wide, course northeast and ascend.
- 5.00 Top of spur bears north and south and descend.
- 8.75 Cross wood road bears north and south.
- 17.00 A house bears north 8.00 chains distant.
- 24.00 Cross gulch, 3 links wide, course north and ascend.
- 31.44 Intersect west boundary line of San Fernando Rancho at a point 20.57 chains  $S.11^{\circ}29'W.$  from post found at 123.20 chains  $N.11^{\circ}29'E.$  from post and oak stump S.F.3, and set a sandstone 30 x 10 x 8 inches, 22 inches in the ground, for closing corner to sections 27 and 34, marked C.C. with 1 notch on south and 5 notches on north edges, and raised a stone mound alongside.

Pits impracticable.

Land, mountainous.

Soil, third rate.

Scattering oak timber and dense undergrowth of chaparral.

-----  
 From the corner to sections 27, 28, 33 and 34, I run West on a true line between sections 28 and 33.

Variation  $14^{\circ}30'$  East.

Ascend.

- 12.50 Top of spur bears northeast and southwest and descend.
- 24.50 Cross wood road in canyon 30 links wide, course northeast and ascend.
- 33.00 Top of spur bears north and south and descend.
- 35.00 Cross gulch 2 links wide, course south and ascend.
- 40.00 Set a sandstone 24 x 14 x 7 inches, 18 inches in the ground for quarter section corner, marked  $\frac{1}{4}$  on north face and raised a stone mound alongside.

Pits impracticable.

T. 2 N., R. 17 W., S. B. M.

- 43.20 Intersect east boundary of Rancho Simi, at a point 7.18 chains N. 01' W. of a sandstone set firmly in the ground marked  $\frac{7}{280}$  with a stone mound in good order alongside on south and S. on north faces, and set sandstone 24 x 16 x 8 inches, 18 inches in the ground, for closing corner to sections 28 and 33, marked C.C. with 1 notch on south and 5 notches on north edges, and raised a stone mound along side. Pits impracticable.
- Land, mountainous.
- Soil, third rate.
- Scattering oak timber and dense undergrowth of chaparral.

-----

From the corner to sections 27, 28, 33 and 34, I run North between sections 27 and 28.

Variation 14° 30' East.

Ascend.

- 8.00 Top of spur bears east and west and descend.
- 13.05 Cross canyon 30 links wide, course northeast and ascend.
- 13.75 Cross woodroad bears northeast and southwest.
- 22.00 Top of spur bears east and west and descend.
- 29.10 Cross Spring Branch 20 links wide, course northeast and ascend.
- 34.00 Top of spur bears east and west, and descend.
- 40.00 Set a sandstone 24 x 12 x 8 inches, 18 inches in the ground for quarter section corner, marked  $\frac{1}{4}$  on west face and raised a stone mound alongside.
- Pits impracticable.
- 40.50 Cross spring branch 6 links wide, course northeast and ascend.
- 56.50 Top of spur bears northeast and southwest and descend.
- 67.00 Cross spring branch, 8 links wide, course southeast and ascend.
- 72.00 Top of ridge bears east and west and descend.

- 78.50 Cross wood road, bears northeast and southwest and ascend.
- 79.60 Cross Spring Branch, 6 links wide, course southeast and ascend.
- 80.00 Set a sandstone 30 x 16 x 6 inches, 22 inches in the ground for corner to sections 21, 22, 27 and 28, marked with 2 notches on south and 3 notches on east edges, dug pits 18 x 18 x 12 inches, in each section  $5\frac{1}{2}$  feet distant, and raised an earth mound 2 feet high  $4\frac{1}{2}$  feet base alongside.
- Land, mountainous.
- Soil, third rate.
- Scattering oak timber and dense undergrowth of chaparral.

-----

East on a true line between sections 22 and 27

Variation  $14^{\circ}30'$  East.

- 2.00 Cross wood road bears northeast and southwest.
- 6.64 Cross canyon 20 links wide, course northeast and ascend.
- 11.00 Top of ridge bears north and south and descend.
- 22.26 Cross gulch 4 links wide, course north and ascend.
- 25.00 Top of spur bears north and south and descend.
- 33.50 Cross gulch 6 links wide, course north and ascend.
- 35.60 Top of spur bears north and south and descend.
- 40.00 Set a sandstone 20 x 12 x 10 inches, 15 inches in the ground, for quarter section corner, marked  $\frac{1}{4}$  on north face and raised a stone mound alongside.
- Pits impracticable.
- 44.50 Cross canyon, 20 links wide, course  $S.60^{\circ}E.$  and ascend.
- 47.92 Intersect west boundary line of San Fernando Rancho, 16.73 chains  $S.11^{\circ}32'W.$  from station No. 33, which is a post set firmly in the ground, marked S.F. 33 on south face, with a stone mound in good order around same and set a sandstone 20 x 10 x 8 inches, 15 inches in the ground for closing corner to sections 22 and 27, marked C.C. with 2 notches on south and 4 notches on north faces and raised a stone

T 2 N., R 17 W., S.B.M.

mound alongside. Pits impracticable.

Land, mountainous.

Soil, third rate.

Scattering oak timber and dense undergrowth of chaparral.

September 26, 1895.

From the corner to sections 21, 22, 27 and 28, I run

West on a true line between sections 21 and 28.

Variation  $14^{\circ}30'$  East.

Ascend over rolling land.

40.00 Set a sandstone 22 x 12 x 9 inches on top of stone boulder  
30 x 12 x 6 feet, marked  $\frac{1}{4}$  on north face and raised a  
stone mound around corner stone.

Pits impracticable.

43.56 Intersect east boundary line of Rancho Simi, 7.26 chains  
N. 01' W. of a sandstone 15 feet high, marked  $\frac{9}{360}$  on  
south and S. on west faces, and set a sandstone 32 x 21 x 7  
inches, 24 inches in the ground for closing corner to sec-  
tions 21 and 28, marked C.C. with 2 notches on south and 4  
notches on north edges, and raised a stone mound alongside.

Pits impracticable.

Land, rolling and rocky.

Soil, third rate.

Dense undergrowth of chaparral.

No timber.

From the corner to sections 21, 22, 27 and 28, I run  
North between sections 21 and 22.

Variation  $14^{\circ}30'$  East.

Ascend.

4.50 Top of spur bears east and west and descend.

10.00 Cross canyon 10 links wide, course east and ascend.

PS 47

T.2 N., R.17 W. S.B.M.

- 14.00 Top of spur bears east and west and descend.  
 16.50 Cross gulch 4 links wide, course southeast and ascend.  
 19.00 Cross wood road bears east and west.  
 32.82 Intersect boundary line of Rancho Simi 3.52 links east of sandstone set firmly in the ground, marked 1/70 on west and S. on north faces, with a stone mound in good order alongside, and set a sandstone 22 x 12 x 9 inches, 16 inches in the ground, for closing corner to sections 21 and 22, marked C.C. with 3 notches on east and west faces, and raised a stone mound alongside.

Pits impracticable.

Land, rough and broken.

Soil, third rate.

Dense undergrowth of chaparral.

No timber.

-----  
 From the closing corner to sections 22 and 27, on boundary of Rancho San Fernando, I run East on a blank line 32.08 chains, thence north 14.06 chains and intersect boundary line of San Fernando Rancho, 29.48 chains S.85°19'E. from station No.33 on boundary which is a post set firmly in the ground, marked S.F.No.33 on south face, with a stone mound in good order around post, and set a sandstone 30 x 14 x 10 inches, 22 inches in the ground, for closing corner to sections 22 and 23, marked C.C. with 2 notches on east and 4 notches on west edges, dug pits 16 x 18 x 12 inches, north, east and west of stone 5½ feet distant and raised an earth mound 2 feet high, 4½ feet base alongside.

Thence I run

North on a true line between sections 22 and 23.

Variation 14°30' East.

Over broken land.

T. 2 N., R. 17 W., S. B. M.

18.90. Intersect boundary line of Rancho Simi, 3.46 chains east of a sandstone set firmly in the ground, marked  $\frac{3}{120}$  on west and S. on north faces, with a stone mound in good order alongside, and set a sandstone 28 x 17 x 7 inches, 21 inches in the ground, for closing corner to sections 22 and 23, marked C.C. with 2 notches on east and 4 notches on west edges, and raised a stone mound alongside.

Pits impracticable.

Land, rough and broken.

Soil, third rate.

Scattering oak timber and dense undergrowth of chaparral.

September 27, 1895.

---

GENERAL DESCRIPTION.

The land in this portion of the township is generally rough, broken and mountainous, with the exception of a few small valleys in the eastern part and some rolling land near the boundary lines of Rancho San Fernando.

The soil for the most part is third rate, second rate in the valleys.

The township is well watered by numerous small streams and springs.

It is covered with a dense undergrowth of chaparral and there is a scattering growth of oak timber.

There are two houses in section 12, one in section 1, one in section 2, one in section 11, one in section 13, one in section 14, one in section 27.

Numerous roads and trails cross this portion of the township in various directions.

---

EX MISSION OF SAN FERNANDO.

Field Notes of

Final Survey of the Ex Mission Fernando, situated in the county of Los Angeles, State of California, compiled in the U.S. Surveyor General's office, from field notes of the following surveys:

Henry Hancock, of the Ex Mission San Fernando.

Henry Hancock's of the Mission San Fernando, (Church property).

G.H. Thompson's of the Rancho El Encino and

G.H. Thompson of the Rancho Providencia and in accordance with the decree of the District Court of the United States in and for the Southern District of California, dated the 14th day of August, 1865.

x x x x x x x x x x x x x x x

- 30. S.38 W. 272.00 To a dead oak 18 inches diameter, marked S.F.31, station on south east base of the mountain called Santa Susana.  
Thence
- 31. S.39 W. 8.30 To a stake, station.  
Thence
- 32. N.85½ W. 72.00 To a large sandstone, marked S.F.33 imbedded in earth about 9 feet long, 2 feet thick and 3 feet high at the easterly base of a high rocky range called Santa Susana, station, from which a live oak 10 inches diameter bears S.74½°E. 450 links. Thence
- 33 S.12½ W. 182.00 To a stake at intersection of the south boundary of Township 2 North, Range 17 West, of San Bernardino Meridian, 25 chains west of corner to sections 3, 4, 33 and 34.  
203.00 To a live oak 24 inches diameter, marked S.F.34, , from which another oak tree 18

75 50

links, station, thence, along the northern boundary

of a tract of land, El Escorpion, confirmed  
to the Indian, Urbano and others.

X X X X X X X X X X X X X X X X X

-----

-----

-----

-----

-----

-----

-----

-----

-----

-----

-----

-----

-----

-----

-----

-----

-----

-----

-----

-----

-----

-----

-----

-----